

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/11/2024		M57 Pretoria Road - 1619
Inspection Date	06/11/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	FN55CLGP
Model	POLO VIVO 1.4 TRENDLINE 5-DR TIPTRONIC [2011-2015]	Register Number	
VIN	AAVZZZ6SZE021729	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	06/11/2024
Color	SILVER	Power / Displacement	
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	284,741 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Oil Leak	Repair
	Engine Wiring Defective	Repair
	Seat Front Right Torn / Cut	Repair
	Side Mirror Left Damaged	Replace
	Front Bumper Paintwork • Scratched	Repair
	Grill Damaged	Replace
	A • Pillar Right Dented	Repair
	Front Fender Left Paintwork • Dull	Repair
	Front Fender Right Paintwork • Dull	Repair
	Rear Fender Right Paintwork • Dull	Repair
	Door Front Left Dented	Repair
	Door Front Right Residual Traces of Repair	Repair
	Door Rear Right Residual Traces of Repair	Repair
	Rear bumper Residual Traces of Repair	Repair
	Sill Panel Left Damaged	Repair
	Windscreen Chipped	Replace
	Tie Rod End left Damaged	Replace
	Tie Rod End right Cracked	Replace
	Tie Rod left Damaged	Replace
	Shock Absorber Mounting Front Left Damaged	Replace
	Shock Absorber Mounting Front Right Damaged	Replace
	Stabilizer Mounting Front Left Damaged	Replace
	Stabilizer Mounting Front Right Damaged	Replace
	Control Arm Bush(es) Front Axle Left Cracked	Replace
	Control Arm Bush(es) Front Axle Right Cracked	Replace
	Tyre Front Left Excessive Wear & Tear	Replace
	Spare Tyre Excessive Wear & Tear	Replace
	Bolt(s) / Nut(s) Front Wheel Right Missing	Replace

Damage	Repair Way
Engine to silencer pipe Welded	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Both front headlights clips broken, headlights are	Replace
Ignition barrel damage	Replace
Rear and Front tyres size differs.	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.9	-	
Rear	1.9	2.1	-	
Emergency / Parking	1.2	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R14	86T	General	Altimax	V	5020	1 mm
Front Right	175/65R14	82T	Hankook	Centum	V	1409	1 mm
Rear Left	175/65R14	82H	Goodride	Radial	V	0000	2 mm
Rear Right	185/60R14	82H	Goodyear	Efficient	V	0000	1 mm
Spare	175/65R14	82H	Apollo	Alnac	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	COMFORT SYSTEM CENTRAL CONTROL MODULE	00849:025	S CONTROL AT IGNITION STARTER - UNDEFINED SWITCDIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on most body panels. Signs of spray work done on most body panels. Minor dents scratches stone chips on some body panels.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

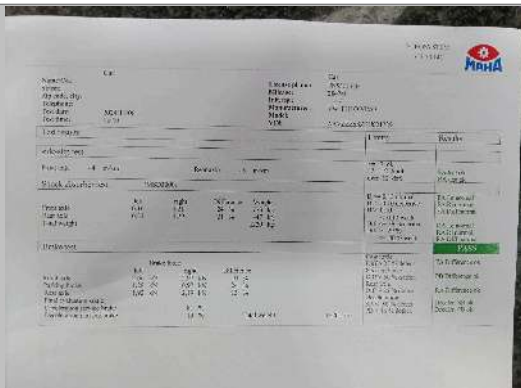

Shock and brake report



Diagnostic test

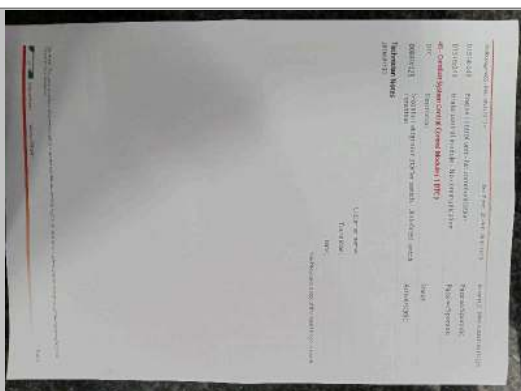

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016601150

VIN: AAVZZZ6SZEU021729

DATE

06/11/2024



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



AUTOMATIC



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

VIN: AAVZZZ6SZEU021729

7 / 16




No license disc



VIN PLATE OR STICKER



ENGINE 1

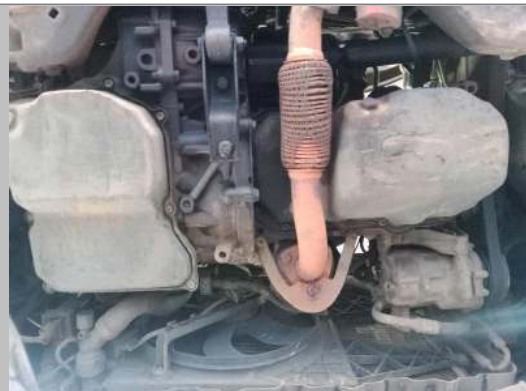

ENGINE 2



CHASSIS



Rear end

VIN: AAVZZZ6SZEU021729

9 / 16



Expansion bottle



Oil cap and dipstick



Ignition barrel



Water light illuminated




L/F headlight is loose



R/F headlight is loose

VIN: AAVZZZ6SZEU021729

11 / 16

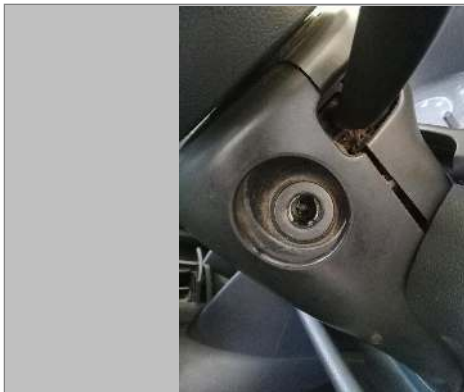

Ignition



Engine

VIN: AAVZZZ6SZEU021729

12 / 16



Engine



Grill



Water level



Shock Absorber Mounting Front Right

VIN: AAVZZZ6SZEU021729

13 / 16



Engine Wiring



Engine Wiring



Engine Wiring



Windscreen



Spare Tyre



Door Front Left

VIN: AAVZZZ6SZEU021729

15 / 16




Door Front Left



Side Mirror Left



Front Fender Left

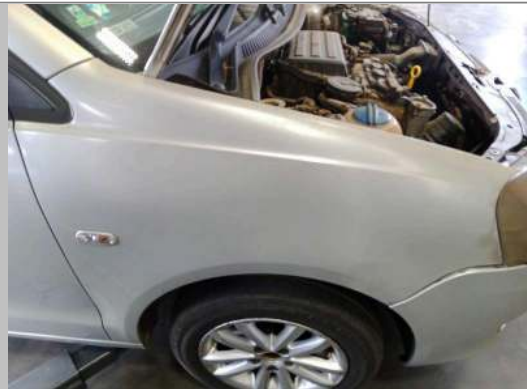

Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right



Bolt(s) / Nut(s) Front Wheel Right



Control Arm Bush(es) Front Axle Right



Tie Rod End right



Stabilizer Mounting Front Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Tie Rod End left



Tie Rod left



Stabilizer Mounting Front Left



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Rear bumper



CV Joint(s) Boot(s) Front Right (inner/outer)



Gearbox



Gearbox



Sill Panel Left



Engine to silencer pipe



A • Pillar Right



Shock Absorber Mounting Front Left



Seat Front Right



CONDITION REPORT

Report No: 2016601150

DATE
06/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za