

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/12/2023		M57 Pretoria Road - 1619
Inspection Date	29/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	MINI BUS	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	JXP681MP
Model	H-1	Register Number	
VIN	KMHWH81KMJU953881	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	188,142 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Oil Sweat	Repair
	Hoses Oil Leak	Repair
	Bonnet stay and shocks Defective	Repair
	Air Conditioner Insufficient	Replace
	Headlight Left Defective	Replace
	Headlight Right Defective	Repair
	Seat Front Left Defective	Repair
	Seat Front Right Damaged	Repair
	Hood Lining Defective	Repair
	Door Handle Rear Left Damaged	Replace
	Door Sealing Rubber Front Right Damaged	Replace
	Boot Panel Left Defective	Repair
	Boot Panel Right Defective	Repair
	Steering Wheel Trim Defective	Repair
	Side Mirror Left Paintwork • Scratched	Repair
	Side Mirror Right Paintwork • Scratched	Repair
	Front Bumper Damaged	Replace
	Bonnet Paintwork • Chipmarks	Repair
	C • Pillar Right Residual Traces of Repair	Repair
	Front Fender Left Damaged	Repair
	Rear Fender Left Residual Traces of Repair	Repair
	Rear Fender Right / Inner Tray Dented	Repair
	Door Front Left Residual Traces of Repair	Repair
	Door Front Right Paintwork • Scratched	Repair
	Door Rear Left Residual Traces of Repair	Repair
	Door Rear Right Dented	Repair
	Rear bumper Paintwork • Scratched	Repair
	Rocker Panel Left Dented	Repair
	Rocker Panel Right Dented	Repair

Damage	Repair Way
Roof Dented	Repair
Windscreen Cracked	Replace
Brake disc 2. Axle right Defective	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Steering Rack Boot Left Damaged	Replace
Shock Absorber Front Left Sweat	Replace
Stabilizer Mounting Front Left Defective	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Gearbox Oil Sweat	Repair
Center Prop Shaft Rubber(s) Cracked	Replace
Triangle Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.79	4.97	-	
Rear	3.39	3.05	-	
Emergency / Parking	2.56	1.39	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65 R16	98H	Westlake	SU318	V	3421	2 mm
Front Right	215/65 R16	98H	Westlake	SU318	V	3521	0 mm
Rear Left	215/65 R16	98H	Westlake	SU318	V	3521	5 mm
Rear Right	215/65 R16	98H	Westlake	SU318	V	3421	4 mm
Spare	215/65 R16	98H	Rapid	Ecosaver	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0532	A/C REFRIGERATOR PRESSURE SENSOR'A' CIRCUIT INPUT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SHOCK ABSORBER TEST COULD NOT BE PERFORMED.

Engine Compartment: Engine bay dirty. Brake fluid level ok. Signs of rodent in engine bay.

Lights: Front left and right park lights not working.

Interior: Vehicle interior dirty and some interior panels scratched.

Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.

Poor residual traces of repair on some body panels. Front left inner fender liner missing and right inner fender liner damaged. Signs of impact damage to front and rear of vehicle.

Tyres and Rims: Alloy rims scratched

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE



CONDITION REPORT

VIN: KAUJW619101623809

Report No: 201623809

2 / 15

DATE

29/12/2023





Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

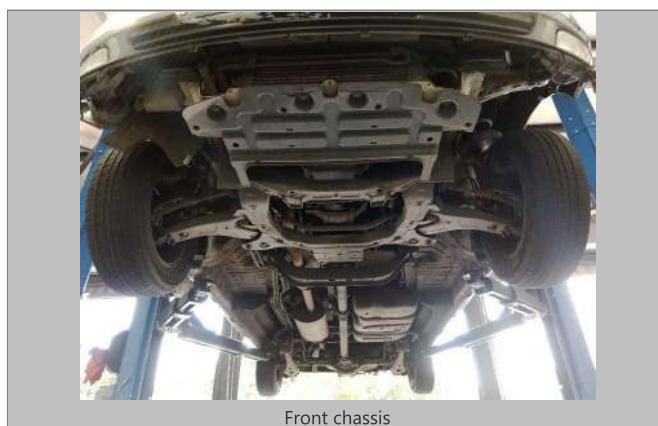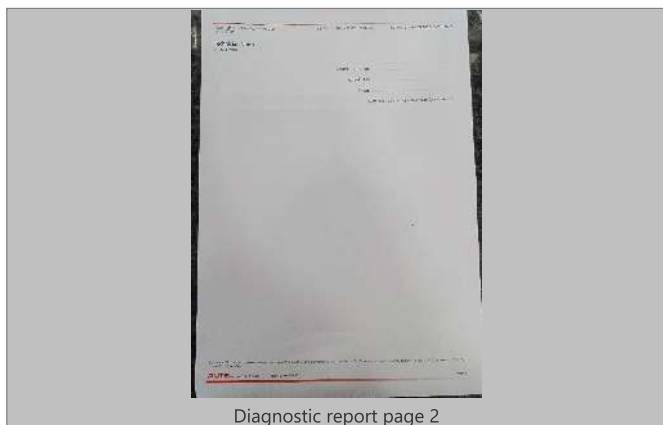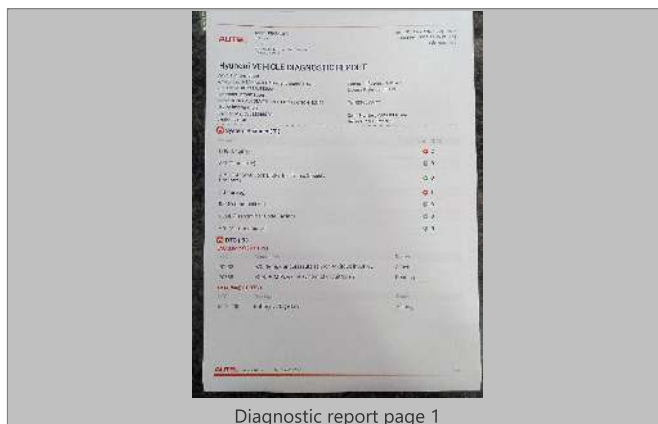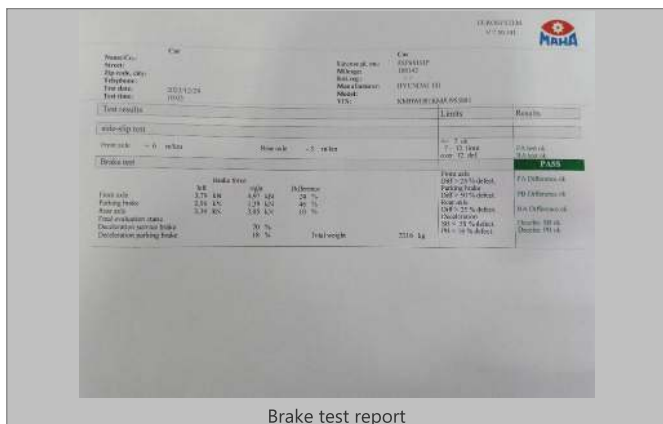



Spare wheel



Rear chassis



Spare wheel Accessories



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

VIN: KMHWH81KMJU953881

6 / 15

VIN: KMHWH81KMJU953881

7 / 15



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: KMHWH81KMJU953881

8 / 15



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

VIN: KMHWH81KMJU953881

10 / 15



ENGINE 1



Front Bumper



Front Bumper



Bonnet



Windscreen



Door Front Right

VIN: KMHWH81KMJU953881

12 / 15



Side Mirror Right



Door Rear Right



Seat Front Right



Door Sealing Rubber Front Right



Steering Wheel Trim



Hood Lining

VIN: KMHWH81KMJU953881

14 / 15



Rear bumper



Rear bumper



Rear bumper



C • Pillar Right



Boot Panel Left



Boot Panel Right



Rear Fender Left



Door Rear Left



Door Handle Rear Left



Door Front Left



Side Mirror Left



Front Fender Left



Water level



Water level



Bolt(s) / Nut(s) Front Wheel Left



Rocker Panel Left



Headlight Left



Headlight Right



Brake disc 2. Axle right



Rocker Panel Right



Tyre Front Right



Tyre Front Right



Gearbox



Engine



Shock Absorber Front Left



Stabilizer Mounting Front Left



Center Prop Shaft Rubber(s)



Tyre Rear Left



Rear Fender Right / Inner Tray



Steering Rack Boot Left



Hoses



Bonnet stay and shocks



Air Conditioner



Seat Front Left



Roof



CONDITION REPORT

Report No: 2016213909

DATE
29/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za