



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	CZ21WYGP
Model	320I AT [2012-2016]	Register Number	
VIN	WBA3B16060NS53148	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2025
Color	SILVER	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	195,272 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories**Items****VEHICLE INSPECTION**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Caps Broken	Replace
Under bonnet insulation cover Damaged	Replace
Tail Light Right Damaged	Replace
Fog Light Front Right Cracked	Replace
Headlight Left Damaged	Replace
Seat Rear Damaged	Replace
Seat Belt Rear Right Defective	Replace
Door Sealing Rubber Rear Right Torn / Cut	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Fuel Flap Defective	Repair
Rocker Panel Left Damaged	Repair
Rocker Panel Right Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Shock Absorber Front Right Leak	Replace
Stabilizer Mounting Front Right Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Damaged	Replace
Engine to silencer pipe Damaged	Repair
Belly plates Defective	Repair
Gearbox Oil Leak	Repair
Fuel Lines Defective	Repair
Engine Noise Excessive	Repair
Body and Exterior	Boot does not open
Front right shock absorber weak	Replace
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Signs of impact damage to rear of vehicle
Undercarriage	Front right jacking point bracket missing
Body and Exterior	Poor residual traces of repair on some body panels
Undercarriage	Bottom of engine fully covered
Body and Exterior	Stone chips and spray work on some body panels
Axle and suspension	Front suspension noisy



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.83	2.65	-	
Rear	2.64	2.87	-	
Emergency / Parking	1.92	1.86	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50 R17	94W	Bridgestone	Potenza	V	2121	1 mm
Front Right	225/50 R17	94W	Bridgestone	Turanza	V	4021	0 mm
Rear Left	225/50 R17	94W	Bridgestone	Potenza	V	4417	0 mm
Rear Right	225/50 R17	94W	Bridgestone	Turanza	V	2619	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DSC	480A11	BRAKE PAD WEAR SENSOR: FRONT AXLE, REPLACE BRAKE PADS	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025

Customer info		Car	
Name:	Car	Model:	BMW 320d
Date:	2016	Vehicle ID:	WBA3B16060NS53148
Reg no:	EF-17-024	Year:	2016
Location:	Johannesburg	VIN:	WBA3B16060NS53148
Technician:		Technician:	
Test results		Results	
Brake test			
Front left	0.16	right	0.11
Front right	0.24		0.19
Total weight		Difference	21 %
		Weight	764 kg
			718 kg
			1483 kg
Shock absorber test		(MSD2000)	
Front left	left	right	Difference
Front right	2.53 kN	2.55 kN	0.5 %
Front left	1.92 kN	1.86 kN	-3 %
Front right	2.64 kN	2.87 kN	8 %
Final evaluation static:			
Deceleration service brake	76 %		
Deceleration parking brake	26 %	Total weight	1483 kg


Brake and shock absorber report

Shock absorber test (MSD2000)			
Front left	left	right	Difference
Front right	2.53 kN	2.55 kN	0.5 %
Front left	1.92 kN	1.86 kN	-3 %
Front right	2.64 kN	2.87 kN	8 %
Final evaluation static:			
Deceleration service brake	76 %		
Deceleration parking brake	26 %	Total weight	1483 kg


Shock absorber readings



Diagnostic report page 1

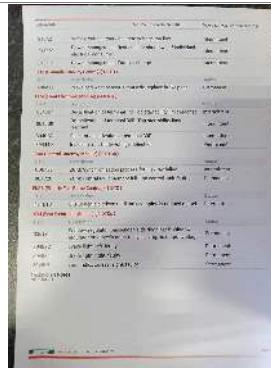

Diagnostic report page 2

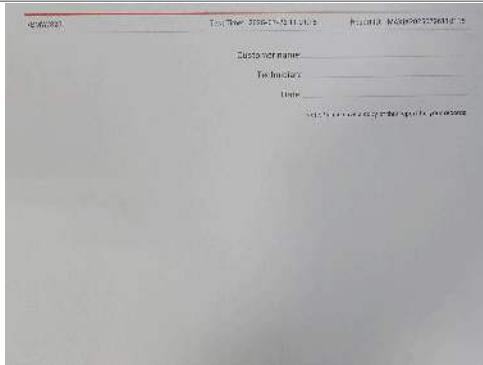

Diagnostic report page 3



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front Chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Oil cap



Oil level



Door Sealing Rubber Rear Right



Seat Belt Rear Right



Seat Rear



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Door Front Right



Door Rear Right



Rear Fender Right



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Roof



Rear bumper



Rear bumper



Rear Fender Left



Door Rear Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Front Bumper



Front Bumper



Bonnet



Grill



Tail Light Right



Fuel Flap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Under bonnet insulation cover



Engine Wiring



Shock Absorber Front Right



Rocker Panel Right



Rocker Panel Left



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Headlight Left



Fog Light Front Right



Tyre Front Right



Stabilizer Mounting Front Right



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Belly plates



Engine to silencer pipe



Tyre Rear Right



Tyre Rear Left



Belly plates



Fuel Lines

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148



CONDITION REPORT



Report No:
2016959304
DATE
26/07/2025



Caps



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3B16060NS53148