



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	17/07/2026		M57 Pretoria Road - 1619
Inspection Date	17/07/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	CJ10NMGP
Model	POLO 1.6 TDI COMFORTLINE DSL 5-DR [2009-2015]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZDU037169	Last COR	
Engine Number		License Expiry Date	30/04/2023
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2013	Fuel	DIESEL
Km Reading	281,541 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Hoses Torn / Cut	Replace
Bonnet cable Damaged	Repair
Windscreen Wiper Missing	Replace
Seat Front Right Torn / Cut	Repair
Sun Visor Right Missing	Replace
Carpet Front Torn / Cut	Repair
Steering Wheel Trim Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Repair
A • Pillar Right Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Welded	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Brake disc 1. Axle left Corrosion	Replace
Brake disc 1. Axle right Corrosion	Replace
Tie Rod End right Damaged	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Ball Joint(s) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Torn / Cut	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Gearbox Oil Sweat	Repair
Drive Shaft Front Right Defective	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cross Member Missing	Replace
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair
Engine Smoke Excessive	Repair
Boot does not open	Repair.
Warning lights illuminated	Repair
Vehicle has no battery.	Replace
Rear tyre size differs	Replace
Front suspension excessive knocking noise	Replace
Driver seat can not be adjusted	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.4	-	
Rear	1.5	1.6	-	
Emergency / Parking	0.8	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92H	Dunlop	Sport	V	4419	0 mm
Front Right	185/65R15	88H	Goodyear	Assurance	V	0421	1 mm
Rear Left	185/60R15	88H	Durun	L919	V	3118	0 mm
Rear Right	195/50R15	82V	Continental	Contact	V	1021	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P067300	CYLINDER 3 GLOW PLUG CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT




Report No:


2017271385

DATE _____


17/07/2026

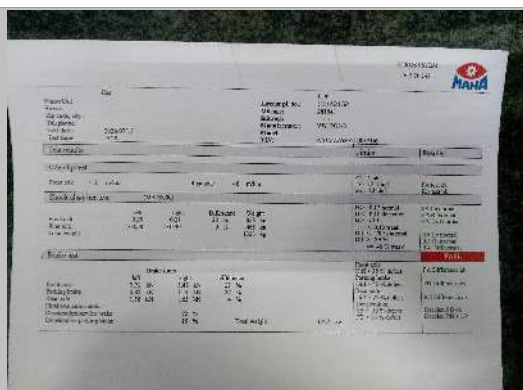


Brake test

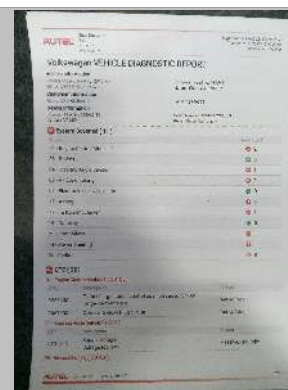

Diagnostic report

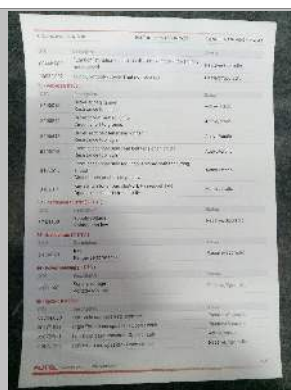

Diagnostic report

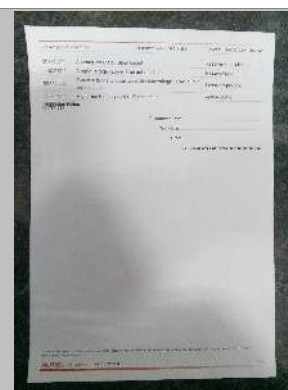

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026




INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

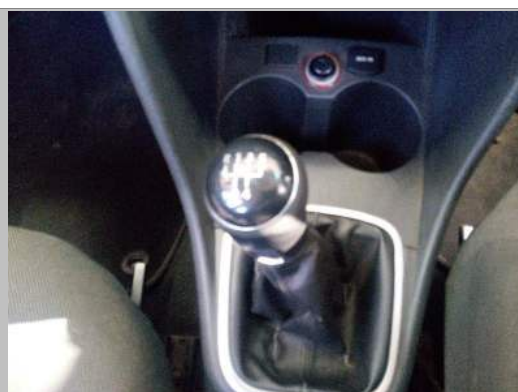

Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT




Report No:

2017271385

DATE

17/07/2026

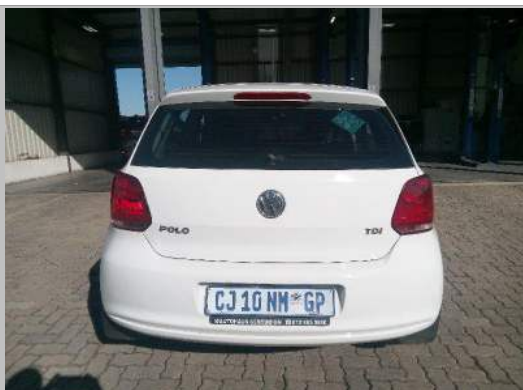

90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

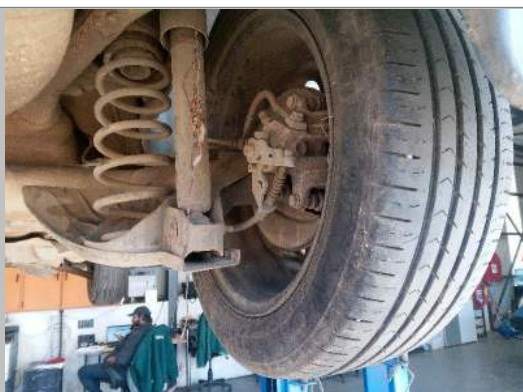

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026



Warning lights illuminated



Warning lights illuminated



Oil cap and dipstick



No battery



Expansion bottle



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026




Sun Visor Right



Carpet Front



Carpet Front

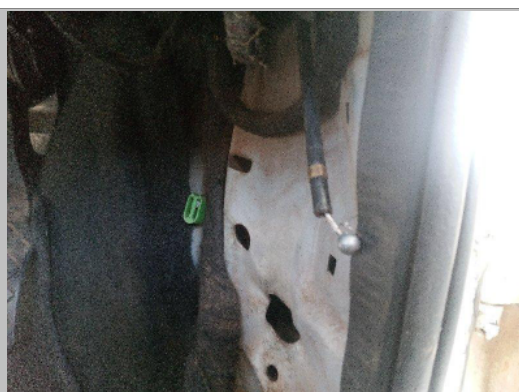

Bonnet cable



A • Pillar Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



A • Pillar Right



A • Pillar Right



Door Front Right



Door Front Right



Door Front Right



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



Door Front Right



Front Fender Right



Windscreen



Door Front Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026




Windscreen Wiper



Door Rear Left



Door Front Left

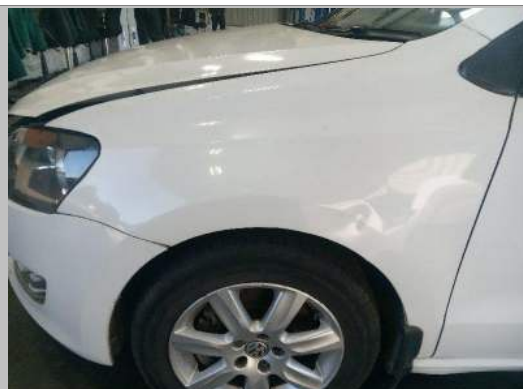

Front Fender Left



Bonnet



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026



Water level



Bolt(s) / Nut(s) Front Wheel Right



Brake disc 1. Axle right



CV Joint(s) Boot(s) Front Right (inner/outer)



Ball Joint(s) Front Axle Right



Stabilizer Mounting Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026



Front Bumper



Front Bumper



Grill



Bolt(s) / Nut(s) Front Wheel Left



Brake disc 1. Axle left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026

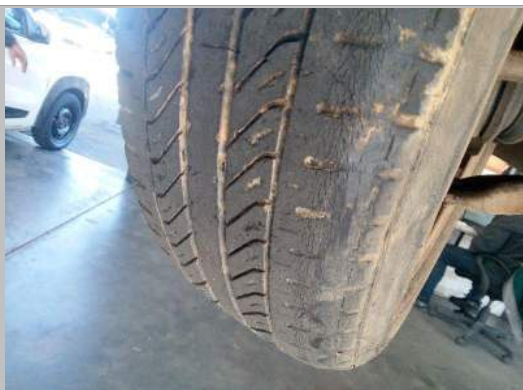

Tyre Front Left



Ball Joint(s) Front Axle Left



Stabilizer Mounting Front Left



Bolt(s) / Nut(s) Rear Wheel Left



Tyre Rear Left



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT




Report No:

2017271385

DATE

17/07/2026

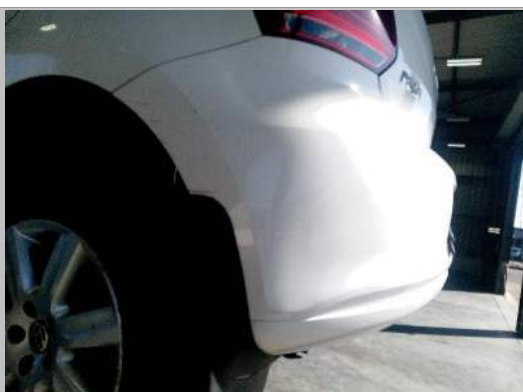

Rear bumper



Rear bumper



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right



Tyre Rear Right



Tie Rod End right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:

2017271385

DATE

17/07/2026



CV Joint(s) Boot(s) Front Right (inner/outer)



Drive Shaft Front Right



Engine



Engine



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



Gearbox



CV Joint(s) Boot(s) Front Left (inner/outer)



Radiator Cross Member



Sill Panel Left



Sill Panel Left



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



Sill Panel Right



Sill Panel Right



Sill Panel Right



Sill Panel Right



Sill Panel Right



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169



CONDITION REPORT



Report No:
2017271385
DATE
17/07/2026



Front Fender Right / Inner Tray



Windscreen Wiper



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZDU037169