

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/05/2025		M57 Pretoria Road - 1619
Inspection Date	26/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KTH593NW
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2018-2019]	Register Number	
VIN	AAVZZZ6RZJU010519	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2024
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	131,795 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Headlight Right Damaged	Repair
Number Plate Rear Missing	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Paintwork • Scratched	Repair
A • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZJU010519

Damage	Repair Way
Roof Dented	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Malfunction	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Cracked	Replace
Gearbox Mountings Defective	Replace
Gearbox Oil Leak	Repair
Radiator Cradle Missing	Replace
Gearbox Noise Excessive	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
EPC light on	Repair
L/F fender liner damage	Repair
Front suspension noisy	Repair
Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.7	-	
Rear	0.3	0.9	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Rapid	Eco809	V	4122	3 mm
Front Right	195/50R15	82V	Velocity	Speed max	V	1919	4 mm
Rear Left	185/60R15	84H	Rapid	Eco809	V	4122	3 mm
Rear Right	185/60R15	84H	Rapid	Eco809	V	4522	3 mm
Spare	185/60R15	84H	Rapid	Eco809	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE/ STATIC	P0300:00/0-0768:000	RANDOM/ MULTIPLE CYLINDER MISFIRE DETECTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZJU010519

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Andrick Wymers


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

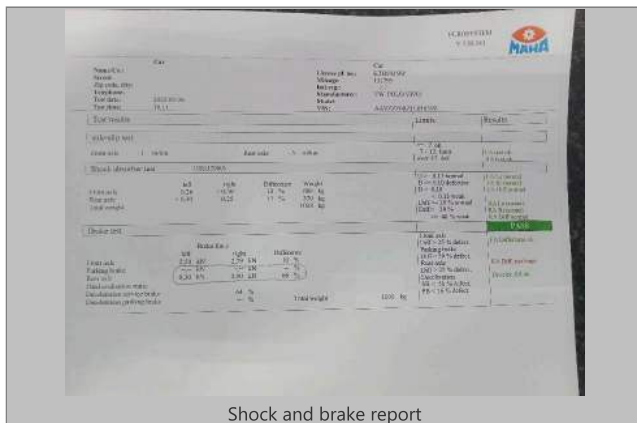

Shock and brake report

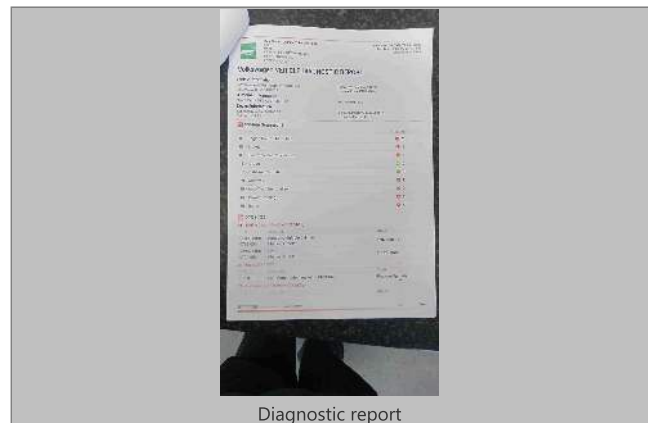

Diagnostic report

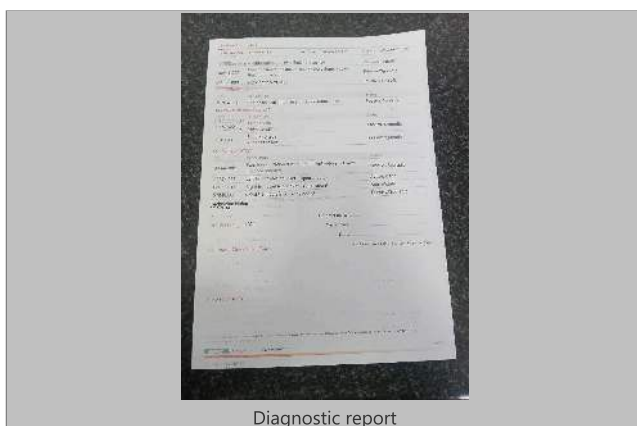

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD




Spare wheel



LICENSE DISC



VIN PLATE OR STICKER

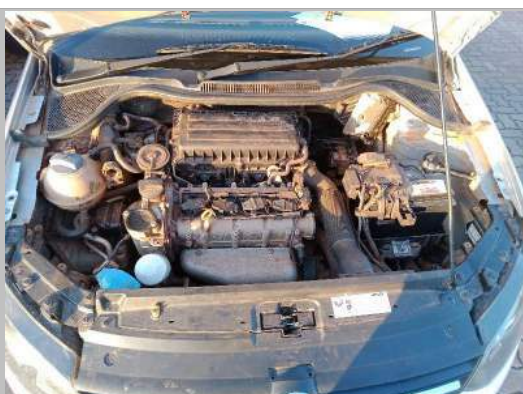

ENGINE 1



ENGINE 2



CHASSIS



Expenditure bottle



Oil cap and dipstick



Water level



Headlight Right

Shock absorber test (MSD3000)			
Front axle	1	m/km	
Rear axle	5	m/km	
Brake test			
Front axle	0.30	> 0.30	
Rear axle	0.26	> 0.30	
Total weight	1035 kg		
Parking Brake Performance			
Front axle	2.50 kN	10 %	
Rear axle	0.90 kN	66 %	
Total weight	64 %		
Deceleration service brake			
Final evaluation state			

Parking Brake Performance

Service Brake Performance Rear Axle			
Front axle	1	m/km	
Rear axle	5	m/km	
Shock absorber test (MSD3000)			
Front axle	0.30	> 0.30	
Rear axle	0.26	> 0.30	
Total weight	1035 kg		
Brake test			
Front axle	2.50 kN	10 %	
Rear axle	0.90 kN	66 %	
Total weight	64 %		
Deceleration service brake			
Final evaluation state			

Service Brake Performance Rear Axle



Bonnet



Windscreen



A • Pillar Left



Number Plate Rear



Side Mirror Right



Side Mirror Left



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door



Rear bumper



Tie Rod End left



Tie Rod End right



Engine



Gearbox



Gearbox



Gearbox Mountings



Radiator Cradle



A • Pillar Right



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZJU010519