



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 22/04/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 22/04/2025        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                               |                         |            |
|-----------------|-----------------------------------------------|-------------------------|------------|
| Vehicle Type    | PASSENGER VEHICLE                             | Registered Owner        |            |
| Manufacturer    | VOLKSWAGEN                                    | Registration Number     | JRC363MP   |
| Model           | POLO VIVO 1.4 55KW TRENDLINE 5-DR [2018-2020] | Register Number         |            |
| VIN             | AAVZZZ6RZKU003178                             | Date Of First Licensing |            |
| Engine Number   |                                               | Last COR                |            |
| Doors           | 5                                             | License Expiry Date     | 31/07/2023 |
| Color           | SILVER                                        | Power / Displacement    |            |
| Year Model      | 2018                                          | Paint Finish            | C - COMMON |
| Km Reading      | 168,869 KM                                    | Fuel                    | PETROL     |
| Cab / Body Type | HATCHBACK                                     | Transmission            | MANUAL     |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

| Damage                                                | Repair Way |
|-------------------------------------------------------|------------|
| Engine Oil Sweat                                      | Repair     |
| Switch Electrical Window Winder front right Defective | Repair     |
| Seat Front Left Torn / Cut                            | Repair     |
| Seat Rear Torn / Cut                                  | Repair     |
| Parcel Tray Missing                                   | Replace    |
| Front Bumper Paintwork • Scratched                    | Repair     |
| Bonnet Paintwork • Chipmarks                          | Repair     |
| Front Fender Left Dented                              | Repair     |
| Front Fender Right Residual Traces of Repair          | Repair     |
| Rear Fender Right Paintwork • Scratched               | Repair     |
| Door Front Left Dented                                | Repair     |
| Door Rear Right Residual Traces of Repair             | Repair     |
| Boot Lid / Hatch door Damaged                         | Repair     |
| Rear bumper Paintwork • Scratched                     | Repair     |
| Stabilizer Mounting Front Left Damaged                | Replace    |
| Control Arm Bush(es) Front Axle Left Cracked          | Replace    |
| Control Arm Bush(es) Front Axle Right Cracked         | Replace    |
| Rim Front Right Scratched                             | Repair     |
| CV Joint(s) Front Left (inner/outer) Damaged          | Replace    |

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178



CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

| Damage                                        | Repair Way |
|-----------------------------------------------|------------|
| CV Joint(s) Front Right (inner/outer) Damaged | Replace    |
| Radiator Cradle Damaged                       | Replace    |
| R/F headlight clips broken headlight is loose | Repair     |

Brakes

Brake Test Results

|                     | Left               | Right              | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] |                  |                                  |
| Front               | 2.8                | 2.7                | -                |                                  |
| Rear                | 1.5                | 1.4                | -                |                                  |
| Emergency / Parking | 0.8                | 0.8                | -                |                                  |

Tyres and Rims

Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model   | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left  | 185/60R15 | 84H              | Continental | Contact | V     | 2220            | 1 mm             |
| Front Right | 185/60R15 | 84H              | Continental | Contact | V     | 2220            | 1 mm             |
| Rear Left   | 185/60R15 | 84H              | Continental | Contact | V     | 2220            | 1 mm             |
| Rear Right  | 185/60R15 | 84H              | Continental | Contact | V     | 2220            | 1 mm             |
| Spare       | 185/60R15 | 84H              | Continental | Contact | V     | 0000            | 1 mm             |

\* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System                       | Code      | Description           | Status |
|----|------------------------------|-----------|-----------------------|--------|
| 1  | ELECTRONICS CENTRAL ELECTRIC | 01598:000 | DRIVE BATTERY VOLTAGE |        |

Inspection Conditions

No Test Drive  
Vehicle doesn't start  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Signs of spray work done on some body panels. Residual traces of poor repair on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge,

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178

**CONDITION REPORT****Report No: 2016850234****DATE**  
**22/04/2025**

operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT


Report No: 2016850234

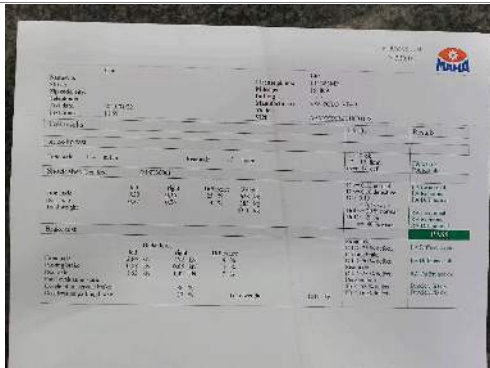DATE  
22/04/2025

Shock and brake report



Diagnostic test

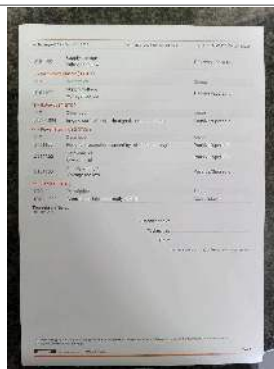

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



tyre no rim

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Oil cap and dipstick



R/F headlight clips broken



Expansion bottle



Water level



Engine



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Seat Front Left



Front Fender Right



Door Rear Right



Rear Fender Right



Seat Rear



Seat Rear

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Boot Lid / Hatch door



Boot Lid / Hatch door



Parcel Tray



Door Front Left



Front Fender Left



Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Rim Front Right



Front Fender Right



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Front Bumper



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



Stabilizer Mounting Front Left



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZKU003178



## CONDITION REPORT

Report No: 2016850234

DATE  
22/04/2025

Rear bumper



Rear bumper



Rear bumper



CV Joint(s) Front Left (inner/outer)



Radiator Cradle



Radiator Cradle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZ6RZKU003178

**CONDITION REPORT**

Report No: 2016850234

DATE  
22/04/2025

Engine



CV Joint(s) Front Right (inner/outer)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU003178