



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	HLF524L
Model	POLO VIVO 1.6 77KW HIGHLINE 5-DR [2018-2020]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZKU014696	Last COR	
Engine Number		License Expiry Date	30/06/2026
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2019	Fuel	PETROL
Km Reading	108,561 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:

2017304590

DATE

29/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Fan Belt Damaged	Replace
Radiator Damaged	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Door Front Left Defective	Repair
Door Front Right Defective	Repair
Door Rear Left Defective	Repair
Door Rear Right Paintwork • Chipmarks	Repair
Boot Lid / Hatch door Defective	Repair
Rear bumper Defective	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Defective	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Rear Left Welded	Replace
Rim Rear Right Scratched	Repair
Engine to silencer pipe Damaged	Repair
Radiator Cradle Damaged	Replace
Front right shock absorber weak	Replace
Deceleration service brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.84	2.1	-	
Rear	1.46	1.47	-	
Emergency / Parking	1.1	1.18	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40 R17	84H	Dunlop	Direzza	V	2821	1 mm
Front Right	205/40 R17	84W	Dunlop	Direzza	V	4721	0 mm
Rear Left	205/40 R17	84W	Dunlop	Direzza	V	4721	1 mm
Rear Right	205/40 R17	84W	Dunlop	Direzza	V	2821	2 mm
Spare	185/60 R14	82H	Goodyear	Excellence	V	0619	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	18011:000	CTRL.MODULE FAULTY	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Computer box strapped with cable ties.Fan Cowley loose.Rust inside expansion bottle.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT




Report No:


2017304590

DATE


29/09/2026

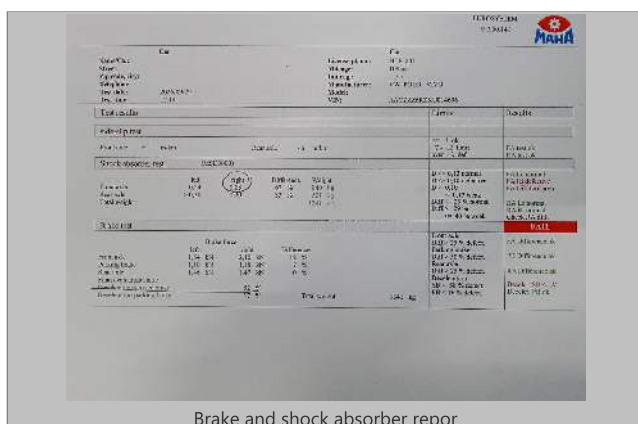


Brake and shock absorber report

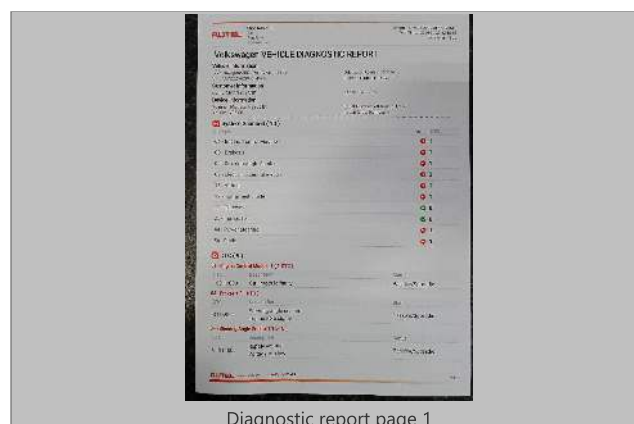

Diagnostic report page 1

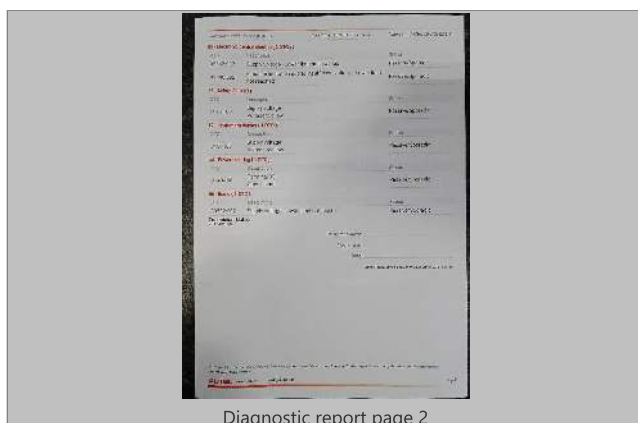

Diagnostic report page 2

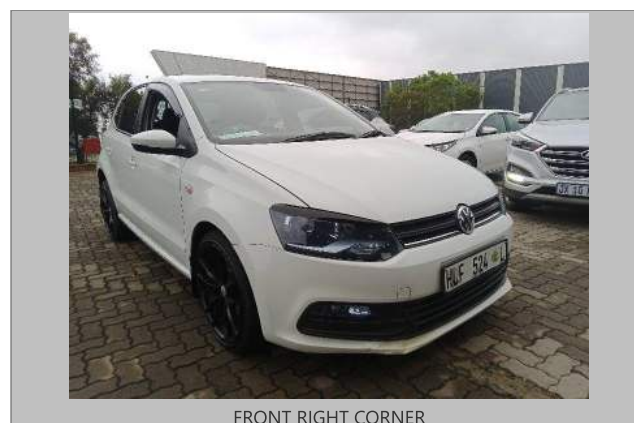

FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:


2017304590

DATE

29/09/2026



LICENSE DISC

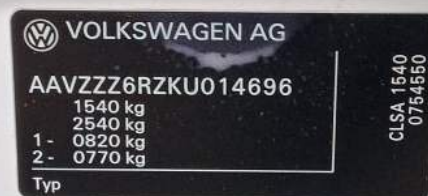

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Hood Lining



Seat Front Right



Seat Rear



Tyre Front Right



Front Fender Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Door Front Right



Door Front Right



Door Rear Right



Door Rear Right



Rim Rear Right



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rim Rear Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:

2017304590

DATE

29/09/2026



Door Rear Left



Seat Front Left



Door Front Left



Door Front Left



Windscreen



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Bonnet



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Front Bumper



Front Bumper



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Sill Panel Right



Engine to silencer pipe



Engine



Tyre Front Right



Radiator



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696



CONDITION REPORT



Report No:
2017304590
DATE
29/09/2026



Radiator Cradle



Water level



Headlight Right



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU014696