



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	MIDI BUS	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JN18HBGP
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZLU014830	Last COR	
Engine Number		License Expiry Date	28/02/2027
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2020	Fuel	PETROL
Km Reading	143,477 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:

2017302938

DATE

23/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Bonnet cable Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Replace
Air Conditioner Insufficient	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Residual Traces of Repair	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
C • Pillar Right Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Replace
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Tie Rod End left Damaged	Replace
Rear Axle Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Damaged	Replace
Chassis Dented	Repair
Sub Frame Damaged	Repair
Engine to silencer pipe Damaged	Repair
Gearbox Oil Leak	Repair
Radiator Cradle Damaged	Repair
Engine Noise Excessive	Repair
Front right shock absorber weak	Replace
Flywheel dust plate dented	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	2.95	-	
Rear	1.72	1.94	-	
Emergency / Parking	0.75	1.41	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	82H	Fronway	Ecogreen	V	4523	0 mm
Front Right	175/65 R14	82H	Fronway	Eco green	V	4523	0 mm
Rear Left	175/65 R14	82T	Annaite	AN600	V	0125	4 mm
Rear Right	175/65 R14	82T	Dunlop	Sp-Sport	V	4621	0 mm
Spare	175/70 R14	84T	Continental	Contipremuim	V	3618	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P1504:00/05380:000	AIR INTAKE SYSTEM LEAK DETECTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Computer box loose.
Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.
Axle and Suspension: Signs of vehicle grabbing.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:

Report No.
2017302938

DATE _____

23/09/2026

[illegible]

Brake and shock absorber test

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:

2017302938

DATE

23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:


2017302938

DATE

23/09/2026



LICENSE DISC

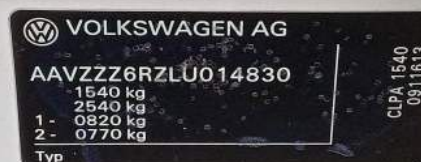


VIN PLATE OR STICKER



ENGINE 1



Front chassis

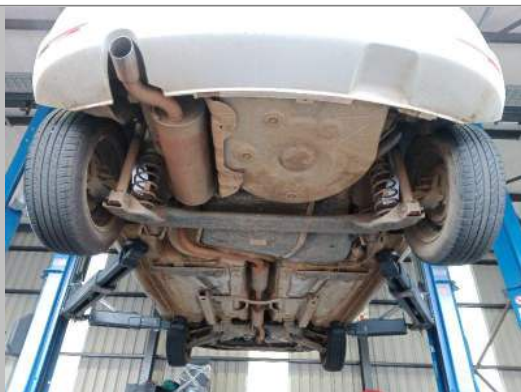

Rear chassis



Flywheel dust plate

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026



Oil cap and dipstick



Center Console / Cubbyhole + Lid



Air Conditioner



Bonnet cable



Seat Front Right



Door Sealing Rubber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026



Seat Rear



C • Pillar Right



Front Fender Right



Side Mirror Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026



Rear Fender Right



Rear Fender Right



Rear bumper



Rear bumper



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830



CONDITION REPORT



Report No:

2017302938

DATE

23/09/2026



Front Fender Left



Front Fender Left



Side Mirror Left



Seat Front Left



Bonnet



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:
2017302938
DATE
23/09/2026



Spare Tyre



Water level



Control Arm Bush(es) Front Axle Right



Radiator Cradle



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:

2017302938

DATE

23/09/2026



Front Bumper



Front Fender Left / Inner Tray



Control Arm Bush(es) Front Axle Left



Sill Panel Left



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT



Report No:

2017302938

DATE

23/09/2026




Tyre Front Right



Tyre Front Left



Tie Rod End left

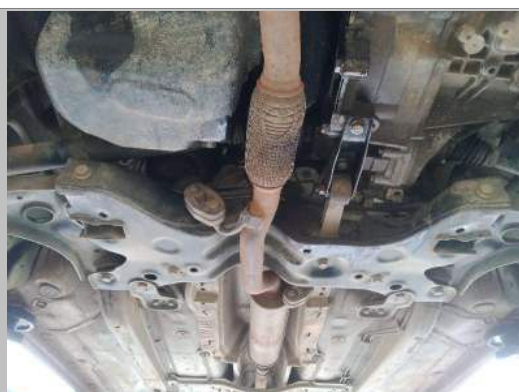

Sub Frame



Sub Frame



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU014830



CONDITION REPORT




Report No:
2017302938
DATE
23/09/2026



Engine to silencer pipe



Chassis

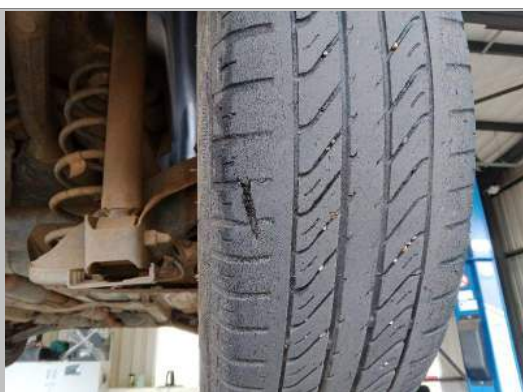

Tyre Rear Right



Rear Axle



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU014830