



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KTZ298NW
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2022-2024]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZPU001844	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	BLUE	Paint Finish	M - METALLIC
Year Model	2022	Fuel	PETROL
Km Reading	83,696 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026

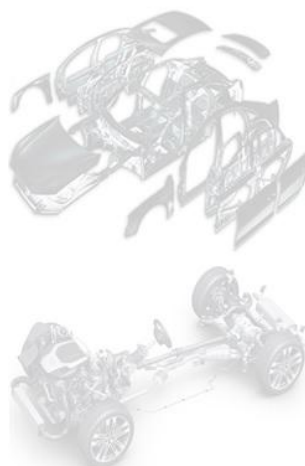

Damage	Repair Way
Engine Wiring Defective	Repair
Switch Electrical Window Winder front right Missing	Replace
Fog Light Front Left Missing	Replace
Number Plate Light Right Missing	Replace
Headlight Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Hood Lining Dirty	Repair
Parcel Tray Missing	Replace
Side Mirror Left Residual Traces of Repair	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Paintwork • Scratched	Repair
A • Pillar Right Residual Traces of Repair	Repair
B • Pillar Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Replace
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Tie Rod End left Cracked	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cross Member Damaged	Repair
Engine Noise Excessive	Repair
Body exterior	Residual traces of poor repair on body panels
Body exterior	Minor dents scratches stone chips on body panels
Body exterior	Signs of spray work done on body panels
Radiator is loose	Repair
Driver electric window not working	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.2	1.9	-	
Rear	2.0	2.1	-	
Emergency / Parking	1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Michelin	Energy	V	0617	0 mm
Front Right	185/65R15	88H	Goodyear	Triplemax	V		0 mm
Rear Left	185/60R15	84H	Continental	Contact	V	4629	1 mm
Rear Right	185/60R15	84H	Michelin	Energy	V	2518	3 mm
Spare	175/65R14	82T	Dunlop	Sport	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	U101100	SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU001844



CONDITION REPORT



Report No:

Report No.
2017303131

DATE _____


25/09/2026



Manual transmission



Expansion bottle

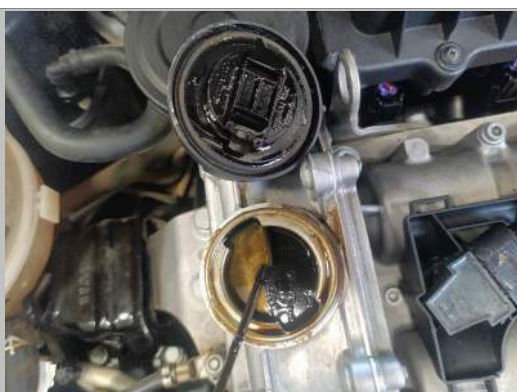

Oil cap and dipstick



Sparewheel

[illegible]

Shock and brake

[illegible]

Diagnostics report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:

2017303131

DATE

25/09/2026



Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU001844



CONDITION REPORT



Report No:

2017303131

DATE

25/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU001844



CONDITION REPORT




Report No:

2017303131

DATE

25/09/2026

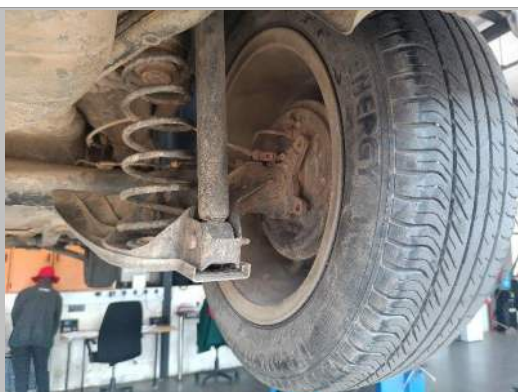

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



REAR



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



ENGINE 2



CHASSIS



Switch Electrical Window Winder front right



Front Fender Right



Side Mirror Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



A • Pillar Right



A • Pillar Right



Roof



Door Rear Right



Rear Fender Right



Hood Lining

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:

2017303131

DATE

25/09/2026



Hood Lining



Parcel Tray



Roof



Door Front Left



Door Front Left



B • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU001844



CONDITION REPORT



Report No:

2017303131

DATE

25/09/2026



Sill Panel Left



Sill Panel Left



Side Mirror Left



Windscreen



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



Seat Front Right



Water level



Headlight Right



Headlight Right



Headlight Right



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:

2017303131

DATE

25/09/2026



Sill Panel Right




Tyre Front Right



Stabilizer Mounting Front Right



Front Bumper

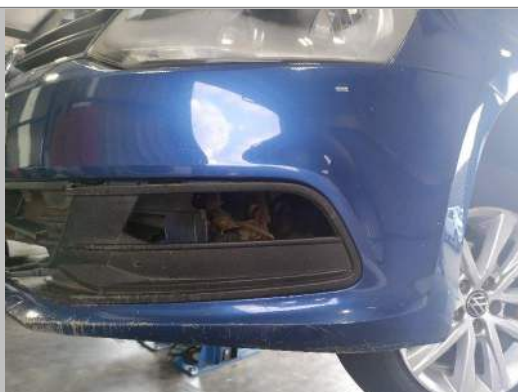

Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



Front Bumper



Grill



Grill



Grill



Fog Light Front Left



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)



Stabilizer Mounting Front Left



Rear bumper



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



Number Plate Light Right



Tie Rod End left



Rim Front Left



Rim Front Left



Rim Front Right



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844



CONDITION REPORT



Report No:
2017303131
DATE
25/09/2026



Radiator Cross Member



Radiator Cross Member



Engine Wiring



Engine Wiring



Sill Panel Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844

**CONDITION REPORT**

Report No:
2017303131
DATE
25/09/2026



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU001844