



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/04/2025		M57 Pretoria Road - 1619
Inspection Date	14/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KX33LXGP
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2022-2024]	Register Number	
VIN	AAVZZZ6RZPU002991	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2025
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	C - COMMON
Km Reading	76,488 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Tail Light Left Damaged	Replace
Dim Light Left Malfunction	Repair
Fog Light Front Right Malfunction	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Pitmarks	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Paintwork • Pitmarks	Repair
Windscreen Cracked	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Left Smooth	Repair
Windscreen washers not working	Repair



DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



## CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.9	2.3	-	
Rear	1.2	0.9	-	
Emergency / Parking	1.1	0.3	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55R16	91V	Continental	Contact	V	0322	3 mm
Front Right	195/55R16	91V	Continental	Contact	V	3822	3 mm
Rear Left	195/55R16	87V	Hilo	Genesys	V	4020	0 mm
Rear Right	195/55R16	91V	Continental	Contact	V	3722	3 mm
Spare	175/70R14	84T	Firestone	Touring	V	0000	2 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE/SPORADIC	U140000	SUPPLY VOLTAGE VOLTAGE TOO LOW	
2	ACTIVE/STATIC	03429:011	ACTIVATION OF RIGHT CORNERING LIGHT- OPEN CIRCUIT	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents. Signs of spray work done on some body panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za


VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025

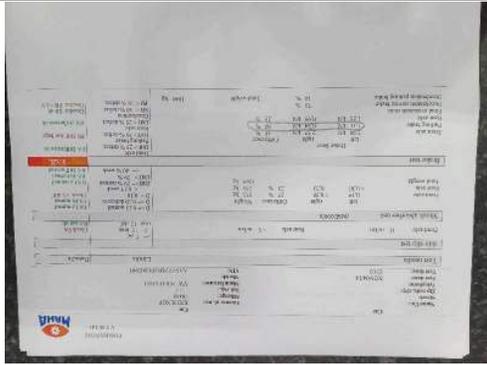


Shock and brake report



Diagnostic report



Diagnostic report

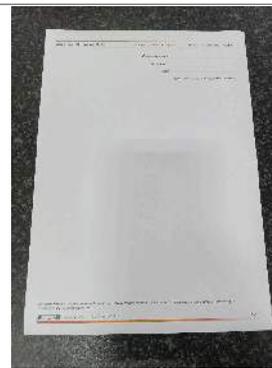

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



Oil cap and dipstick



Expansion bottle

Brake test	
Front axle	2.90 kN
Left	2.57 kN
Right	3.23 kN
Exhaustion	18.7%
Weight	673 kg
Front axle	0.19
Rear axle	-0.20
Total weight	1649 kg
Front axle	11.1%
Rear axle	5.0%
Total weight	23.1%

Shock absorber test (MSD37000)	
Front axle	-11.1 mm/km
Rear axle	-5.0 mm/km

Parking brake performance	
Front axle	0.11 kN
Rear axle	0.96 kN
Exhaustion	69.5%
Weight	576 kg
Front axle	1.25 kN
Rear axle	0.96 kN
Exhaustion	25.0%
Weight	1649 kg

Parking Brake Performance



Water level



Bonnet



Windscreen

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



Tail Light Left



Roof



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



Front Bumper



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991



CONDITION REPORT

Report No: 2016842116

DATE  
14/04/2025



Dim Light Left



Fog Light Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU002991