



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2025		M57 Pretoria Road - 1619
Inspection Date	06/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	DP39DMGP
Model	POLO VIVO GP 1.6 GT 5-DR [2014-2016]	Register Number	
VIN	AAVZZZ6SZFU023316	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2025
Color	WHITE	Power / Displacement	
Year Model	2015	Paint Finish	C - COMMON
Km Reading	176,759 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Fog Light Front Right Missing	Replace
Headlight Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
C • Pillar Left Paintwork • Scratched	Repair
C • Pillar Right Dented	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End left Cracked	Replace
Tie Rod End right Cracked	Replace
Shock Absorber Mounting Front Left Damaged	Replace
Shock Absorber Mounting Front Right Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Damage	Repair Way
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Smooth	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Excessive Wear & Tear	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Body panels	Signs of spray work done on some body panels
Body panels	Minor dents scratches stone chips on some body pan
Body panels	Residual traces of poor repair work on some body p
Some body panels misaligned	Repair
Front suspension excessive noise	Replace
Radiator is loose or not secured	Repair
Warning lights illuminated on cluster	Repair
Driver seat cannot be adjusted	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.9	-	
Rear	1.6	1.2	-	
Emergency / Parking	1.2	0.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Kumho	Solus	V	4111	3 mm
Front Right	185/65R15	92T	Barum	Brillantis	V	0000	0 mm
Rear Left	185/60R15	84H	Zextour	Comfort	V	0123	1 mm
Rear Right	185/65R15	92H	Dunlop	Sport	V	0000	0 mm
Spare	175/65R14	82T	Continental	Control	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P0571:00/01393:000	CRUISE BRAKE SWITCH A CIRCUIT MALFUNCTION	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316

**CONDITION REPORT**

Report No: 2016866298

DATE
06/05/2025**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

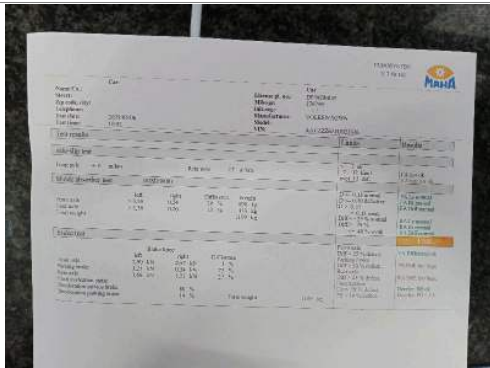DATE
06/05/2025


Shock and brake report



Diagnostic test



Diagnostic test

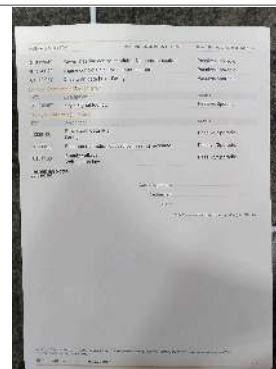

Diagnostic test



Airbag warning lights illumina



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Manual



Oil cap and dipstick



L/F headlight clips broken



ECU



Expansion bottle



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Sparewheel



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

ENGINE 1



Door Front Right



Door Front Right



Door Rear Right



C • Pillar Right



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025


C • Pillar Left



Bonnet



Front Fender Right

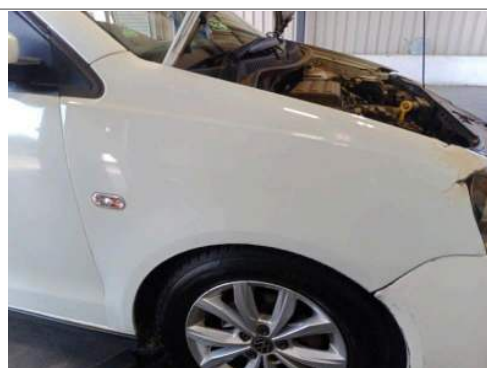

Front Fender Right



Shock Absorber Mounting Front Left



Shock Absorber Mounting Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Engine




Engine



Seat Front Right



Water level

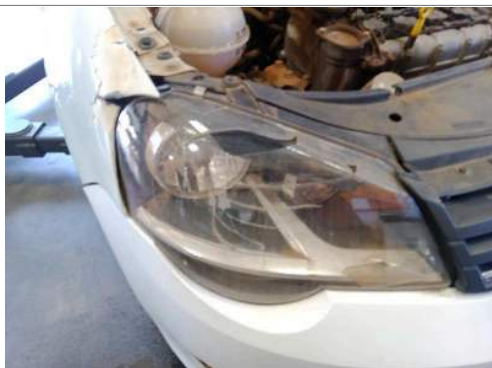

Headlight Right



Bolt(s) / Nut(s) Front Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Tyre Front Right



Control Arm Bush(es) Front Axle Right



Tie Rod End right



Stabilizer Mounting Front Right



Fog Light Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Front Bumper



Front Bumper



Front Bumper



Grill



Bolt(s) / Nut(s) Front Wheel Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025

Stabilizer Mounting Front Left



Tie Rod End left



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right



Rear bumper



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316



CONDITION REPORT

Report No: 2016866298

DATE
06/05/2025



Engine Wiring



Engine Wiring



Tyre Rear Right



Tyre Rear Left

Front axle	+ 6 mm	Rear axle	- 17 mm
Shock absorber test (MSD0000)			
	left	right	Difference
Front axle	> 0.30	0.24	20 %
Rear axle	> 0.30	0.06	13 %
Total weight			1100 kg
Brake test			
	left	right	Difference
Front axle	2.50 kN	2.82 kN	1 %
Parking brake	1.73 kN	0.34 kN	71 %
Rear axle	1.68 kN	1.21 kN	27 %
Final evaluation status		80 %	
Deceleration service brake		1.4 %	
Deceleration parking brake			Total weight

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZFU023316