



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	HR50VXGP
Model	POLO 1.0 TSI 70KW TRENDLINE 5-DR [2018-2020]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZJU063796	Last COR	
Engine Number		License Expiry Date	31/07/2026
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	PETROL
Km Reading	207,572 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026

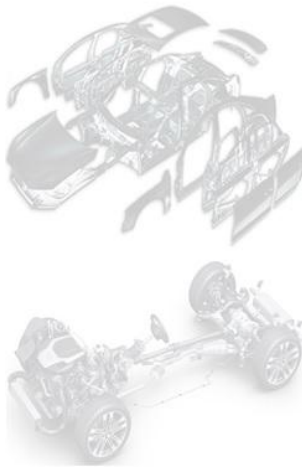

Damage	Repair Way
Engine Water Leak	Repair
Hoses Defective	Replace
Water level Insufficient	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder front left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Headlight Left Defective	Replace
Headlight Right Defective	Replace
Hood Lining Dirty	Repair
Door Panel Front Right Damaged	Repair
Door Panel Rear Left Damaged	Repair
Window Winder rear left Defective	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Replace
Bonnet Residual Traces of Repair	Repair
B • Pillar Right Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Brake disc 1. Axle left Excessive Wear & Tear	Replace
Tie Rod End left Damaged	Replace
Steering Rack Boot Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Spare Tyre Damaged	Replace
Cross Member Rear Left Damaged	Repair
Belly plates Damaged	Replace
Fuel Tank Damaged	Repair
CV Joint(s) Front Right (inner/outer) Defective	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Warning lights illuminated on dashboard	Repair
Aircon condenser dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.18	3.19	-	
Rear	2.28	3.04	-	
Emergency / Parking	1.22	1.87	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70 R14	88T	Firestone	Touring	V	1823	3 mm
Front Right	185/70 R14	88T	Firestone	Touring	V	4923	4 mm
Rear Left	185/70 R14	88H	Continental	Contipremuim	V	2424	4 mm
Rear Right	185/70 R14	88T	Dunlop	Sp-Sport	V	4023	2 mm
Spare	185/70 R14	88H	Falken	Sincera	V	1618	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P029900	TURBOCHARGER/SUPERCHARGER UNDERBOOST	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Signs of oil leak on turbo.

Interior: Front and rear seats fully covered.Vehicle interior dirty and panels scratched.

Body • Exterior: Poor residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.Signs of impact damage to front of vehicle.

Undercarriage: Signs of water leak on bottom of engine.Bottom of engine and gearbox fully covered.Cannot pin direction of water leak.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU063796

**CONDITION REPORT**

Report No:
2017302479
DATE
23/09/2026

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026

Car				Car			
Make/Model	Year	Engine	Transmission	Make/Model	Year	Engine	Transmission
Volkswagen Polo	2017	1.4 TSI	5-Speed	Volkswagen Polo	2017	1.4 TSI	5-Speed
VIN	AAVZZZAWZJU063796			VIN	AAVZZZAWZJU063796		
Test Results				Results			
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI

Brake and shock absorber report

Car				Car			
Make/Model	Year	Engine	Transmission	Make/Model	Year	Engine	Transmission
Volkswagen Polo	2017	1.4 TSI	5-Speed	Volkswagen Polo	2017	1.4 TSI	5-Speed
VIN	AAVZZZAWZJU063796			VIN	AAVZZZAWZJU063796		
Test Results				Results			
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI

Diagnostic report page 1

Car				Car			
Make/Model	Year	Engine	Transmission	Make/Model	Year	Engine	Transmission
Volkswagen Polo	2017	1.4 TSI	5-Speed	Volkswagen Polo	2017	1.4 TSI	5-Speed
VIN	AAVZZZAWZJU063796			VIN	AAVZZZAWZJU063796		
Test Results				Results			
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI

Diagnostic report page 2

Car				Car			
Make/Model	Year	Engine	Transmission	Make/Model	Year	Engine	Transmission
Volkswagen Polo	2017	1.4 TSI	5-Speed	Volkswagen Polo	2017	1.4 TSI	5-Speed
VIN	AAVZZZAWZJU063796			VIN	AAVZZZAWZJU063796		
Test Results				Results			
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI
Brake and Shock Absorber				Brake and Shock Absorber			
Front Left	1.4 TSI	1.4 TSI	1.4 TSI	Front Left	1.4 TSI	1.4 TSI	1.4 TSI
Front Right	1.4 TSI	1.4 TSI	1.4 TSI	Front Right	1.4 TSI	1.4 TSI	1.4 TSI
Rear Left	1.4 TSI	1.4 TSI	1.4 TSI	Rear Left	1.4 TSI	1.4 TSI	1.4 TSI
Rear Right	1.4 TSI	1.4 TSI	1.4 TSI	Rear Right	1.4 TSI	1.4 TSI	1.4 TSI

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU063796



CONDITION REPORT



Report No:

2017302479

DATE

23/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

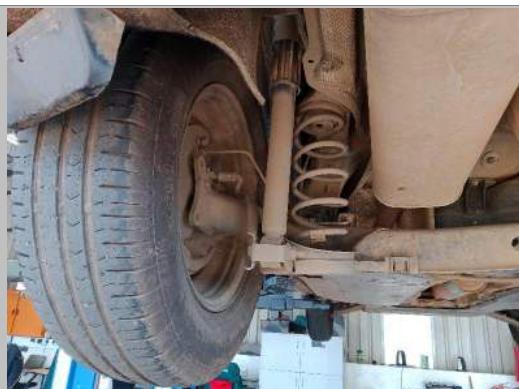

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT




Report No:

2017302479

DATE

23/09/2026

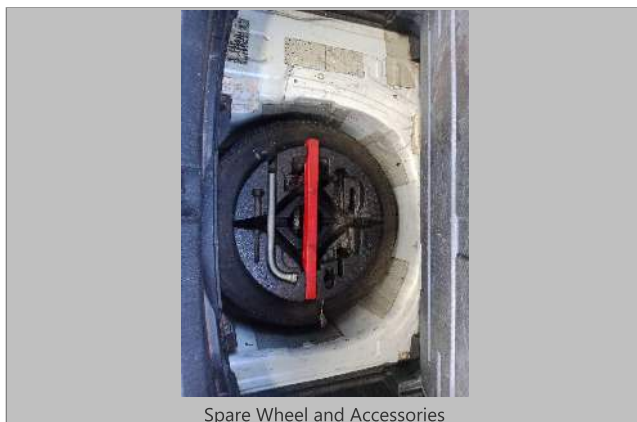


Spare Wheel and Accessories




LICENSE DISC




VIN PLATE OR STICKER

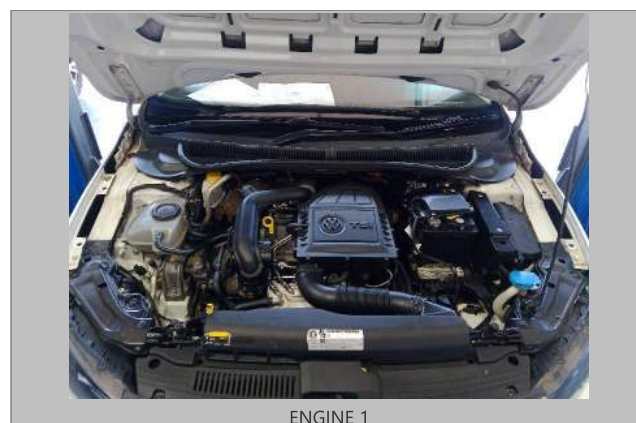

ENGINE 1

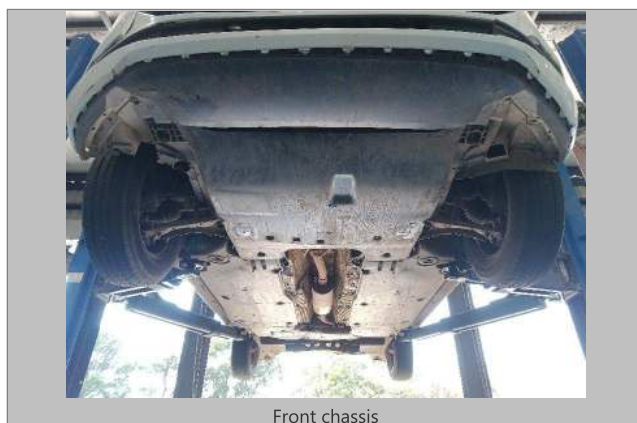

Front chassis

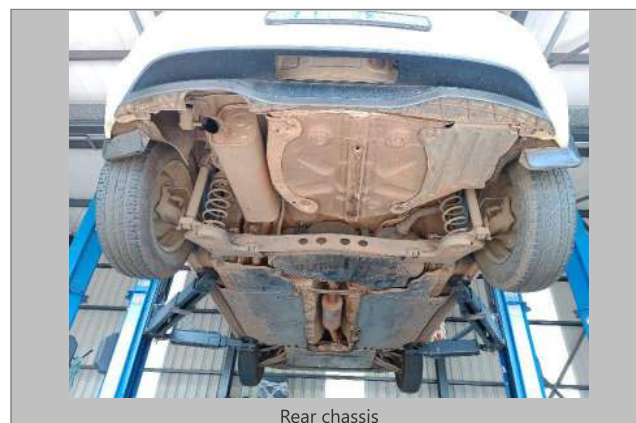

Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:

2017302479

DATE

23/09/2026



Oil cap and dipstick



Aircon condenser



Center Console / Cubbyhole + Lid



Hood Lining



Steering Wheel Trim



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026



B • Pillar Right



C • Pillar Right



Sill Panel Right



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026



Window Winder rear left



Door Panel Rear Left



Switch Electrical Window Winder front left



Rear Fender Left



Door Rear Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026



Front Fender Right



Door Front Left



Bonnet



Side Mirror Right



Spare Tyre



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU063796



CONDITION REPORT



Report No:

2017302479

DATE

23/09/2026



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Radiator Cradle



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT




Report No:
2017302479
DATE
23/09/2026



Headlight Right



Control Arm Bush(es) Front Axle Left

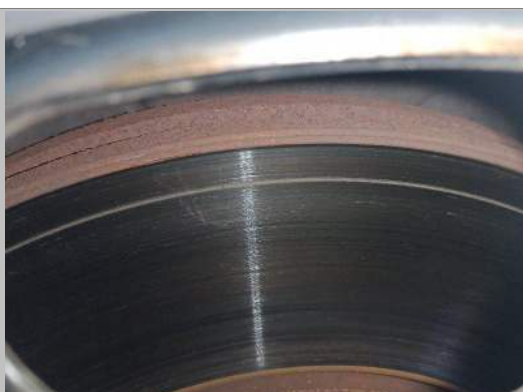

Brake disc 1. Axle left



Sill Panel Left



Sill Panel Left



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT




Report No:
2017302479
DATE
23/09/2026



Belly plates



Belly plates

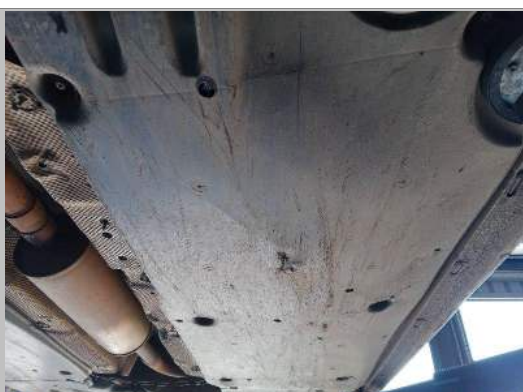

Belly plates



Tie Rod End left



CV Joint(s) Boot(s) Front Left (inner/outer)



Steering Rack Boot Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796



CONDITION REPORT



Report No:
2017302479
DATE
23/09/2026



Engine



CV Joint(s) Front Right (inner/outer)



Cross Member Rear Left



Fuel Tank



Belly plates




Indicator Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796

**CONDITION REPORT**

Report No:
2017302479
DATE
23/09/2026

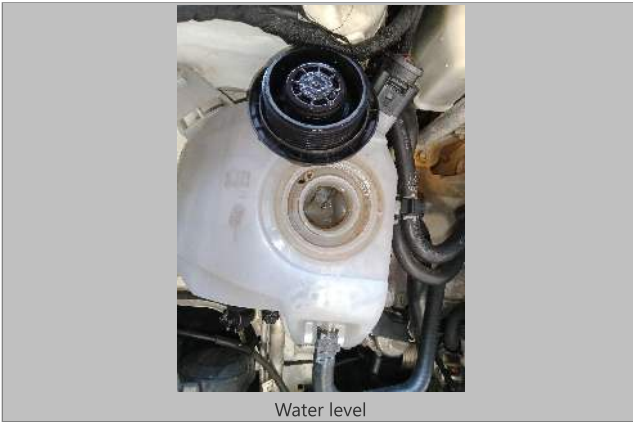

Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU063796