



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/06/2024		M57 Pretoria Road - 1619
Inspection Date	06/06/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	FMC704L
Model	POLO TSI	Register Number	
VIN	AAVZZZAWZKU082438	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2022
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	66,128 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

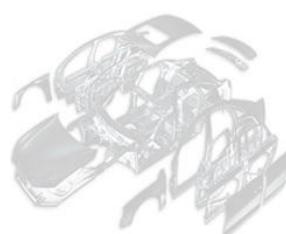

Damage	Repair Way
Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear bumper Damaged	Repair
Body and exterior	Signs of repair work done to somebody panels.
Body and exterior	Poor alignment to somebody panels.
Undercarriage	Bottom of engine and gearbox fully cover.





CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024**Brakes****Brake Test Results**

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.63	2.87	-	
Rear	2.16	2.28	-	
Emergency / Parking	1.32	1.4	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88H	Falken	Radial	V	1319	2 mm
Front Right	185/70R14	88T	Dunlop	Sp	V	1820	3 mm
Rear Left	185/70R14	88T	Dunlop	Sp	V	1820	3 mm
Rear Right	185/70R14	88T	Dunlop	Radial	V	1820	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: AAVZZZAWZK1002432

Report No: 2016407562


2 / 8

DATE


06/06/2024

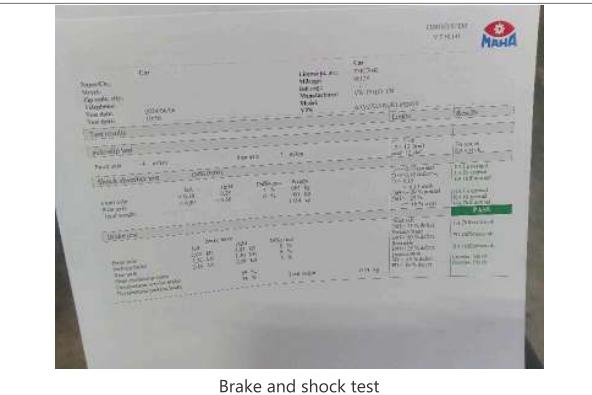


Brake and shock test

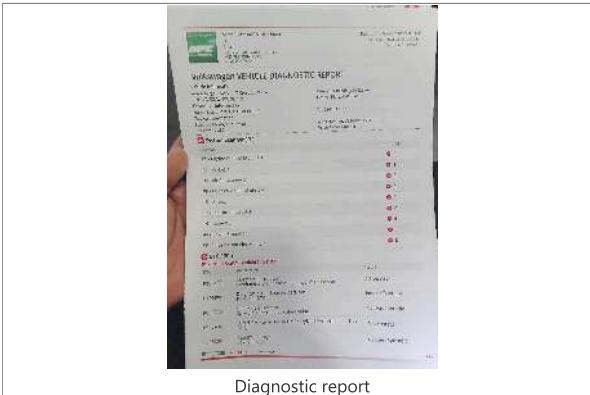

Diagnostic report

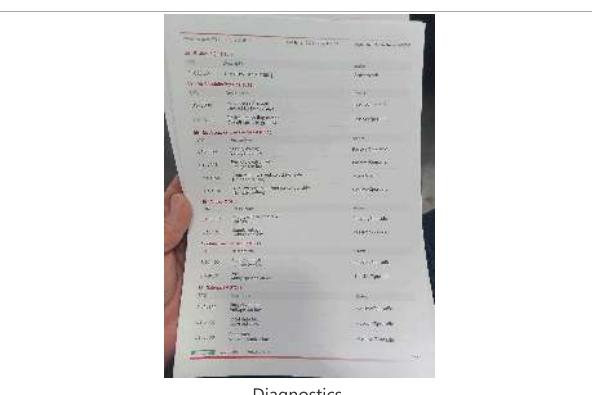

Diagnostics.

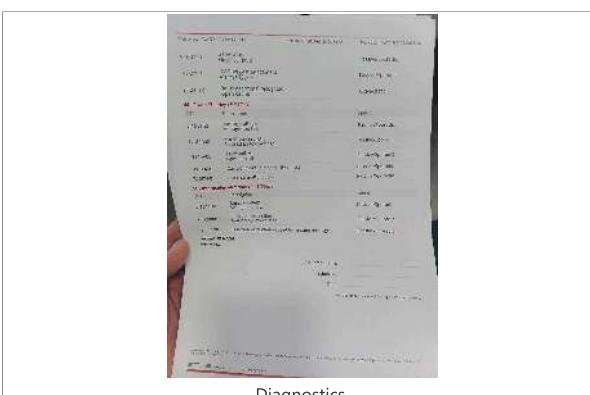

Diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016407562

VIN: AAVZZZAWZKU082438

DATE

06/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016407562

DATE

VIN: AAVZZZAWZKL082438

06/06/2024

4 / 8



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016407562

DATE

06/06/2024

VIN: AAVZZZAWZKU002430

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

VIN: AAVZZZAWZKU082438

6 / 8



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

VIN: AAVZZZAWZKU082438

7 / 8



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

LICENSE DISC

VIN: AAVZZAWZKU082438
8 / 8

ENGINE 1



Undercarriage rear.



Undercarriage front.



Oil cap and dipstick.



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016407562

DATE
06/06/2024

Rear bumper



Engine Management Lights

**CONDITION REPORT**

Report No: 2016407562

DATE
06/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za