



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/05/2024		M57 Pretoria Road - 1619
Inspection Date	15/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	JF35SXGP
Model	POLO TSI	Register Number	
VIN	AAVZZZAWZKU102006	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	124,854 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Air cleaner Defective	Repair
Engine Oil Sweat	Repair
Switch Electrical Window Winder front left Missing	Replace
Switch Electrical Window Winder front right Missing	Replace
Headlight Left Damaged	Replace
Headlight Right Defective	Repair
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Steering Wheel Trim Defective	Repair
Number Plate Front Damaged	Replace
Front Bumper Damaged	Replace
Grill Cracked	Repair
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Replace
B • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU102006

1 / 19



CONDITION REPORT

Report No: 2016379379

 DATE
15/05/2024

Damage	Repair Way
Fuel Flap Damaged	Replace
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Residual Traces of Repair	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Window Rear Door Right Scratched	Repair
Shock Absorber Front Right Defective	Replace
Stabilizer Front Defective	Repair
Alignment Poor Alignment	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Torn / Cut	Replace
Rim Front Left Dented	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Damaged	Repair
Rim Rear Right Damaged	Repair
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Cross Member Rear Right Dented	Repair
Engine to silencer pipe Defective	Repair
Belly plates Defective	Repair
Gearbox Oil Leak	Repair
Fuel Tank Defective	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Defective	Replace
Engine Noise Excessive	Repair
Warning light illuminated on dashboard	Repair
Undercarriage	Oil leak on engine splash plate
Undercarriage	Bottom of engine and gearbox fully covered
Undercarriage	Cannot pin direction of oil leak
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Some body panels misaligned

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.94	3.0	-	
Rear	2.07	2.73	-	
Emergency / Parking	1.4	1.93	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45Z R17	91W	Accelera	PHI-R	V	4122	0 mm
Front Right	215/45 R17	91W	Continental	Contipremuim	V	2720	0 mm
Rear Left	215/45 R17	91W	Continental	Contisport	V	2720	0 mm
Rear Right	215/45Z R17	91W	Duran	M636	V	1420	0 mm
Spare	185/70 R14	88T	Yokohama	Bluearth	V	3919	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: AA4774V6241192006
Report No: 201639319
2 / 19
DATE
15/05/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P227900	INTAKE AIR SYSTEM LEAKAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016379379


VIN: AAVZZZAWZKU102006

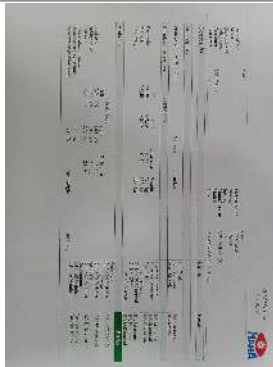DATE
3/10
15/05/2024


Brake and shock absorber repor

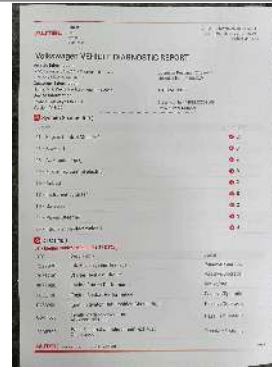


Diagnostic report page 1

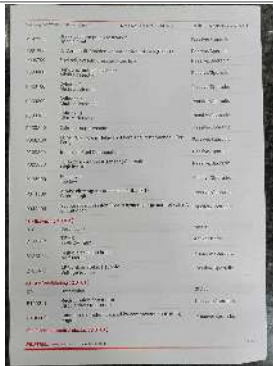

Diagnostic report page 2

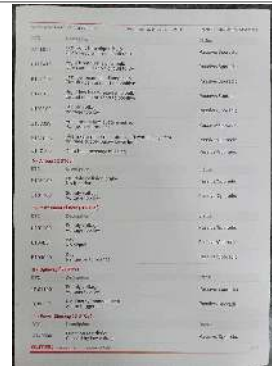

Diagnostic report page 3

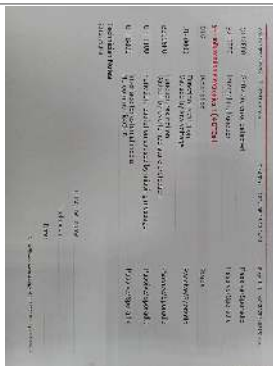

Diagnostic report page 4



FRONT RIGHT CORNER



CONDITION REPORT

Report No: 2016379379

VIN: AAVZZZAW7K10572024
DATE: 15/05/2024
4 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006

5 / 19



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
6 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
8 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024



RF TYRE TREAD



Spare wheel and Accessories

VIN: AAVZZZAWZKU102006
9 / 19



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Rear chassis



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
10 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Front chassis



Oil cap and dipstick

VIN: AAVZZAWZKU102006
11 / 19

Bonnet



Number Plate Front



Headlight Left



Front Bumper



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
12 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Front Bumper



Engine

VIN: AAVZZAWZKU102006

13 / 19



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Front Fender Left / Inner Tray



Hood Lining



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
14 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Steering Wheel Trim



Switch Electrical Window Winder front left

VIN: AAVZZZAWZKU102006

15 / 19



Switch Electrical Window Winder front right



Seat Front Right



Sill Panel Right



Door Front Right



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZAWZKU102006
16 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Front Fender Right



Door Rear Right

VIN: AAVZZZAWZKU102006

17 / 19



Rear Fender Right



Fuel Flap



Sill Panel Right



Seat Rear



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

VIN: AAVZZZAWZKU102006
18 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024



Rear bumper



Rear bumper



Roof



Roof



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Door Front Left



Front Fender Left



Sill Panel Left



B • Pillar Left



Seat Front Left



Window Rear Door Right



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Boot Lid / Hatch door



Rim Front Right



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Rim Front Left



Rocker Panel Left



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Rim Rear Left



Bolt(s) / Nut(s) Rear Wheel Right



Rim Rear Right



Tyre Front Left



Tyre Front Right



Engine



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

CV Joint(s) Boot(s) Front Right (inner/outer)



Engine to silencer pipe



Belly plates



Tyre Rear Left



Tyre Rear Right



Inner Boot Floor Pan and Spare Wheel Well



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Fuel Tank



Cross Member Rear Right



Engine



Gearbox



Front Fender Left / Inner Tray



Shock Absorber Front Right



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

Stabilizer Front



Air cleaner



Headlight Right



Grill



Windscreen



CONDITION REPORT

Report No: 2016379379

DATE
15/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za