



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/10/2026		M57 Pretoria Road - 1619
Inspection Date	01/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	CXR985NC
Model	POLO 1.0 TSI 70KW COMFORTLINE 5-DR [2020-2022]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZMU011920	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	SILVER	Paint Finish	TWO COAT UNI
Year Model	2020	Fuel	PETROL
Km Reading	85,632 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026

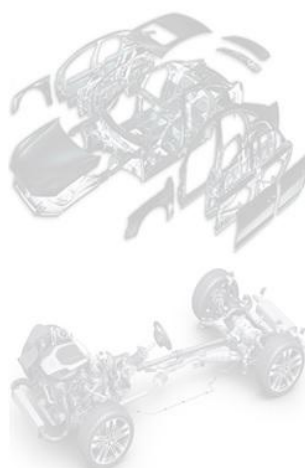

Damage	Repair Way
Engine Wiring Damaged	Replace
Caps Missing	Replace
Hoses Damaged	Replace
Fan Belt Damaged	Replace
Radiator Damaged	Repair
Water level Insufficient	Repair
Air conditioner pump Damaged	Repair
Air conditioner pipes Damaged	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Right Damaged	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Wheel Cylinder / Caliper 2. Axle left Leak	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Engine mountings Damaged	Replace
Gearbox Mountings Damaged	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Rear and Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.45	2.29	-	
Rear	1.47	2.77	-	
Emergency / Parking	0.65	1.58	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/50R17	93W	Durun	Radial	V	3823	0 mm
Front Right	205/55R17	91V	Hankook	Radial	V	4921	0 mm
Rear Left	225/45R17	94W	Xcent	Radial	V	1221	2 mm
Rear Right	205/50R17	88V	Goodyear	Efficient	V	3719	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODEL 1	P019700	OIL TEMPERATURE SENSOR SHORT CIRCUIT TO GROUND	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 79 DTC'S AT TIME OF TESTING SEE DTC REPORT. Engine Compartment: Foreign substance on oil filler cap. Battery loose. Electrical Components and Instruments: vehicle electronics malfunctioning.
Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Vehicle body in poor condition. Signs of impact damage to front of vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU011920



CONDITION REPORT




Report No:


2017306222

DATE _____


01/10/2026

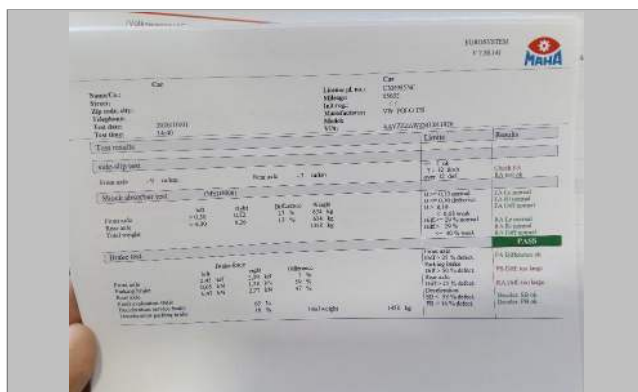


Brake test.

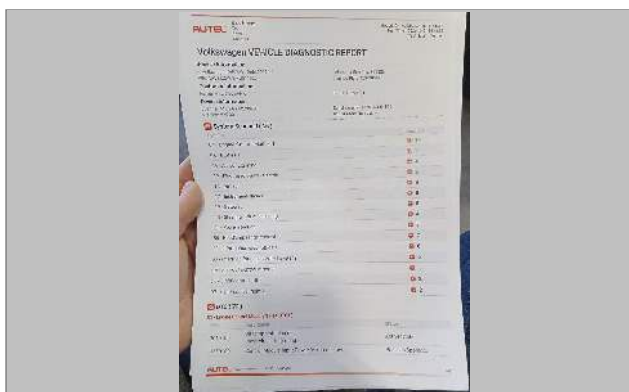


Diagnostic.

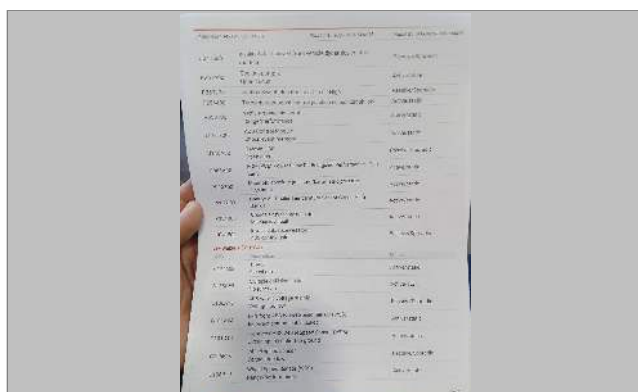


Diagnostic.

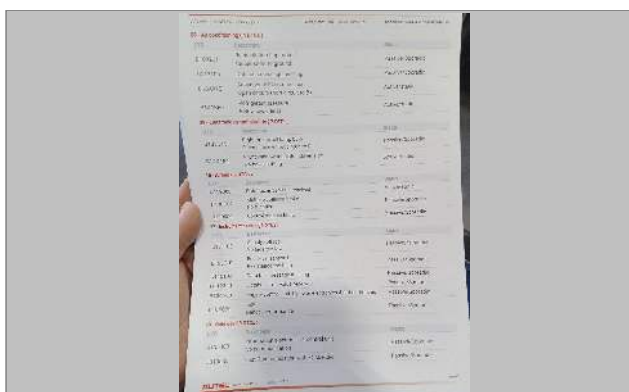

Diagnostic.

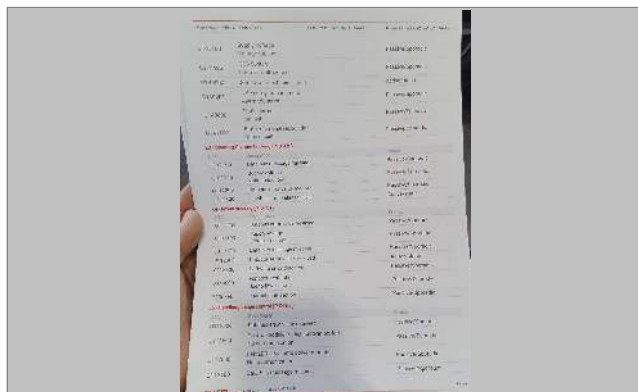

Diagnostic.

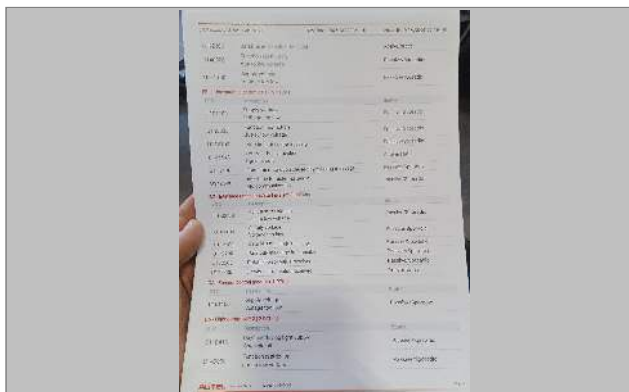

Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026

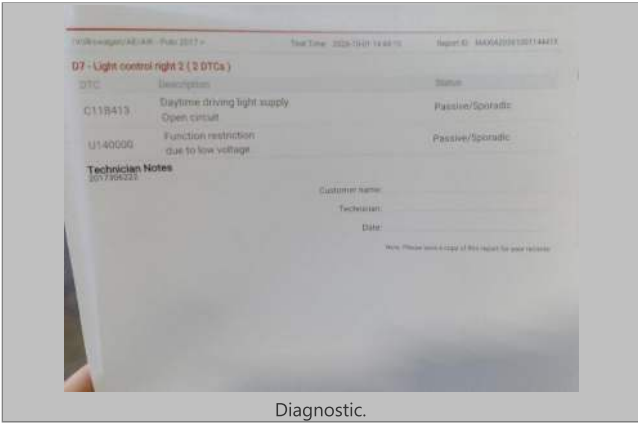

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026

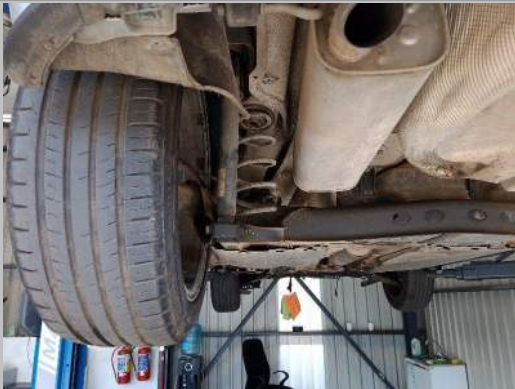

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No license disc



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU011920



CONDITION REPORT



Report No:

2017306222

DATE

01/10/2026



Undercarriage rear.



Undercarriage rear.



Oil cap and dipstick.



Water level



Water level



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Engine mountings



Radiator



Hoses



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU011920



CONDITION REPORT



Report No:

2017306222

DATE

01/10/2026



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Door Rear Right



Door Front Right



Rear Fender Right



Front Fender Right



Windscreen



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Tail Light Left



Headlight Right



Seat Front Right



Hoses



Hoses



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:

2017306222

DATE

01/10/2026



Air conditioner pipes



Caps



Air conditioner pump



Gearbox Mountings



Tyre Front Left



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Tyre Rear Right



Wheel Cylinder / Caliper 2. Axle left



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



Gearbox



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU011920



CONDITION REPORT



Report No:
2017306222
DATE
01/10/2026



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU011920