



CONDITION REPORT



Report No:
2017305926
DATE
01/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/10/2026		M57 Pretoria Road - 1619
Inspection Date	01/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	NONE
Model	POLO 2.0 TSI 147KW GTI 5-DR DSG [2020-2022]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZMU030795	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	RED	Paint Finish	TWO COAT UNI
Year Model	2020	Fuel	PETROL
Km Reading	131,282 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU030795



CONDITION REPORT



Report No:

2017305926

DATE

01/10/2026

Damage

Repair Way

Engine Oil Leak	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Left Residual Traces of Repair	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle right Excessive Wear & Tear	Replace
Shock Absorber Front Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Tyre Front Left Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Rim Front Left Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Belly plates Damaged	Repair
Warning light illuminated on dashboard	Repair
Vehicle license disk missing	Replace
Spare wheel missing	Replace
Front tyres size differs	Replace
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.52	3.73	-	
Rear	2.56	2.81	-	
Emergency / Parking	1.27	1.54	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/40 R18	92W	Symmetry	SY400	V	0723	1 mm
Front Right	T125/60 R18	94M	Linglong	Temporary	V	0320	2 mm
Rear Left	215/40Z R18	89W	Winrun	Radial	V	1521	0 mm
Rear Right	225/45Z R19	95W	Wanli	Sport	V	3219	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AAVZZZAWZMU030795



CONDITION REPORT



Report No:

2017305926

DATE

01/10/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P253500	IGNITION SWITCH RUN/START POSITION CIRCUIT HIGH	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BOTTOM OF ENGINE AND GEARBOX FULLY COVERED.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795



CONDITION REPORT



Report No:

2017305926

DATE

01/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795



CONDITION REPORT



Report No:

2017305926

DATE

01/10/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic Transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



NO LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU030795



CONDITION REPORT




Report No:
2017305926
DATE
01/10/2026



ENGINE 1



Front chassis

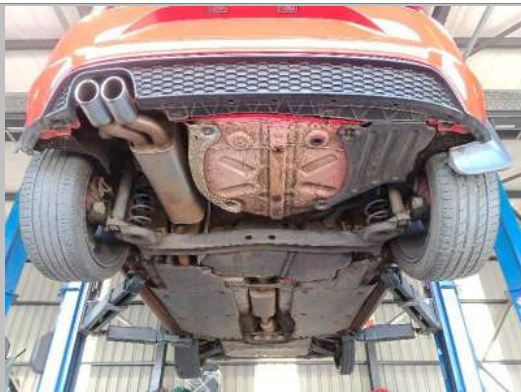

Rear chassis



Oil cap and dipstick



Spare wheel Accessories



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795



CONDITION REPORT



Report No:

Report No.
2017305926

DATE _____

01/10/2026



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

[illegible]

Brake and shock absorber repor



Diagnostic report page 1



Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZMU030795



CONDITION REPORT



Report No:
2017305926
DATE
01/10/2026

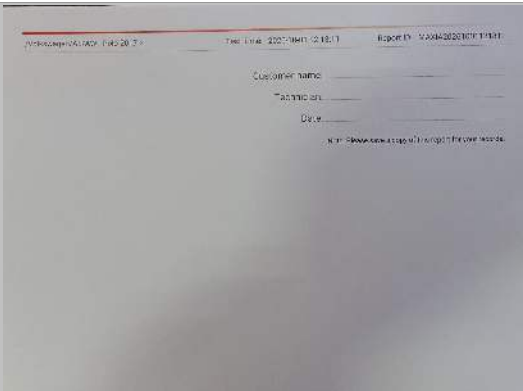

Diagnostic report page 3



Seat Front Right



B • Pillar Left



Seat Front Left



Seat Front Left



Rim Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU030795



CONDITION REPORT



Report No:
2017305926
DATE
01/10/2026



Rim Rear Left



Windscreen



Rim Rear Right



Door Rear Right



Front Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZAWZMU030795



CONDITION REPORT



Report No:
2017305926
DATE
01/10/2026

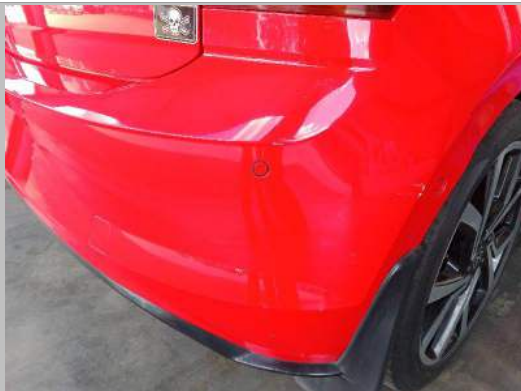

Rear bumper



Rear Fender Left



Bonnet



Bonnet



Water level



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795



CONDITION REPORT



Report No:

2017305926

DATE

01/10/2026



Brake disc 1. Axle right



Control Arm Bush(es) Front Axle Left



Tyre Front Left



Front Bumper



Front Bumper



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795




CONDITION REPORT



Report No:
2017305926
DATE
01/10/2026



Tyre Rear Right

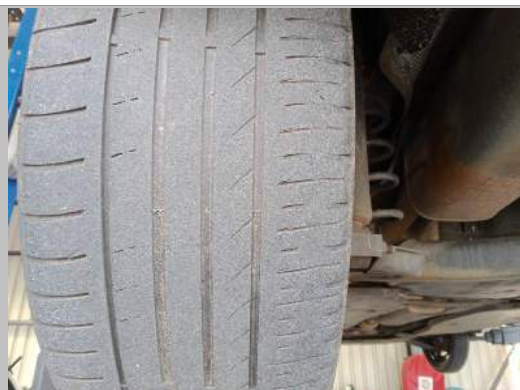

Tyre Rear Left



Belly plates



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZMU030795