



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	DXX836L
Model	KB250 HO HR D-CAB DSL PU [2016-2018]	Register Number	
VIN	ACVNRCHR9H4003060	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/04/2026
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT UNI
Km Reading	388,575 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

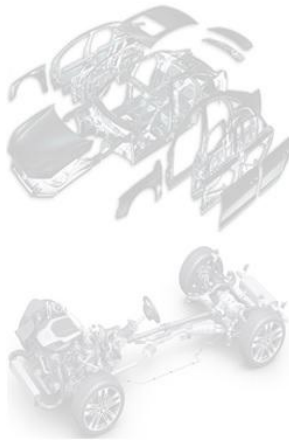

Damage	Repair Way
Engine Wiring Defective	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder front right Damaged	Replace
Air Conditioner Insufficient	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Number Plate Light Left Defective	Repair
Number Plate Light Right Defective	Repair
Headlight Left Defective	Replace
Headlight Right Defective	Repair
Seat Front Right Defective	Repair
Hood Lining Dirty	Repair
Door Panel Rear Right Defective	Repair
Carpet Front Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
A • Pillar Left Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair
Front Fender Right Dented	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Fuel Flap Defective	Repair
Rocker Panel Left Paintwork • Scratched	Repair
Rocker Panel Right Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Load Body Dented	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Spring Rear Left Defective	Repair
Spring Rear Right Defective	Repair
Shock Absorber Front Right Leak	Replace
Ball Joint(s) Front Axle Left Defective	Replace
Mounting Rubber(s) Rear Axle Left Damaged	Replace
Mounting Rubber(s) Rear Axle Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Catalytic converter Missing	Replace
Gearbox Oil Sweat	Repair
Differential Oil Sweat	Repair
Center Prop Shaft Rubber(s) Cracked	Replace
4x4 Differential Lock Insufficient	Repair
Engine	Oil leak on intercooler
Undercarriage	Vehicle undercarriage dirty

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

Damage

Undercarriage
Undercarriage
Interior
Body and Exterior
Body and Exterior
Warning light illuminated on dashboard

Repair Way

Bottom of engine and gearbox covered
Gear lever worn
Vehicle interior dirty and some panels scratched
Dents and scratches on some body panels
Bonnet shield loose
Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.51	3.85	-	
Rear	3.01	0.68	-	
Emergency / Parking	2.7	1.04	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60 R18	110T	Continental	Crosscontact	V	2319	1 mm
Front Right	265/60 R18	110T	Continental	Crosscontact	V	2319	1 mm
Rear Left	265/60 R18	110T	Continental	Crosscontact	V	1621	3 mm
Rear Right	265/60 R18	110T	Continental	Crosscontact	V	4321	3 mm
Spare	245/70 R16C	111S	Goodyear	Wrangler	V	0918	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM(ENGINE CONTROL MODULE)	U0167	LOST COMMUNICATION WITH VEHICLE IMMOBILIZER CONTRO	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

[illegible]

Brake and shock absorber repor

[illegible]

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



Spare wheel Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060




CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Intercooler

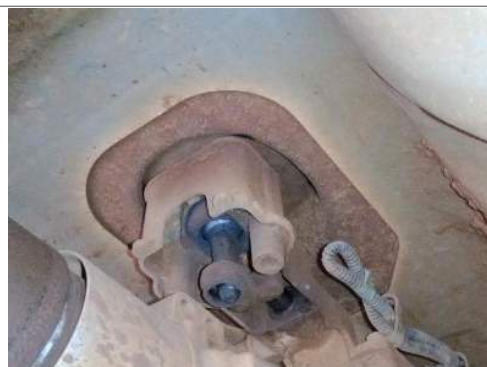

Gear lever



Switch Electrical Window Winder front right



Hood Lining



Steering Wheel Trim



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Carpet Front



Door Panel Rear Right



Rear Fender Right



Door Rear Right



Door Front Right



Rocker Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Front Fender Right



Front Bumper



Front Bumper



Bonnet



Headlight Left



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Front Fender Left



Windscreen



A • Pillar Left



Side Mirror Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Rear Fender Left



Fuel Flap



Tail Light Left



Tail Light Right



Tailgate



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Rear bumper



Load Body



Roof



Air Conditioner



Number Plate Light Left



Number Plate Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVNRCHR9H4003060




CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

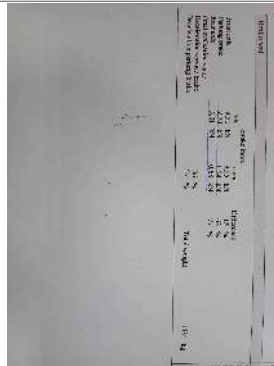

Parking Brake Performance

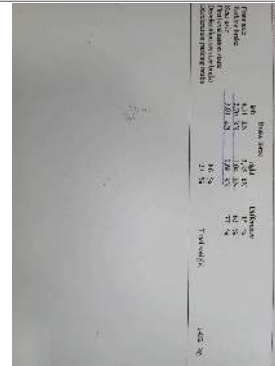

Service Brake Performance Rear Axle



Engine Wiring



Water level



Rim Front Right



Rim Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Rim Rear Left



Rocker Panel Left



Rim Front Left



Front Bumper



Gearbox



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025

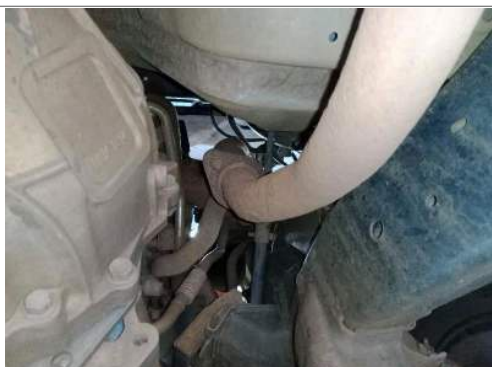

Catalytic converter



Center Prop Shaft Rubber(s)



Differential



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Spring Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060



CONDITION REPORT



Report No:
2016959196
DATE
26/07/2025



Spring Rear Right



Ball Joint(s) Front Axle Left



Water level



4x4 Differential Lock



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVNRCHR9H4003060