

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/03/2024		M57 Pretoria Road - 1619
Inspection Date	18/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	CHEVROLET	Registration Number	DJ38BVGP
Model	UTILITY	Register Number	
VIN	ADMEF4MR2F4704127	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/08/2023
Color	RED	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	173,633 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Expansion Bottle Defective	Replace
Windscreen Wiper Damaged	Replace
Headlight Right Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Chipmarks	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Cracked	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.0	-	
Rear	2.2	2.2	-	
Emergency / Parking	1.5	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92T	Dunlop	Sp touring	V	4421	4 mm
Front Right	185/65R15	92T	Dunlop	Sp touring	V	4421	4 mm
Rear Left	185/65R15	92T	Dunlop	Sp touring	V	4821	4 mm
Rear Right	185/65R15	92T	Dunlop	Sp touring	V	4921	4 mm
Spare	185/65R14	86H	Dunlop	Sp sport	V	2514	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AD MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

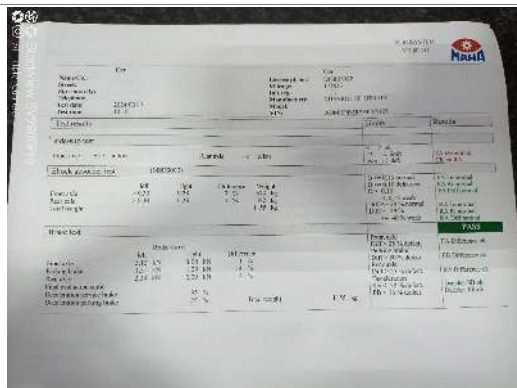

SHOCK & BRAKE REPORT



DIAGNOSTIC REPORT



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER




DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)




LR TYRE TREAD

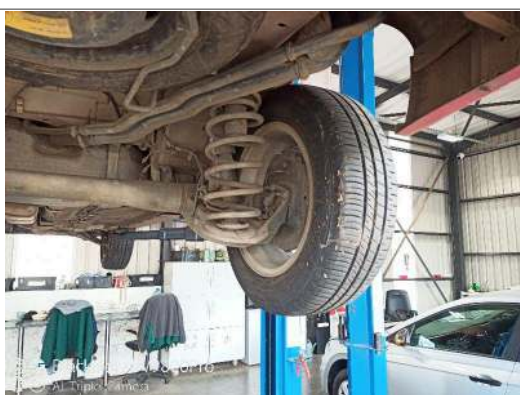

RR TYRE TREAD



LF TYRE TREAD

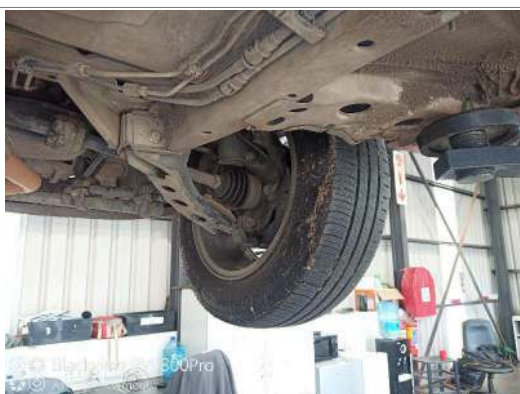


RF TYRE TREAD



Spare wheel



Expection bottle

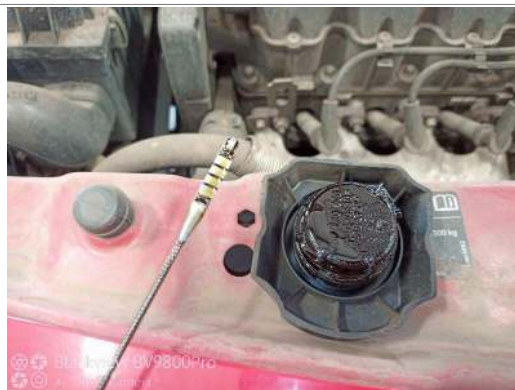

Oil cap and dipstick



Manual




ENGINE 1



ENGINE 2



CHASSIS

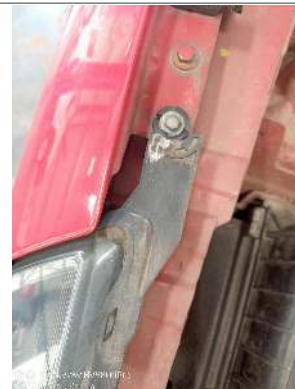**Water level****Expansion Bottle****Engine Wiring****Headlight Right****Headlight Right****Bonnet**



Roof




Windscreen



Windscreen Wiper



Side Mirror Right

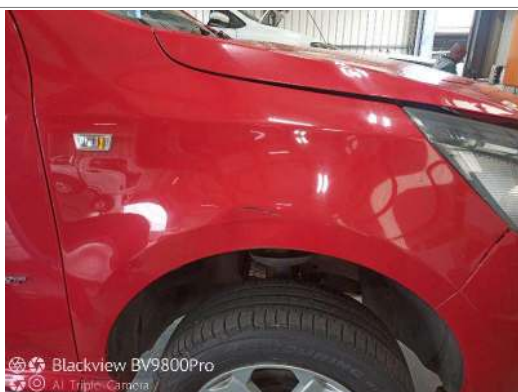

Front Fender Right



Door Front Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Rear Fender Left



Rear Fender Right



Tailgate



Rear bumper



Engine



CONDITION REPORT

Report No: 2016309147

DATE
18/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za