



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	31/07/2025		M57 Pretoria Road - 1619
Inspection Date	31/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	JDY681NW
Model	KB300 LX 4X4 DSL PU [2013-2014]	Register Number	
VIN	ADMUSRER2C4644073	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	C - COMMON
Km Reading	409,918 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025

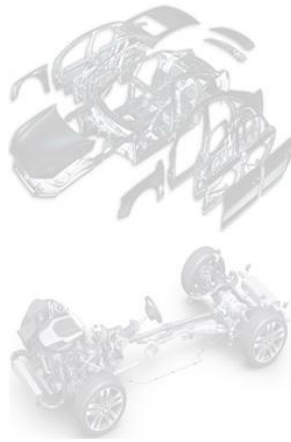

Damage	Repair Way
Engine Oil Leak	Repair
Under bonnet insulation cover Worn	Replace
Engine Management Lights Set	Repair
Switch Electrical Window Winder front left Defective	Repair
Heater operation Malfunction	Repair
Air Conditioner Defective	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Number Plate Light Right Damaged	Repair
Interior Mirror Defective	Repair
Door Panel Front Right Damaged	Replace
Door Sealing Rubber Front Right Torn / Cut	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Corrosion	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Residual Traces of Repair	Repair
A • Pillar Right Residual Traces of Repair	Repair
C • Pillar Left Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Welded	Repair
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Tailgate Defective	Replace
Tailgate Hinge Right Damaged	Replace
Rear bumper Damaged	Repair
Fuel Flap Residual Traces of Repair	Repair
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Residual Traces of Repair	Repair
Load Body Welded	Replace
Windscreen Cracked	Replace
Window Front Door Left Defective	Repair
Brake disc 1. Axle left Excessive Wear & Tear	Replace
Brake disc 1. Axle right Excessive Wear & Tear	Replace
Tie Rod End left Loose / Excessive Play	Replace
Tie Rod End right Defective	Replace
Steering Rack Defective	Repair
Steering Rack Boot Left Defective	Replace
Steering Rack Boot Right Defective	Replace
Shock Absorber Rear Right Deformed	Replace
Shock Absorber Mounting Front Left Excessive Wear & Tear	Repair
Shock Absorber Mounting Front Right Excessive Wear & Tear	Replace
Shock Absorber Mounting Rear Left Damaged	Replace
Shock Absorber Mounting Rear Right Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Tyre Rear Left Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025

Damage	Repair Way
Tyre Rear Right Worn	Replace
Spare Tyre Incorrect	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Mounting rubber(s) Front Left Cracked	Replace
Mounting rubber(s) Front Right Cracked	Replace
Engine to silencer pipe Welded	Repair
Gearbox Oil Leak	Repair
Differential Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Replace
Universal Joint Loose / Excessive Play	Replace
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair
Fold away mirrors incorrect operation	Repair
Right Door retaining hinge defective	Repair
Wiper valance grille defective	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Bridgestone	Dueler	V	4317	0 mm
Front Right	265/65R17	112S	Bridgestone	Dueler	V	4117	0 mm
Rear Left	265/65R17	112S	Michelin	LTX	V	1117	0 mm
Rear Right	265/65R17	112S	Michelin	LTX	V	1117	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM	P0113	INTAKE AIR TEMPERATURE (IAT) SENSOR CIRCUIT HIGH	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: The engine control and ABS warning lights stay illuminated on the cluster. Air conditioner and interior fan / heater not operational.
Interior: Seat covers fitted, seats fully covered. Grab handle cover missing. Vehicle interior dirty.
Body • Exterior: Custom front bumper fitted, surface Tailgate latch defective. Oxidation on rear of cab. Quality of previous repairs not to standard. Minor dents, scratches and chip marks on various body panels. Left front window tint damaged
Tyres and Rims: All alloy wheel center caps missing.
Undercarriage: Front and rear differentials leaking

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Clive Russon

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025

Customer Information			
Name:	Mr. M. M. M.	Cell:	081 123 4567
Address:	123 Main St, Pretoria	Vehicle:	2015 Toyota Hilux
Phone:	012 345 6789	Engine:	2.5L Diesel
Test Date:	30/07/2025	Tester:	John Doe
Test Result:	Pass	Vehicle ID:	ADMUSRER2C4644073
Shock Absorber Test Results			
Wheel	Left	Right	Remarks
Front Left	1.2	1.5	Good
Front Right	1.1	1.4	Good
Rear Left	1.3	1.6	Good
Rear Right	1.4	1.7	Good

Shock absorber test report

Vehicle Diagnostic Report	
Vehicle ID:	ADMUSRER2C4644073
Engine Code:	2.5L Diesel
Transmission:	5-Speed Manual
Brake System:	Disc/Drum
Steering:	Power Steering
Electrical:	Good
Exhaust:	Good
Oil Level:	Good
Water Level:	Good
Brake Fluid:	Good
Steering Fluid:	Good
Exhaust Fluid:	Good
Oil Pressure:	Good
Water Pressure:	Good
Brake Pressure:	Good
Steering Pressure:	Good
Exhaust Pressure:	Good
Oil Temperature:	Good
Water Temperature:	Good
Brake Temperature:	Good
Steering Temperature:	Good
Exhaust Temperature:	Good
Oil Level:	Good
Water Level:	Good
Brake Fluid:	Good
Steering Fluid:	Good
Exhaust Fluid:	Good
Oil Pressure:	Good
Water Pressure:	Good
Brake Pressure:	Good
Steering Pressure:	Good
Exhaust Pressure:	Good
Oil Temperature:	Good
Water Temperature:	Good
Brake Temperature:	Good
Steering Temperature:	Good
Exhaust Temperature:	Good

Diagnostic report

Vehicle Diagnostic Report	
Vehicle ID:	ADMUSRER2C4644073
Engine Code:	2.5L Diesel
Transmission:	5-Speed Manual
Brake System:	Disc/Drum
Steering:	Power Steering
Electrical:	Good
Exhaust:	Good
Oil Level:	Good
Water Level:	Good
Brake Fluid:	Good
Steering Fluid:	Good
Exhaust Fluid:	Good
Oil Pressure:	Good
Water Pressure:	Good
Brake Pressure:	Good
Steering Pressure:	Good
Exhaust Pressure:	Good
Oil Temperature:	Good
Water Temperature:	Good
Brake Temperature:	Good
Steering Temperature:	Good
Exhaust Temperature:	Good

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

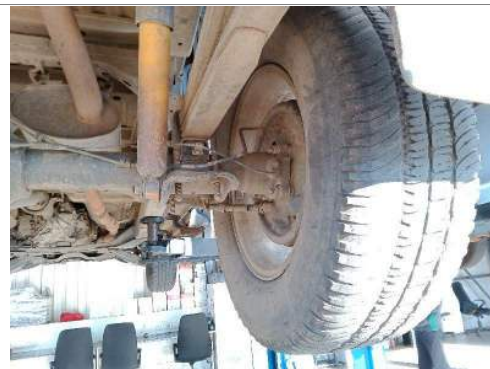

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



REAR



No spare wheel fitted.



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Coolant level



Expansion bottle



Grab handle cover



Fold away mirrors.



Door retainer



Wiper valance grille

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



CHASSIS



Front Bumper



Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Front Fender Left / Inner Tray



A • Pillar Left



Windscreen



Side Mirror Left



Side Mirror Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Rear Fender Left



Fuel Flap



Rear bumper



Rear bumper



Number Plate Light Right



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Tail Light Left



Tail Light Right



Tail Light Right



Load Body



Load Body



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Tailgate Hinge Right



Load Body



Load Body



Tailgate



Tailgate



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Rear Fender Right



Door Front Right



C • Pillar Right



C • Pillar Left



Front Fender Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Side Mirror Right



Side Mirror Right



Brake disc 1. Axle right



Brake disc 1. Axle left



Spare Tyre



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Tyre Rear Right



Tyre Front Left



Tyre Front Left



Tyre Front Right



Tyre Front Right



Rim Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Rim Rear Right



Rim Front Right



Rim Front Left



Rim Rear Left



Engine



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Steering Rack



Steering Rack Boot Right



Steering Rack Boot Left



CV Joint(s) Boot(s) Front Left (inner/outer)



Ball Joint(s) Front Axle Right



Ball Joint(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Tie Rod End right



Tie Rod End left



Gearbox



Differential



Differential



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Engine to silencer pipe



Universal Joint



Mounting rubber(s) Front Right



Mounting rubber(s) Front Left



Shock Absorber Mounting Front Right



Shock Absorber Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Shock Absorber Mounting Rear Left



Shock Absorber Rear Right



Shock Absorber Mounting Rear Right



Sill Panel Right



Sill Panel Left



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Front Fender Left / Inner Tray



Front Fender Left / Inner Tray



Door Panel Front Right



Window Front Door Left



Switch Electrical Window Winder front left



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073



CONDITION REPORT



Report No:
2016963494
DATE
31/07/2025



Air Conditioner



Heater operation



Interior Mirror



Under bonnet insulation cover



Door Sealing Rubber Front Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMUSRER2C4644073