



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	25/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	CHEVROLET	Registration Number	JCL625MP
Model	CORSA 1.4 CLUB UTILITY PU [2010-2012]	Register Number	
VIN	ADMXF80JG84571058	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/07/2021
Color	WHITE	Power / Displacement	
Year Model	2011	Paint Finish	TWO COAT UNI
Km Reading	200,211 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025

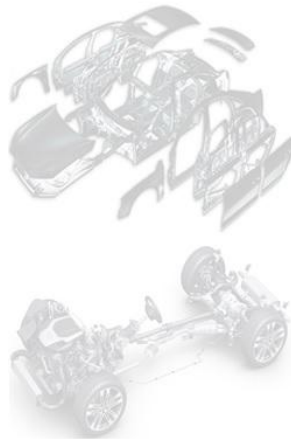

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Defective	Repair
Fan Belt Damaged	Replace
Bonnet cable Damaged	Replace
Central Air Vent Damaged	Replace
Radio/CD/USB Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Indicator Light Front Right Cracked	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Number Plate Light Left Damaged	Replace
Number Plate Light Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Sun Visor Left Damaged	Replace
Sun Visor Right Missing	Replace
Door Panel Front Left Damaged	Repair
Door Panel Front Right Damaged	Replace
Door Handle Front Left Damaged	Replace
Door Handle Front Right Damaged	Replace
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Gear Lever Dust Boot Damaged	Repair
Clutch Pedal Rubber Missing	Replace
Brake Pedal Rubber Missing	Replace
Steering Wheel Trim Damaged	Repair
Side Mirror Left Residual Traces of Repair	Replace
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
Front Fender Left Dented	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Defective	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Damaged	Repair
Doorstopper Front Right Defective	Replace
Rear bumper Damaged	Repair
Fuel Flap Damaged	Replace
Sill Panel Left Damaged	Repair
Sill Panel Right Dented	Repair
Load Body Damaged	Repair
Windscreen Cracked	Replace
Brake disc 1. Axle left Defective	Replace
Brake disc 1. Axle right Defective	Replace
Parking Brake Performance Insufficient	Repair
Spring Front Left Defective	Replace
Spring Front Right Defective	Replace
Spring Rear Left Defective	Replace
Spring Rear Right Defective	Replace
Stabilizer Mounting Front Left Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025

Damage	Repair Way
Stabilizer Mounting Front Right Damaged	Replace
Ball Joint(s) Front Axle Left Loose / Excessive Play	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Chassis Damaged	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Defective	Repair
Silencer Damaged	Replace
Catalytic converter Welded	Replace
Engine mountings Loose / Excessive Play	Replace
Belly plates Damaged	Replace
Gearbox Mountings Cracked	Replace
Gearbox Oil Sweat	Repair
Engine Noise Excessive	Repair
Engine Smoke Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Airbag warning light illuminated on dashboard	Repair
Body and Exterior	Wiper valance damaged
Body and Exterior	Tailgate missing
Engine	Rust inside expansion bottle
Interior	Gear knob damaged
Road test	Vehicle struggles to start
Interior	Loose wiring inside of vehicle
Electrical instruments and components	Speedometer not working
Interior	Right interior C pillar plastic cover missing
Electrical instruments and components	Vehicle has no diagnostic report OBD faulty
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Residual traces of repair on some body panels

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	1.85	1.8	-	
Rear	1.23	0.95	-	
Emergency / Parking	0	0	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50 R15	86H	Double king	---	V	0000	0 mm
Front Right	195/50 R15	82V	Sumitomo	HTR V5	V	2221	5 mm
Rear Left	195/60 R15	88V	Ovation	Ecovision	V	1821	0 mm
Rear Right	195/55 R15	85H	DoubleStar	Maximum	V	4717	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Diagnostic could not be performed due to no data available and or OBD interface malfunction.

Inspection Conditions

No Test Drive

Rain at time of inspection

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025

[illegible]

Brake and shock absorber repor



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Front chassis



Rear chassis



Wiper valance



Oil cap and dipstick



Center Console / Cubbyhole + Lid



Radio/CD/USB

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Door Sealing Rubber Front Right



Seat Front Right



Door Handle Front Right



Sun Visor Right



Sun Visor Left



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Doorstopper Front Right



Door Panel Front Right



Central Air Vent



Front Fender Right



Side Mirror Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Rear Fender Right



Fuel Flap



Rear bumper



Rear bumper



Load Body



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Tail Light Left



Rear Fender Left



Sill Panel Left



Door Front Left



Front Fender Left



Door Panel Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Seat Front Left



Door Sealing Rubber Front Left



Central Air Vent



Door Handle Front Left



Side Mirror Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Front Bumper



Bonnet



Windscreen



Headlight Right



Headlight Left



Clutch Pedal Rubber

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Brake Pedal Rubber



Bolt(s) / Nut(s) Rear Wheel Right



Rim Front Right



Bolt(s) / Nut(s) Front Wheel Left



Rim Front Left



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Spring Front Left



Bolt(s) / Nut(s) Rear Wheel Left



Number Plate Light Left



Number Plate Light Right



Sill Panel Right



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Spring Front Right



Tyre Front Right



Tyre Front Left



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Ball Joint(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Ball Joint(s) Front Axle Right



Gearbox Mountings



Gearbox



Engine



Sub Frame



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Engine to silencer pipe



Catalytic converter



Belly plates



Chassis



Chassis



Silencer

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Spring Rear Left



Spring Rear Right



Tyre Rear Left



Silencer



Brake disc 1. Axle left



Brake disc 1. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Bolt(s) / Nut(s) Front Wheel Right



Indicator Light Front Right



Water level



Engine Wiring



Engine mountings



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058



CONDITION REPORT



Report No:
2016958074
DATE
25/07/2025



Bonnet cable



Gear Lever Dust Boot



Grill



Hoses

Brake test			
	Brake force		
	left	right	Difference
Front axle	1,85 kN	1,80 kN	3 %
Parking brake	— kN	— kN	— %
Rear axle	1,23 kN	0,95 kN	23 %
Final evaluation static		53 %	
Deceleration service brake	— %		
Deceleration parking brake			
	Total weight		1111 kg

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMXF80JG84571058