

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/12/2024		M57 Pretoria Road - 1619
Inspection Date	05/12/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	FXG759L
Model	NP200 1.6 8V BASE +AC SAFETY PU [2011-ON]	Register Number	
VIN	ADNUSN1D5U0184247	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/10/2023
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	18,630 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Water level Insufficient	Repair
Door Lock Front Left Damaged	Repair
Front Bumper Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Main Beam Left Damaged	Repair
Airbag warning lights illuminated	Repair
Body exterior	Minor dents scratches stone chips on some body pan
Engine	Bottom of engine is covered
Cut and join L/F main beam	Replace
Body exterior	Residual traces of poor repair on some body panels



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	3.1	-	
Rear	1.3	1.6	-	
Emergency / Parking	1.1	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92T	Barum	Brillantis	V	3620	3 mm
Front Right	185/65R15	92T	Barum	Brillantis	V	3620	5 mm
Rear Left	185/65R15	92T	Barum	Brillantis	V	3620	6 mm
Rear Right	185/65R15	92T	Barum	Brillantis	V	3620	6 mm
Spare	185/65R15	88H	Continental	Contact	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BCM	000100	FRONT WINDSHIELD WIPER PARK CIRCUIT	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.VEHICLE IS POSSIBLY A CODE 3

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Expansion bottle



Oil cap and dipstick

VIN: ADNUSN1D5U0184247

2 / 9



Airbag warning lights illuminated



Manual



Sparewheel



Rear end

VIN: ADNUSN1D5U0184247

3 / 9

VIN: ADNUSN1D5U0184247

5 / 9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: ADNUSN1D5U0184247




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

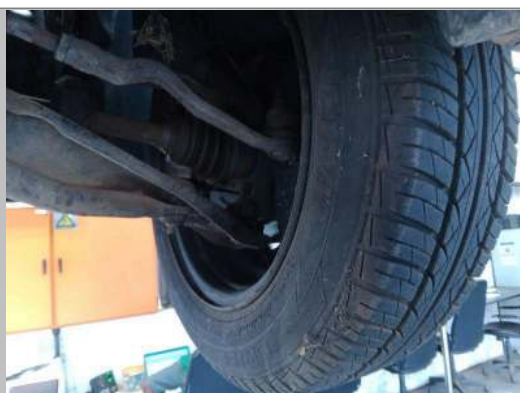

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

VIN: ADNUSN1D5U0184247

8 / 9



CHASSIS



ENGINE 2

VIN: ADNUS1D5U0184247

9 / 9



ENGINE 1



Water level



Water level



Door Lock Front Left



Door Front Left



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Main Beam Left



Main Beam Left



Main Beam Left



Main Beam Left



Main Beam Left



CONDITION REPORT

Report No: 2016649680

DATE
05/12/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za