

CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025

MFC Auction House M57 Pretoria Rd, Glenmarais, KEMPTON PARK Gauteng

DEKRA MFC M57 Pretoria Rd - 1619 KEMPTON PARK - GT 08610 33572











-							
Δ	ssi	~	n	m	Δ	n	٠

Client MFC Auction House MFC Inspection Location M57 Pretoria Road - 1619 06/05/2025 Requested Date Kempton Park - GT Inspection Date 06/05/2025

Vehicle Data Vehicle Type LIGHT LOAD VEHICLE Registered Owner NISSAN Manufacturer KJ62YFGP Registration Number Model NP200 Register Number Date Of First Licensing ADNUSN1D5U0199549 Last COR Engine Number License Expiry Date 31/03/2025 Power / Displacement WHITE Paint Finish TWO COAT UNI Year Model Fuel **PETROL** Km Reading 116,979 KM MANUAL Transmission Cab / Body Type SINGLE CAB

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way	
	Engine Oil Leak	Repair	
\sim	Radio/CD/USB Damaged	Replace	
17 July 18	Seat Front Right Damaged	Repair	
	Front Bumper Damaged	Repair	
	Bonnet Damaged	Repair	
	Front Fender Left Damaged	Repair	
T LAN	Front Fender Right Damaged	Repair	
	Rear Fender Left Damaged	Repair	
	Rear Fender Right Damaged	Repair	
. //	Door Front Left Damaged	Repair	
-	Door Front Right Damaged	Repair	
(A)	Tailgate Damaged	Repair	
	Rear bumper Damaged	Repair	
	Windscreen Damaged	Replace	
	Tyre Front Left Worn	Replace	



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.58	2.95	-	
Rear	1.39	1.62	-	
Emergency / Parking	1.16	1.53	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92T	Barum	Radial	V	3921	0 mm
Front Right	185/65R15	92T	Barum	Radial	V	3822	3 mm
Rear Left	185/65R15	92T	barum	Radial	V	3221	3 mm
Rear Right	185/65R15	92T	Barum	Radial	V	2622	3 mm

^{*} Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BCM	000100	FRONT WINDSHIELD WIPER PARK CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

 $\label{lem:engine} \textbf{Engine number} - \textbf{not possible to verify engine number (not visible without dismantling)}$

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 5 DTC'S AT TIME OF TESTING SEE DTC REPORT.Body • Exterior: Minor dents and scratches to some body panels. Signs of stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za




CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025

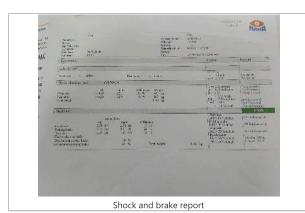

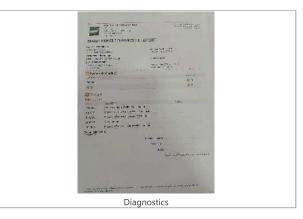







INTERIOR (FRONT DRIVER DOOR)



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025

















DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025



Rear bumper





Rear Fender Right







Door Front Right



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016866193

DATE 06/05/2025









DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za