



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/08/2025		M57 Pretoria Road - 1619
Inspection Date	13/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	HP64FXGP
Model	NP200 1.5DCI BASE +AC SAFETY DSL PU [2014-2022]	Register Number	
		Date Of First Licensing	
VIN	ADNUSN365U0151512	Last COR	
Engine Number		License Expiry Date	
Doors	2	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	DIESEL
Km Reading	245,291 KM	Transmission	MANUAL
Cab / Body Type	SINGLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025

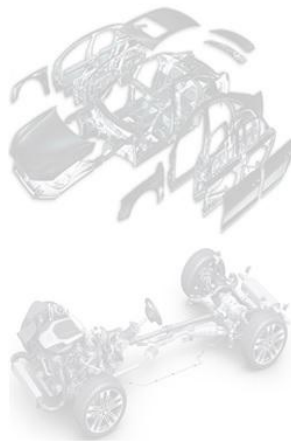

Damage	Repair Way
Tail Light Right Scratched	Repair
Number Plate Light Left Damaged	Replace
Number Plate Light Right Damaged	Replace
Headlight Left Cracked	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Damaged	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Right Residual Traces of Repair	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Parking Brake Performance Insufficient	Repair
Tie Rod End left Cracked	Replace
Tie Rod End right Cracked	Replace
Shock Absorber Front Right Leak	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Dented	Repair
Rim Rear Left Dented	Repair
Main Beam Right Residual Traces of Repair	Repair
Chassis Damaged	Repair
Belly plates Damaged	Repair
Gearbox Oil Sweat	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Defective	Replace
Brakes Malfunction	Repair
Engine Noise Excessive	Repair
Electrical instruments and components	Interior fan blower blocked
Warning light illuminated on dashboard	Repair
Interior	Fuel flap release handle not opening
Road test	Vehicle struggles to start
Engine	Engine bay dirty and battery loose.
Undercarriage	Vehicle undercarriage dirty
Undercarriage	Some loose bolts on gearbox
Tyres and rims	Spare wheel missing
Undercarriage	Bottom of engine and gearbox fully covered
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Stone chips and spray work on some body panels
Interior	Vehicle interior dirty and some panels scratched

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.14	3.17	-	
Rear	1.38	1.49	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	92T	Dunlop	Sp-Touring	V	0725	5 mm
Front Right	185/65 R15	92T	Dunlop	Sp-Touring	V	4624	5 mm
Rear Left	185/65 R15	82T	Dunlop	Sp-Touring	V	4624	5 mm
Rear Right	185/65 R15	88H	Kumho	Ecowing	V	3722	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0110	INLET AIR TEMPERATURE SENSOR CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512




CONDITION REPORT




Report No:
2016978055
DATE
13/08/2025



Manual Transmission

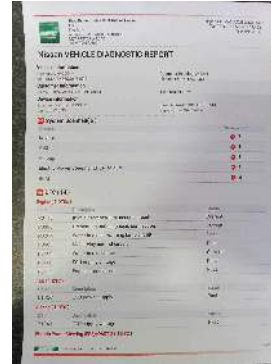

Diagnostic report page 1

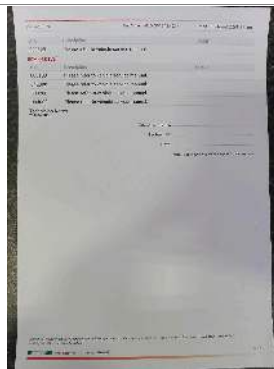

Diagnostic report page 2

[illegible]

Brake and shock absorber report



Oil cap and dipstick



Front chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Rear chassis



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Front Fender Right



Door Front Right



Rear Fender Right



Rear bumper



Rear bumper



Tailgate

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Rear Fender Left



Seat Front Left



Front Fender Left



Windscreen



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Bonnet



Number Plate Light Left




Number Plate Light Right



Tail Light Right



Roof

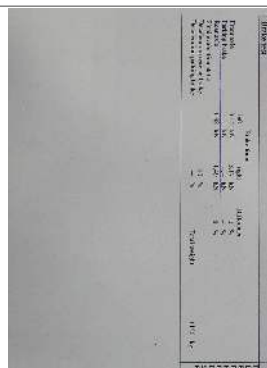

Parking Brake Performance

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Front Fender Right / Inner Tray



Headlight Left



Rim Front Left



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Belly plates



Chassis



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



Gearbox



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512



CONDITION REPORT



Report No:
2016978055
DATE
13/08/2025



Main Beam Right



Tyre Rear Right



Tie Rod End left



Tie Rod End right



Shock Absorber Front Right



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN365U0151512