



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/05/2024		M57 Pretoria Road - 1619
Inspection Date	22/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	FKN035L
Model	RANGER	Register Number	
VIN	AFAPXXMJ2PDP09696	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	268,926 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Seat Front Right Worn	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Windscreen Damaged	Replace
Rebound Rubber Front Axle Left Damaged	Replace
Rebound Rubber Front Axle Right Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Rear Right Worn	Replace
Engine to silencer pipe Welded	Replace
Silencer Missing	Replace
Gearbox Mountings Damaged	Replace
Gearbox Oil Leak	Repair
Fuel Tank Damaged	Replace
Differential Oil Sweat	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PDP09696

1 / 13



CONDITION REPORT

Report No: 2016388044

 DATE
22/05/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.19	4.73	-	
Rear	3.89	4.33	-	
Emergency / Parking	2.84	3.06	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/70R16	111T	Continental	Crosscontact	V	2516	0 mm
Front Right	255/70R16	111T	Continental	Crosscontact	V	2316	1 mm
Rear Left	225/70R16	111T	Continental	Crosscontact	V	1616	2 mm
Rear Right	255/70R16	111T	Continental	Crosscontact	V	2516	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. VEHICLE ELECTRONICS MALFUNCTIONING.Engine Compartment: Battery loose. signs of tampering done to catalytic converter.

Body • Exterior: Signs of repair work done to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: A5APXV12P12309606

Report No: 201638044


2 / 13

DATE


22/05/2024

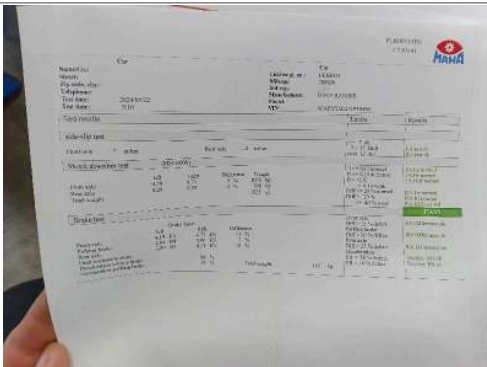


Brake and shock test

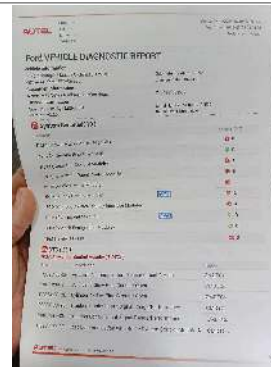

Diagnostic report

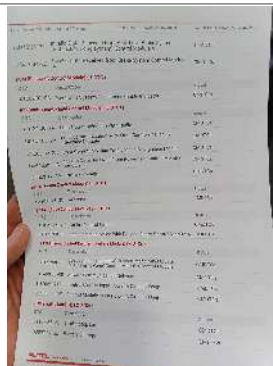

Diagnostic report

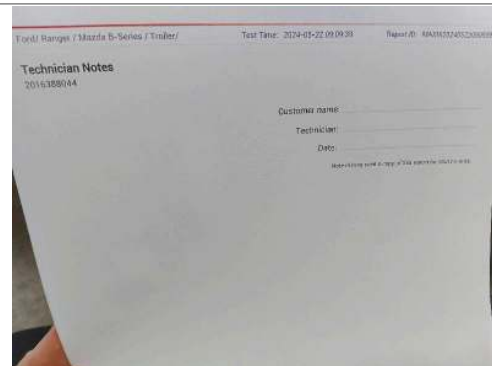

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016388044
VIN: AFAPXXMJ2PDP09696
DATE
22/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
VIN: AFAPXXMJ27052024
4 / 13



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



ADDITIONAL 11



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696

6 / 13




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

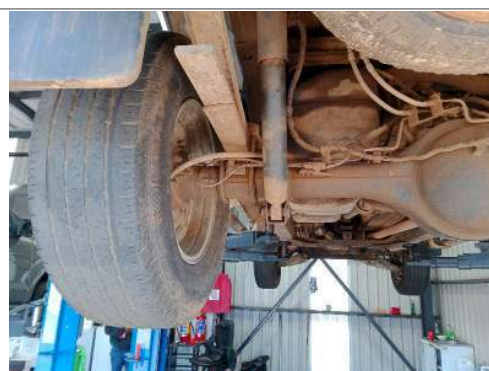

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 10



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

Water level



Front Bumper

VIN: AFAPX0MJ2PDP09696

10 / 13



Front Bumper



Bonnet



Front Fender Left



Door Front Left



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

Door Rear Left



Rear Fender Left



Tailgate



Rear bumper



Rear bumper



Rear Fender Right



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

VIN: AFAPXXMJ2PDP09696
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

Door Front Right



Door Rear Right



Front Fender Right



Roof



Windscreen



Differential



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

Differential



Gearbox



Engine



Engine to silencer pipe



Silencer



Rebound Rubber Front Axle Right



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

Rebound Rubber Front Axle Left



Gearbox Mountings



Tyre Front Left



Tyre Rear Right



Fuel Tank



Fuel Tank



CONDITION REPORT

Report No: 2016388044

DATE
22/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016388044

DATE
22/05/2024

Seat Front Right



Center Console / Cubbyhole + Lid

**CONDITION REPORT****Report No: 2016388044****DATE**
22/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za