



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/03/2025		M57 Pretoria Road - 1619
Inspection Date	26/03/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	DHW563L
Model	RANGER 2.2 HP XL D-CAB DSL PU [2012-2016]	Register Number	
VIN	AFAPXXMJ2PFY83452	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2025
Color	SILVER	Power / Displacement	
Year Model	2015	Paint Finish	M - METALLIC
Km Reading	263,946 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Bonnet stay and shocks Defective	Repair
Switch Electrical Window Winder front left Malfunction	Repair
Switch Electrical Window Winder front right Malfunction	Repair
Switch Electrical Window Winder rear left Malfunction	Repair
Tail Light Left Cracked	Repair
Headlight Left Damaged	Repair
Seat Front Right Damaged	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Residual	Repair
Traces of Repair	Repair
C • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



## CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025

Damage	Repair Way
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Rocker Panel Left Damaged	Repair
Windscreen Cracked	Repair
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Body exterior	Vehicle got some scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
ABS and traction control light on	Repair
Both front fog lights malfunction	Repair

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	3.5	5.0	-	
Rear	3.0	3.2	-	
Emergency / Parking	2.8	3	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/70R16	111T	Continental	Contact	V	3812	1 mm
Front Right	255/70R16	111T	Continental	Contact	V	4313	1 mm
Rear Left	265/70R16	112T	Dunlop	Grandtrek	V	4419	2 mm
Rear Right	275/70R16	114T	Dunlop	Grandtrek	V	5014	4 mm
Spare	245/70R16	107T	Mirage	Mr-at172	V	0000	3 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	P0671:00-2F	CYLINDER 1 GLOW PLUG CIRCUIT/OPEN	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452

**CONDITION REPORT**

Report No: 2016814686

DATE  
26/03/2025

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686


DATE  
26/03/2025

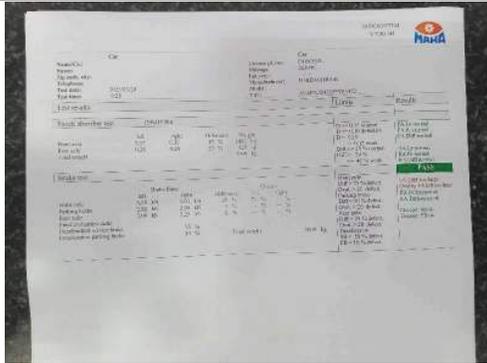

Shock and brake report



Diagnostic report

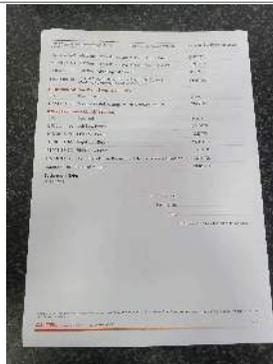

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Expection bottle



Water level



Headlight Left



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Bonnet stay and shocks



Bonnet



Windscreen



Rocker Panel Left



Seat Front Right



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Switch Electrical Window Winder front left



Switch Electrical Window Winder front right



Switch Electrical Window Winder rear left



Switch Electrical Window Winder rear left



C • Pillar Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Tailgate



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Rear bumper



Tail Light Left



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Ball Joint(s) Front Axle Right



Ball Joint(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452



CONDITION REPORT

Report No: 2016814686

DATE  
26/03/2025



Ball Joint(s) Front Axle Right



Ball Joint(s) Front Axle Right



Side Mirror Left



Side Mirror Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAPXXMJ2PFY83452