



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	KPV873MP
Model	RANGER 2.2 TDCI XL D-CAB DSL PU [2017-2020]	Register Number	
		Date Of First Licensing	
VIN	AFAPXXMJ2PJ85764	Last COR	
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	DIESEL
Km Reading	235,512 KM	Transmission	MANUAL
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026

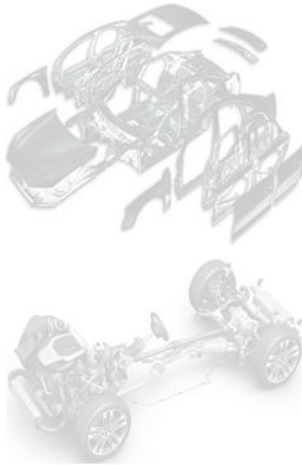

Damage	Repair Way
Engine Oil Leak	Repair
Tail Light Right Scratched	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Dirty	Repair
Seat Rear Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Damaged	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Load Body Damaged	Repair
Windscreen Chipped	Repair
Tie Rod End left Damaged	Replace
Rebound Rubber Front Axle Left Damaged	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Rim Rear Right Scratched	Repair
Catalytic converter Missing	Replace
Gearbox Oil Leak	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.85	4.84	-	
Rear	3.16	3.9	-	
Emergency / Parking	2.1	3.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/70 R16	112H	General	Grabber	V	4219	2 mm
Front Right	265/70 R16	112M	General	Grabber	V	4021	4 mm
Rear Left	265/70 R16	112H	General	Grabber	V	4219	1 mm
Rear Right	265/70 R16	112H	General	Grabber	V	4219	2 mm
Spare	255/70 R16	111T	Continental	Crosscontact	V	0000	8 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P0671:00-6C	CYLINDER 1 GLOW PLUG CIRCUIT/OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Lights: Front left and right headlight lenses faded.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Dents and scratches on body panels. Residual traces of repair on body panels.

Undercarriage: Excessive play on prop shaft vibration damper.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel



Front chassis



Rear chassis



Spare Wheel Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:

2017303136

DATE

25/09/2026



Oil cap and dipstick



ENGINE 1



VIN PLATE OR STICKER



LICENSE DISC

VEHICLE INFORMATION			
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg

SHOCK AND BRAKE REPORT

VEHICLE INFORMATION			
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg
Make/Model	Year	Engine	Transmission
Ford	2015	2.2L 4-cyl	5-speed manual
VIN	AFAPXXMJ2PJ85764	Engine no.	3200kg

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:

2017303136

DATE

25/09/2026

Hardware / Module	2017-09-26 12:55 PM	Bus ID: 1600B3C00701A983
U0131:00:05	Lost Communication With Power Steering Control Module A	CMOTCS
BodyCM (Body control module) (2 DTCs)		
P1C	Description	Status
B1245:15:05	Left Daytime Running Light	CMOTCS
B1202:15:08	Left High Beam Headlight	CMOTCS
FCM (Front control interface module) (2 DTCs)		
D1D	Description	Status
D1063:19:06	Residual Air Damper Motor	CMOTCS
D11F0:15:06	Air Intake Damper Position Sensor	CMOTCS
Technician Notes		
9/2/2026		
Customer Name:		
Technician:		
Date:		
Notes: Please make a copy of this report for your records.		


DIAGNOSTIC REPORT PAGE 2



Seat Rear



Seat Rear

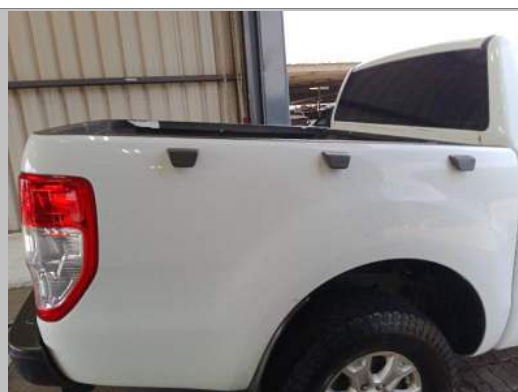

Rear Fender Right



Rear Fender Right



Tailgate

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Tailgate



Rear Fender Left




Rear Fender Left



Load Body



Door Rear Left

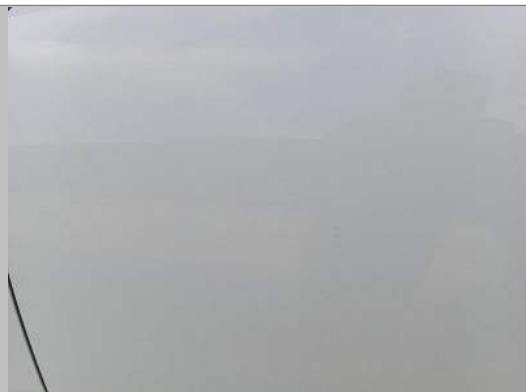

Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Door Front Left



Front Fender Left



Seat Rear



Seat Front Left



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Headlight Right



Headlight Left



Windscreen



Front Fender Right



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Door Front Right



Roof



Rear bumper



Rear bumper



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Front Bumper



Front Bumper



Rim Rear Right



Gearbox



Engine



Rebound Rubber Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764



CONDITION REPORT



Report No:
2017303136
DATE
25/09/2026



Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Catalytic converter



Tie Rod End left



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJ85764