

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/01/2025		M57 Pretoria Road - 1619
Inspection Date	29/01/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	HT43VDGP
Model	COROLLA 1.4D ESTEEM DSL [2017-2020]	Register Number	
VIN	AHTBC0JEX00008507	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2025
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT UNI
Km Reading	204,752 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Under bonnet insulation cover Damaged	Replace
	Radio/CD/USB Damaged	Repair
	Windscreen Wiper Damaged	Replace
	Tail Light Left Damaged	Replace
	Tail Light Right Defective	Replace
	Headlight Left Damaged	Replace
	Headlight Right Damaged	Replace
	Seat Front Left Defective	Repair
	Seat Front Right Damaged	Repair
	Hood Lining Dirty	Repair
	Door Handle Front Right Damaged	Replace
	Door Lock Front Right Damaged	Replace
	Steering Wheel Trim Defective	Repair
	Number Plate Front Damaged	Replace
	Front Bumper Damaged	Replace
	Grill Damaged	Replace
	Bonnet Damaged	Repair
	Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
	B • Pillar Right Dented	Repair
	C • Pillar Left Residual Traces of Repair	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBC0JEX00008507

Damage	Repair Way
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Defective	Repair
Front Fender Right / Inner Tray Damaged	Replace
Rear Fender Right / Inner Tray Welded	Repair
Door Front Left Paintwork • Dull	Repair
Door Front Right Paintwork • Dull	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Doorstopper Rear Left Defective	Replace
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Welded	Repair
Roof Damaged	Repair
Caliper 1. Axle left Leak	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Right Defective	Replace
Rim Front Left Dented	Repair
Rim Front Right Dented	Repair
Main Beam Left Damaged	Repair
Main Beam Right Damaged	Repair
Chassis Damaged	Repair
Belly plates Damaged	Replace
Radiator Cradle Damaged	Repair
Steering Malfunction	Repair
Engine Performance Malfunction	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Warning lights illuminated on dashboard	Repair
Electrical instruments and components	Speedometer not working
Engine	Engine bay dirty.
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Signs of impact damage to rear of vehicle.
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Vehicle safety integrity compromised
Body and Exterior	Vehicle is a cut and joint on rear left main beam

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.52	3.32	-	
Rear	2.24	2.13	-	
Emergency / Parking	1.51	0.08	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Continental	Contipremuim	V	4018	3 mm
Front Right	195/65 R15	91V	Nexen	Nblue	V	4221	2 mm
Rear Left	195/65 R15	91H	Nexen	Nblue	V	2522	5 mm
Rear Right	195/65 R15	91V	Nexen	Nblue	V	2921	1 mm
Spare	195/65 R15	91V	Nexen	Nblue	V	4321	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

VIN: AHTBC0JEX00008507

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) 19 and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P0502	VEHICLE SPEED SENSOR(VSS)A CIRCUIT LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

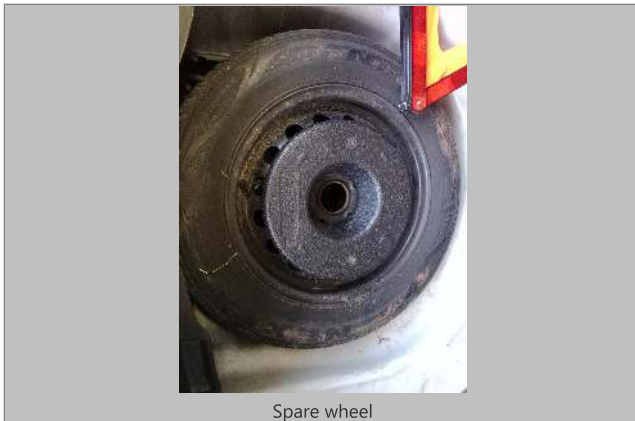


Spare wheel

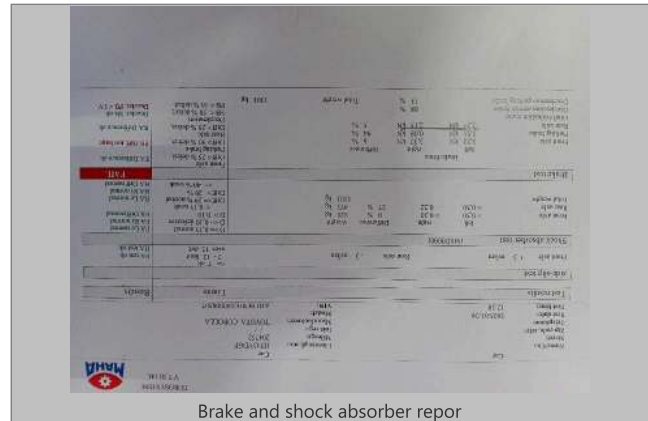


Brake and shock absorber report

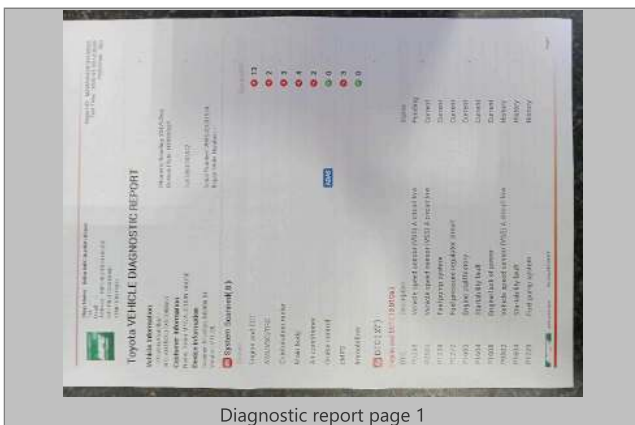


Diagnostic report page 1

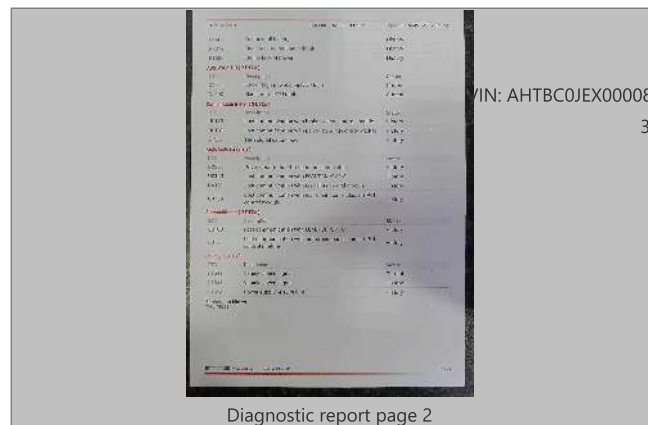

Diagnostic report page 2

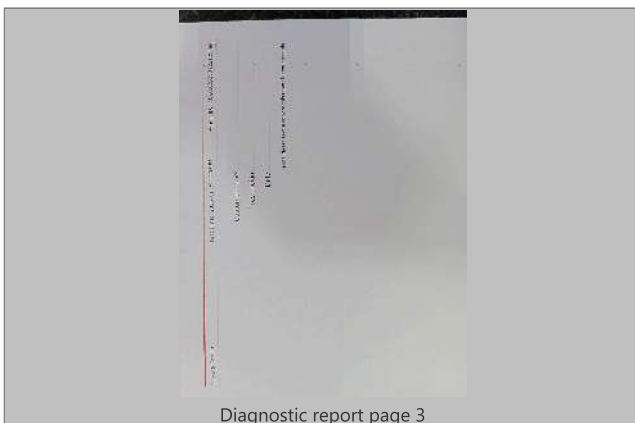

Diagnostic report page 3

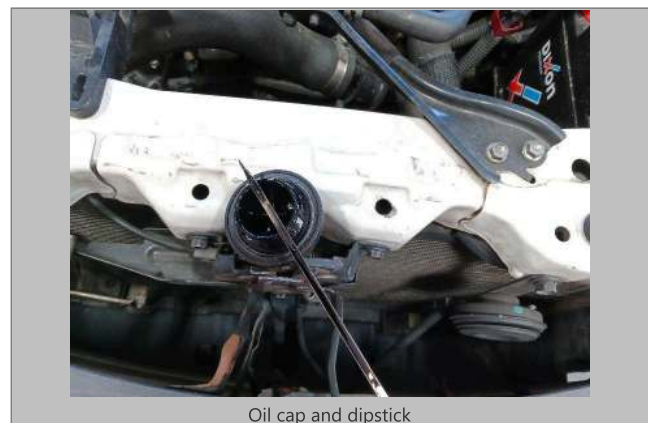

Oil cap and dipstick

VIN: AHTBC0JEX00008507
3 / 19

VIN: AHTBC0JEX00008507

4 / 19



Front chassis



Rear chassis



Manual transmission



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

TFCOJEX00008507
5 / 19

VIN: AHTBC0JEX00008507

6 / 19



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

VIN: AHTBC0JEX00008507

9 / 19



ENGINE 1



Radio/CD/USB




Steering Wheel Trim



Hood Lining

VIN: AHTBC0JEX00008507
10 / 19

Door Handle Front Right

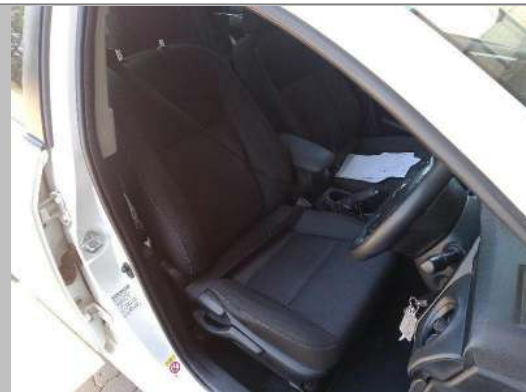

Seat Front Right

VIN: AHTBC0JEX00008507

11 / 19



C • Pillar Right



B • Pillar Right



Doorstopper Rear Left



Seat Front Left



Front Bumper



Front Bumper

VIN: AHTBC0JEX00008507

13 / 19



Bonnet



Grill



Number Plate Front



Headlight Left



Headlight Right



Steering



C • Pillar Right



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



C • Pillar Left



Tail Light Right



Tail Light Left

VIN: AHTBC0JEX00008507

16 / 19



Boot Lid / Hatch door



Rear bumper



Rear bumper



Roof



Door Rear Right



Door Front Right

VIN: AHTBC0JEX00008507

18 / 19



Front Fender Right



Front Fender Left



Windscreen Wiper



Door Front Left



Door Rear Left




Rear Fender Left

VIN: AHTB0JEX00008507

19 / 19



Rear Fender Right

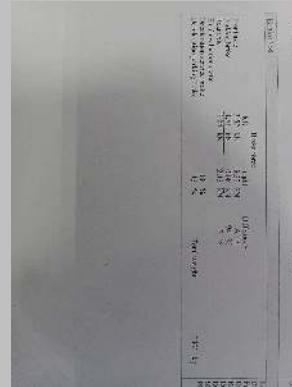

Parking Brake Performance



Under bonnet insulation cover



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Front Fender Right / Inner Tray



Rim Front Right



Sill Panel Right



Rear Fender Right / Inner Tray




Tyre Rear Right



Sill Panel Left




Rim Front Left

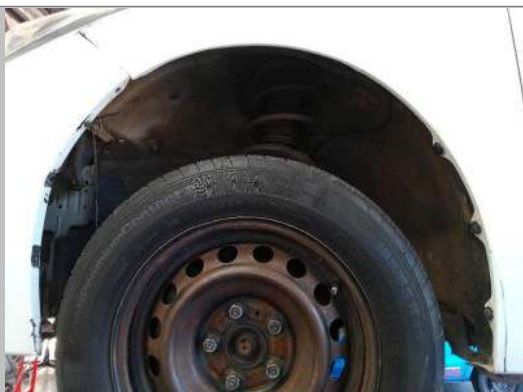

Front Fender Left / Inner Tray



Belly plates

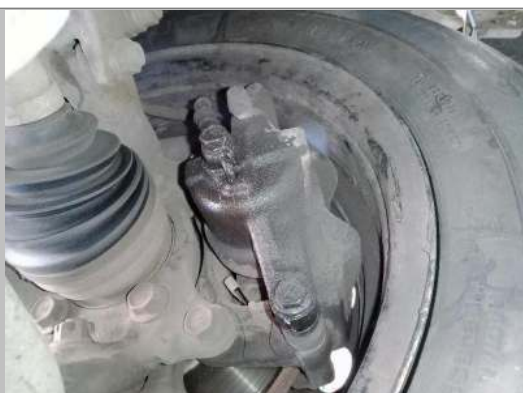

Caliper 1. Axle left



Radiator Cradle



Chassis



Chassis



Sill Panel Right



Main Beam Right



Main Beam Right



Main Beam Left



Chassis



Water level



Door Lock Front Right



CONDITION REPORT

Report No: 2016739385

DATE
29/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za