



CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	HHD351L
Model	COROLLA QUEST 1.8 PLUS CVT [2022-2025]	Register Number	
VIN	AHTBF8JE301022071	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	45,167 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:

2017305114


DATE

30/09/2026

Damage

Repair Way

Seat Rear Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Fuel Flap Dented	Repair
Windscreen Chipped	Repair

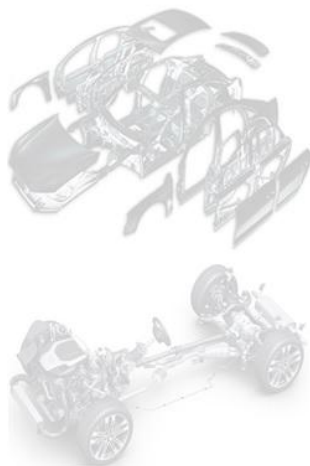

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.69	2.7	-	
Rear	2.34	2.11	-	
Emergency / Parking	1.65	1.62	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Goodyear	Excellence	V	0323	3 mm
Front Right	195/65 R15	91H	Goodyear	Excellence	V	0323	3 mm
Rear Left	195/65 R15	91H	Goodyear	Excellence	V	4422	1 mm
Rear Right	195/65 R15	91H	Goodyear	Excellence	V	4822	2 mm
Spare	195/65 R15	91H	Autogrip	P308 Plus	V	1924	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026

Item	Unit	Value	Unit	Value	Unit	Value
Front wheel	mm	0.02	mm	0.02	mm	0.02
Rear wheel	mm	0.02	mm	0.02	mm	0.02
Shock absorber	mm	0.02	mm	0.02	mm	0.02


Brake and shock absorber report

System	Code	Description	Severity
Engine	P0013	Variable Valve Timing (VVT) - Bank 1	High
Engine	P0014	Variable Valve Timing (VVT) - Bank 2	High
Engine	P0015	Variable Valve Timing (VVT) - Bank 1	High
Engine	P0016	Variable Valve Timing (VVT) - Bank 2	High

Diagnostic report page 1

System	Code	Description	Severity
Engine	P0013	Variable Valve Timing (VVT) - Bank 1	High
Engine	P0014	Variable Valve Timing (VVT) - Bank 2	High
Engine	P0015	Variable Valve Timing (VVT) - Bank 1	High
Engine	P0016	Variable Valve Timing (VVT) - Bank 2	High


Diagnostic report page 2

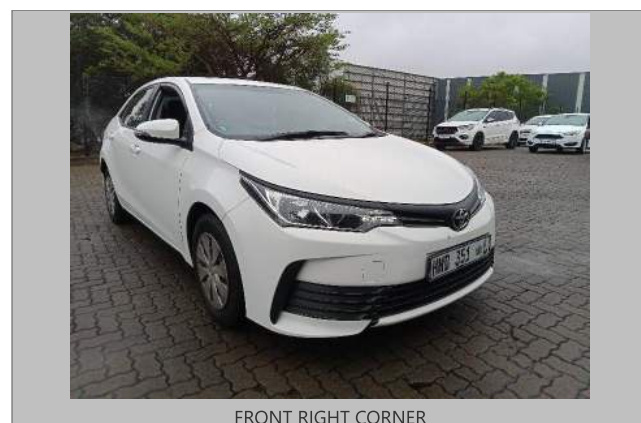

FRONT RIGHT CORNER



REAR LEFT CORNER

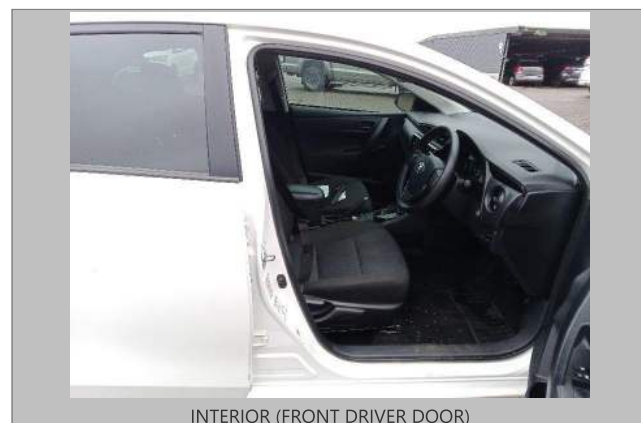

INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:

2017305114

DATE

30/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT




Report No:

2017305114

DATE

30/09/2026

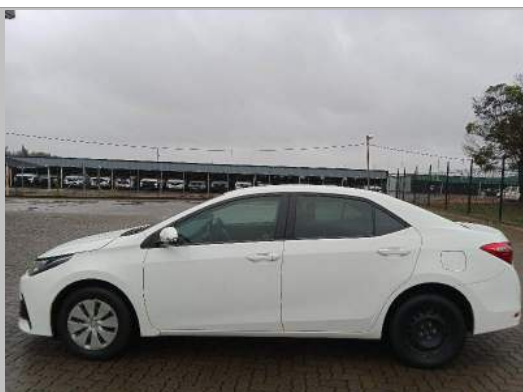

90 DEGREE LEFT



LR TYRE TREAD



RF TYRE TREAD



LF TYRE TREAD



RR TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Oil cap and dipstick



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071




CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026



Seat Rear

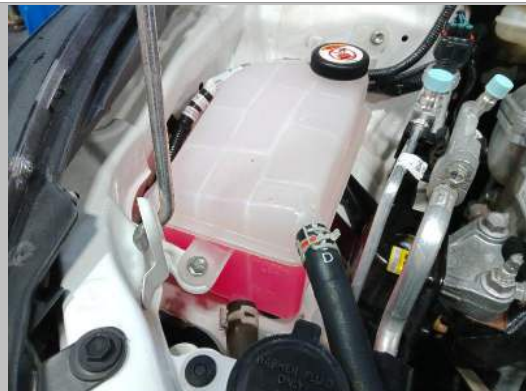

Water level



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071



CONDITION REPORT



Report No:
2017305114
DATE
30/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Fuel Flap



Windscreen



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE301022071