



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KPC870MP
Model	HILUX 2.0 VVT-I PU AC [2018-2020]	Register Number	
VIN	AHTEW8CB201291596	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	C - COMMON
Km Reading	257,241 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



Damage	Repair Way
Park Light Rear Right Defective	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Deformed	
Door Front Left Paintwork • Chipmarks	
Door Front Right Paintwork • Chipmarks	Repair
Tailgate Dented	Repair
Roof Dented	Repair
Load Body Dented	Repair
Parking Brake Performance Insufficient	Repair
Stabilizer Front Defective	Replace
Wheel bearing Front Left Loose / Excessive Play	Replace
Wheel bearing Front Right Loose / Excessive Play	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Gearbox Oil Sweat	Repair
RF Seat backrest lever cover missing	Replace
Rear cab body scratched	Repair
Bonnet latch defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	3.0	-	
Rear	1.8	1.7	-	
Emergency / Parking	0.9	0.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/70R15	100T	Goodyear	Wrangler	V	2321	2 mm
Front Right	205/70R15	100T	Goodyear	Wrangler	V	2321	4 mm
Rear Left	205/70R15	100T	Goodyear	Wrangler	V	0122	2 mm
Rear Right	205/70R15C	106/104S	Continental	WorldContact	V	4819	2 mm
Spare	205/70R15	100T	Goodyear	Wrangler	V	0222	7 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/VSC/TRC	C1241	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents, scratches and chip marks on various body panels. Tailgate alignment.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Clive Russon

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025

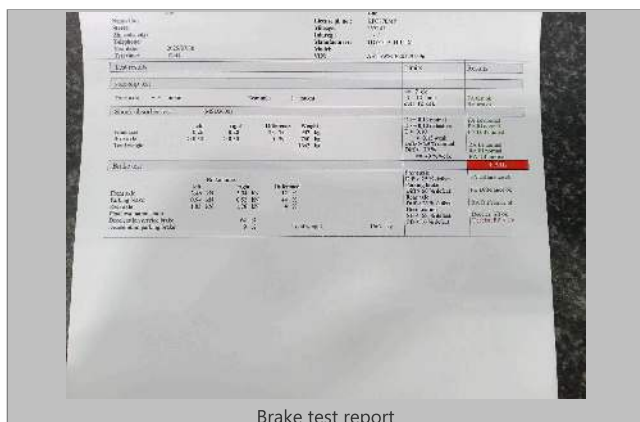

Brake test report



Diagnostic report




FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

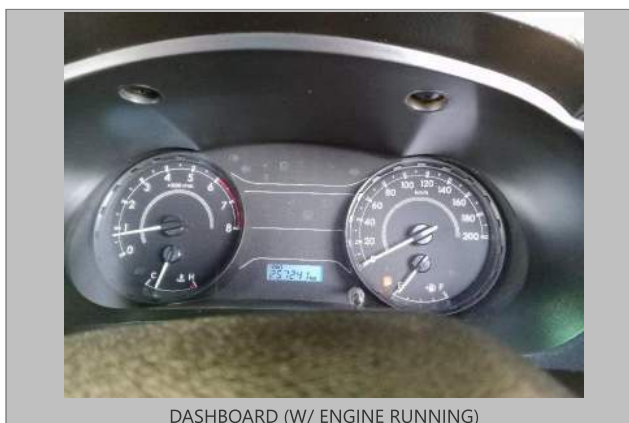

DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:

2016962809

DATE


30/07/2025




LF TYRE TREAD



LR TYRE TREAD

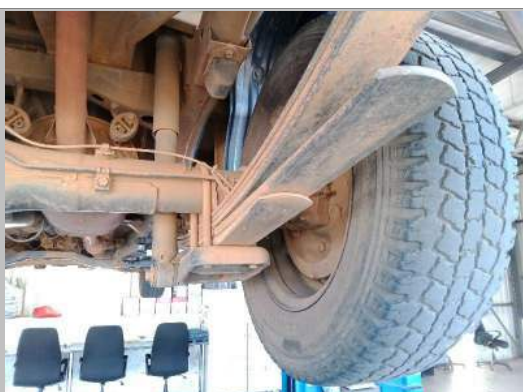

RR TYRE TREAD

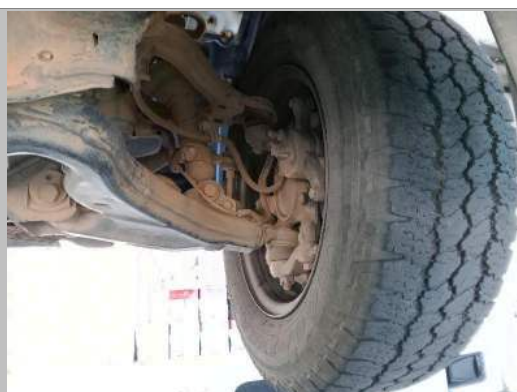

RF TYRE TREAD



Spare wheel



No license disc

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:

2016962809

DATE

30/07/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Bonnet latch

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



Coolant level



Oil cap and dipstick



RF seat backrest lever cover m



Rear cab body scratched



Seat Front Right



Wheel bearing Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



Wheel bearing Front Right



Tyre Rear Right



Tyre Rear Right



Stabilizer Front



Gearbox



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT




Report No:
2016962809
DATE
30/07/2025




Front Bumper



Front Bumper

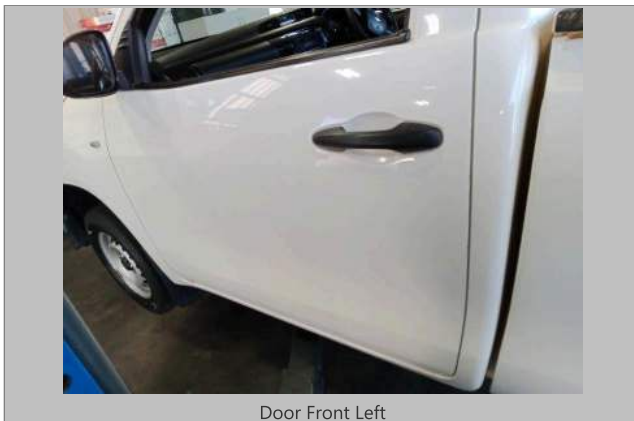

Door Front Left

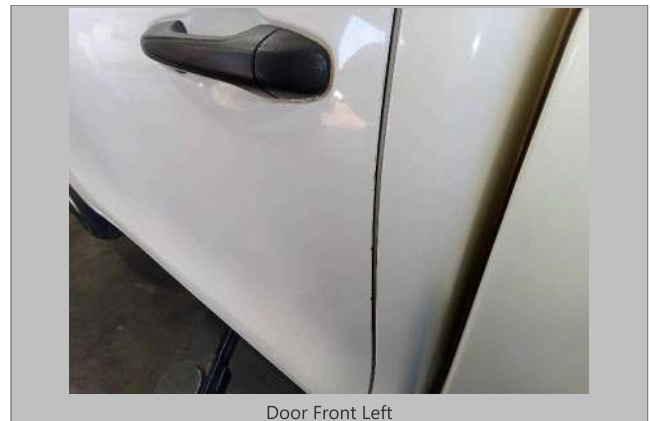

Door Front Left



Load Body



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



Tailgate



Tailgate



Tailgate



Tailgate



Door Front Right



Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596



CONDITION REPORT



Report No:
2016962809
DATE
30/07/2025



Roof



Park Light Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW8CB201291596