



## CONDITION REPORT

Report No: 201688601

DATE  
21/05/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 21/05/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 21/05/2025        |                     | Kempton Park - GT        |

**Vehicle Data**

|                 |                               |                         |              |
|-----------------|-------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE             | Registered Owner        |              |
| Manufacturer    | TOYOTA                        | Registration Number     | KL86ZHGP     |
| Model           | COROLLA QUEST 1.6 [2016-2021] | Register Number         |              |
| VIN             | AHTLB52E303142213             | Date Of First Licensing |              |
| Engine Number   |                               | Last COR                |              |
| Doors           | 4                             | License Expiry Date     | 28/02/2026   |
| Color           | WHITE                         | Power / Displacement    |              |
| Year Model      | 2019                          | Paint Finish            | TWO COAT UNI |
| Km Reading      | 402,907 KM                    | Fuel                    | PETROL       |
| Cab / Body Type | SEDAN                         | Transmission            | MANUAL       |

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

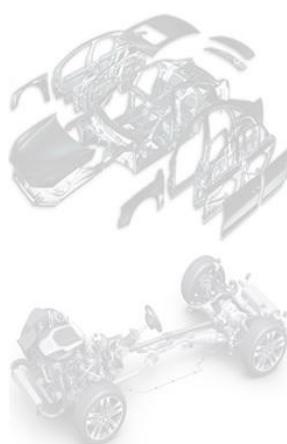

| Damage   | Repair Way |
|--|------------|
| Engine Oil Leak  | Repair     |
| Central Air Vent Damaged   | Repair     |
| Windscreen Wiper Damaged   | Replace    |
| Tail Light Left Damaged  | Replace    |
| Seat Front Right Worn  | Repair     |
| Front Bumper Damaged   | Repair     |
| Bonnet Damaged   | Repair     |
| Front Fender Left Damaged  | Repair     |
| Rear Fender Left Damaged   | Repair     |
| Door Front Left Damaged  | Repair     |
| Door Front Right Damaged   | Repair     |
| Door Rear Left Damaged   | Repair     |
| Door Rear Right Damaged  | Repair     |
| Boot Lid / Hatch door Damaged  | Repair     |
| Rear bumper Damaged  | Repair     |
| Windscreen Damaged   | Replace    |
| Brake disc 1. Axle left Worn   | Replace    |
| Brake disc 1. Axle right Worn  | Replace    |
| Parking Brake Performance Left / Right Difference out of legal range | Repair     |

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

| Damage                | Repair Way |
|-----------------------|------------|
| Tyre Front Left Worn  | Replace    |
| Tyre Front Right Worn | Replace    |
| Gearbox Oil Leak      | Repair     |

**Brakes****Brake Test Results**

|                     | Left               | Right              | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [kN] | Braking Force [kN] |                  |                                  |
| Front               | 3.29               | 3.02               | -                |                                  |
| Rear                | 1.99               | 2.45               | -                |                                  |
| Emergency / Parking | 1.49               | 0.38               | -                |                                  |

**Tyres and Rims****Tyre Specification & Measurement**

|             | Size      | Load/Speed Index | Manufacture | Model  | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------|-------|-----------------|------------------|
| Front Left  | 195/65R15 | 91H              | Annaite     | Radial | V     | 4723            | 0 mm             |
| Front Right | 195/65R15 | 91H              | Annaite     | Radial | V     | 4723            | 0 mm             |
| Rear Left   | 195/65R15 | 95V              | Michelin    | Radial | V     | 0223            | 2 mm             |
| Rear Right  | 185/60R15 | 84H              | Dunlop      | Sp     | V     | 1524            | 2 mm             |

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System      | Code  | Description                      | Status |
|----|-------------|-------|----------------------------------|--------|
| 1  | ABS/VSC/TRC | C1241 | LOW OR HIGH POWER SUPPLY VOLTAGE |        |

**Inspection Conditions**

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Battery loose.  
 Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksdorp, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213

**CONDITION REPORT****Report No:** 2016886016**DATE**  
21/05/2025

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213




## CONDITION REPORT

Report No: 2016886016

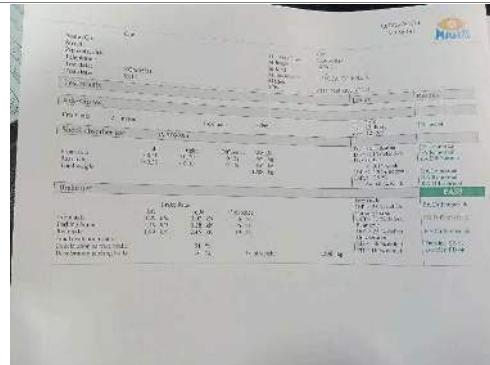DATE  
21/05/2025

Brake test.

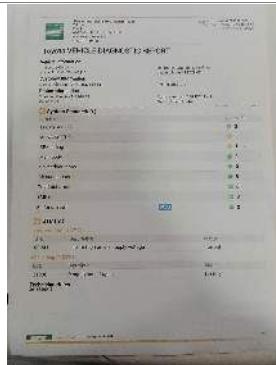

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right



Central Air Vent

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT

Report No: 2016886016

DATE  
21/05/2025

Windscreen



Windscreen Wiper



Seat Front Right



Tyre Front Left



Tyre Front Right



Engine

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213



## CONDITION REPORT


Report No: 2016886016

DATE  
21/05/2025

Gearbox



Brake disc 1. Axle left

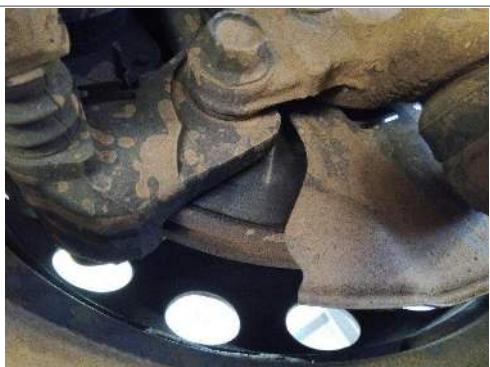

Brake disc 1. Axle right



Tail Light Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTLB52E303142213