



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/03/2024		M57 Pretoria Road - 1619
Inspection Date	01/03/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	JPN790MP
Model	COROLLA QUEST	Register Number	
VIN	AHTLB52E403102125	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/05/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	286,495 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

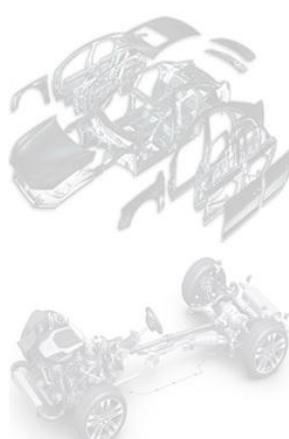

Damage	Repair Way
Engine Oil Leak	Repair
Dim Light Right Defective	Replace
Bright Light Right Defective	Replace
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Replace
Side Mirror Left Damaged	Replace
Rear Lower Valance Damaged	Repair
Front Bumper Damaged	Repair
Sill Panel Right Dented	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Split Pin Right Missing	Replace
Shock Absorber Front Right Sweat	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Alignment Poor Alignment	Repair
Tyre Rear Right Excessive Wear & Tear	Replace
Rim Front Left Welded	Repair
Rim Front Right Dented	Repair
Main Beam Left Damaged	Repair
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
R/R tyre is flat.	Repair.
Electronics	L/F electric mirror malfunction.
Body exterior.	Signs of color fading on all body panels
Body exterior	Some body panels misaligned

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTLB52E403102125

1 / 13



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Damage	Repair Way
Body exterior	Residual traces of poor repair work done on some b
Body exterior	Signs of welding on some body panels
Axle and suspension	Front suspension excessive noise

**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	3.3	2.8	-	
Rear	2.5	3.0	-	
Emergency / Parking	2.1	0.4	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Timax	Eco comfort	V	1323	5 mm
Front Right	185/65R15	88H	Timax	Eco comfort	V	1323	5 mm
Rear Left	195/65R15	91H	Autogrip	Grip	V	3221	4 mm
Rear Right	195/65R15	91T	General	Altimax	V	4022	1 mm
Spare	185/65R15	88H	Continental	Contact	V	//////////	1 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

A vehicle diagnostic has not been conducted.

**Inspection Conditions**

No Test Drive

Vehicle doesn't start

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT

VIN: AHTN52006200123  
Report No: 2006200123

2 / 13

DATE

01/03/2024



Shock and brake report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



## CONDITION REPORT

Report No: 2016289113

VIN: AHTLB52E403102125

DATE

01/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE

VIN: AHTLB52010192024

4 / 13



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

5 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

6 / 13



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

7 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

ENGINE 1



ENGINE 2



CHASSIS



Rear end



Expansion bottle



Oil cap and dipstick



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

9 / 13



# CONDITION REPORT

Report No: 201628913

DATE  
01/03/2024



L/F fender liner missing

	Initial test	Final test	Initial test	Final test	Initial test	Final test
Time at 60°	0.06	0.14	17 min	50 min	5%	5%
Time at 80°	>0.30	0.32	5%	5%	125°	125°
Total weight						
Initial test						

Parking Brake Performance



Water level



## Windscreen



#### Stabilizer Mounting Front Right



#### Front Bumper



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

11 / 13



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Front Bumper



Front Bumper




Front Bumper



Front Bumper



Front Bumper

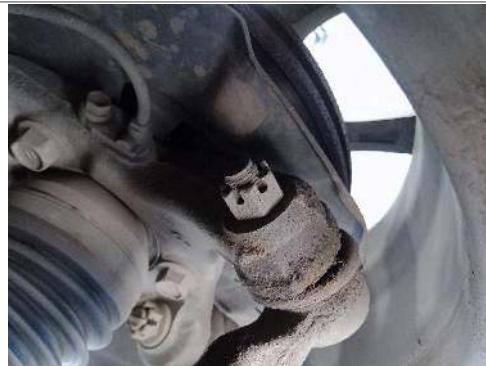

Split Pin Right



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

VIN: AHTLB52E403102125

13 / 13



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Shock Absorber Front Right



Tie Rod End right



Rim Front Right



Rim Front Left



Stabilizer Mounting Front Left



Tie Rod End left



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Rim Front Left



Engine



CV Joint(s) Boot(s) Front Right (inner/outer)



Gearbox



Rear Lower Valance



Rear Lower Valance



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Rear Lower Valance



Rear Lower Valance



Main Beam Left



Tyre Rear Right



Sill Panel Right



Sill Panel Right



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

Seat Rear



Side Mirror Left




Dim Light Right



Bright Light Right



Seat Front Right

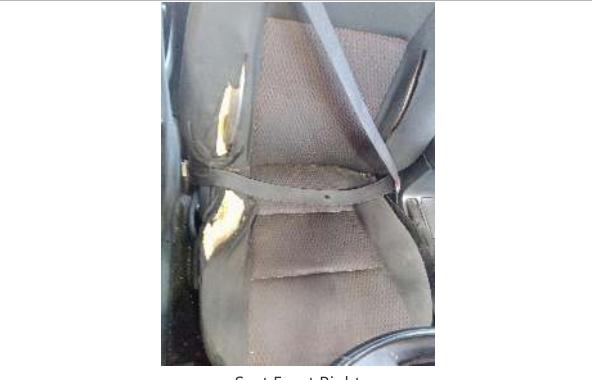



## CONDITION REPORT

Report No: 2016289113

DATE  
01/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)