



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/04/2025		M57 Pretoria Road - 1619
Inspection Date	22/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	NONE
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
VIN	AHTSS22P007131626	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2026
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	251,154 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Caps Damaged	Replace
Hoses Oil Sweat	Replace
Fan Belt Defective	Replace
Battery clamps Corrosion	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Tail Light Left Cracked	Replace
Headlight Left Damaged	Replace
Seat Front Left Defective	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Sun Visor Right Damaged	Repair
Gear Lever Dust Boot Damaged	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Damaged	Repair
Grill Paintwork • Scratched	Repair
Bonnet Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Damage	Repair Way
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Rear Fender Right / Inner Tray Paintwork • Scratched	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Windscreen Cracked	Replace
Window Rear Door Left Defective	Repair
Service Brake Performance Rear Axle Insufficient	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Steering Rack Defective	Replace
Rebound Rubber Front Axle Left Cracked	Replace
Rebound Rubber Front Axle Right Cracked	Replace
Stabilizer Mounting Front Left Damaged	Replace
Control Arm(s) Front Axle Left Damaged	Replace
Tyre Front Right Torn / Cut	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Rim Rear Right Scratched	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Damaged	Repair
Catalytic converter Missing	Replace
Gearbox Oil Leak	Repair
Fuel Tank Dented	Repair
Radiator Cradle Damaged	Repair
Steering Loose / Excessive Play	Repair
Brakes Insufficient	Repair
Gear Selections Malfunction	Repair
Clutch Operation Noisy	Repair
Interior	Rear left door side step damaged
Interior	Rear left window net missing
Road test	Vehicle unsafe to drive.
Front right shock absorber weak	Replace
Engine	Engine oil sump
Brakes	Rear left brake piping damaged
Tyres and rims	Spare wheel missing
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Signs of impact damage to rear of vehicle
Interior	Aftermarket sound fitted to vehicle
Body and Exterior	Rear left door lock damaged
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Some body panels misaligned
Rear tyres size differs	Replace
Airbag warning light illuminated	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

 DATE
22/04/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.81	3.93	-	
Rear	0.0	0.0	-	
Emergency / Parking	2.36	0.89	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	106S	Velocity	Radial	V	2923	1 mm
Front Right	195R15C	106R	Velocity	Radial	V	2923	1 mm
Rear Left	195/70 R15C	104S	Dunlop	Endura	V	4122	8 mm
Rear Right	195R15C	106R	Dunlop	Vantrek	V	1121	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/VSC/TRC	C1201	ENGINE E/V CONTROL SYSTEM MALFUNCTION	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Vehicle Data			
Vehicle No:	2016850176	Client No:	2016850176
Make:	TOYOTA	Model:	PROACE
Year:	2014	Engine:	1.8L
Test Date:	2024/04/22	Test Time:	11:47
Test Location:	THERMATECH		
Test Result:	PASS		
Shock Absorber Test			
Front Left:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Front Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg
Front Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Rear Left:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg
Rear Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Total weight: 1200 kg	

Brake and shock absorber report

Shock Absorber Test			
Front Left:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Front Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg
Front Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Rear Left:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg
Rear Right:	Left: 0.16, Right: 0.15, Difference: 0.01, Weight: 1200 kg	Total weight: 1200 kg	

Shock absorber readings

Vehicle Data			
Vehicle No:	2016850176	Client No:	2016850176
Make:	TOYOTA	Model:	PROACE
Year:	2014	Engine:	1.8L
Test Date:	2024/04/22	Test Time:	11:47
Test Location:	THERMATECH		
Test Result:	PASS		

Diagnostic report page 1

Vehicle Data			
Vehicle No:	2016850176	Client No:	2016850176
Make:	TOYOTA	Model:	PROACE
Year:	2014	Engine:	1.8L
Test Date:	2024/04/22	Test Time:	11:47
Test Location:	THERMATECH		
Test Result:	PASS		

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

90 DEGREE REAR




90 DEGREE LEFT




LF TYRE TREAD



RR TYRE TREAD

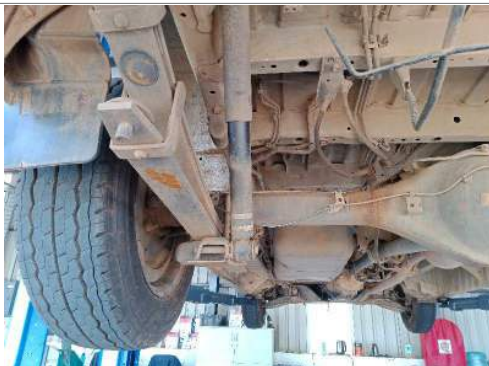

LR TYRE TREAD

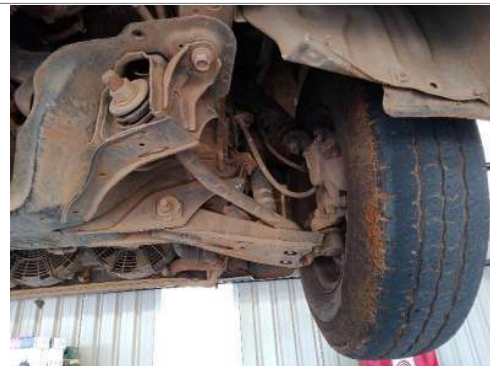

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626




CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

LICENSE DISC

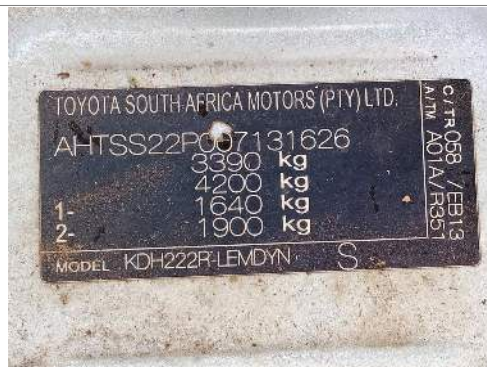

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear Chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Rear left door step box



Engine oil sump



Rear left brake piping



Spare wheel Accessories



Rear left door lock



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Steering Wheel Trim



Seat Front Right



Door Front Right



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Grill



Windscreen



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Headlight Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Door Front Left



Door Rear Left



Rear Fender Left



Sill Panel Left



Battery clamps



Caps

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Seat Rear



Seat Rear



Seat Rear (2. Row)



Seat Rear (2. Row)



Rear Fender Left / Inner Tray



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Window Rear Door Left



Rear Fender Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025


Steering Wheel Trim




Sun Visor Right



Gear Lever Dust Boot

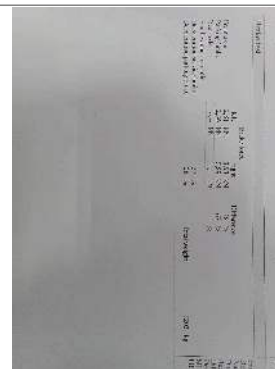

Parking Brake Performance

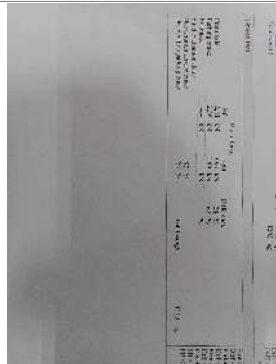

Service Brake Performance Rear Axle



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Tyre Front Right



Rim Front Right



Tyre Rear Right



Rim Rear Right



Rim Rear Left



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025


Sill Panel Left



Engine



Gearbox

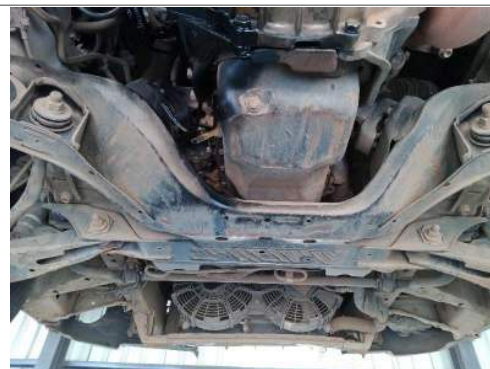

Sub Frame



Control Arm(s) Front Axle Left



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Hoses



Steering Rack



Fan Belt



Rebound Rubber Front Axle Right



Rebound Rubber Front Axle Left



Catalytic converter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626



CONDITION REPORT

Report No: 2016850176

DATE
22/04/2025

Fuel Tank



Engine to silencer pipe



Tyre Rear Right



Rear Fender Left / Inner Tray



Stabilizer Mounting Front Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626

**CONDITION REPORT**

Report No: 2016850176

DATE
22/04/2025

Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007131626