



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/02/2026		M57 Pretoria Road - 1619
Inspection Date	20/02/2026		Kempton Park -

Vehicle Data

Vehicle Type	MINI BUS	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KYH098MP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
		Date Of First Licensing	
VIN	AHTSS22P207151456	Last COR	
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	DIESEL
Km Reading	62,333 KM	Transmission	MANUAL
Cab / Body Type	OTHERS		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



Damage	Repair Way
Engine Management Lights Set	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Left Worn	Repair
Seat Front Right Worn	Repair
Window Winder front right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Repair
Brakes Insufficient	Repair
Clutch Operation Insufficient	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.35	5.24	-	
Rear	3.13	3.52	-	
Emergency / Parking	2.45	2.25	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	104S	Toyo	Radial	V	2123	0 mm
Front Right	195R15C	104R	Autogrip	Radial	V	0325	0 mm
Rear Left	195R15C	104S	Toyo	Radial	V	2323	0 mm
Rear Right	195R15C	104S	Toyo	Radial	V	2223	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	SRS AIRBAG	B1801	DRIVING SIDE SQUIB CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. VEHICLE IS A CUT AND JOIN. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Repair work done to vehicle below standard. Signs of impact damage to front of vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
6 DTC'S AT TIME OF TESTIN
G SEE DTC REPORT.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:

Report No.
2017165812

DATE


20/02/2026




Oil cap and dipstick.



Manual.

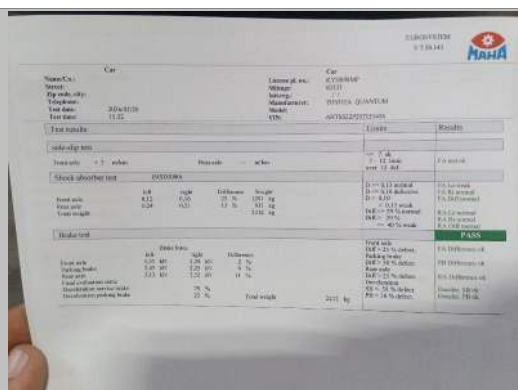

Brake test.

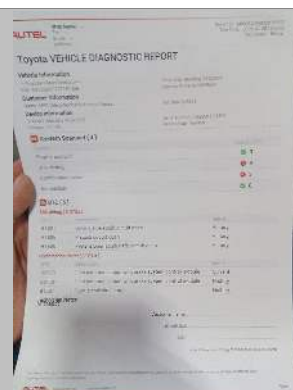

Diagnostic.



Undercarriage front.



Undercarriage rear.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

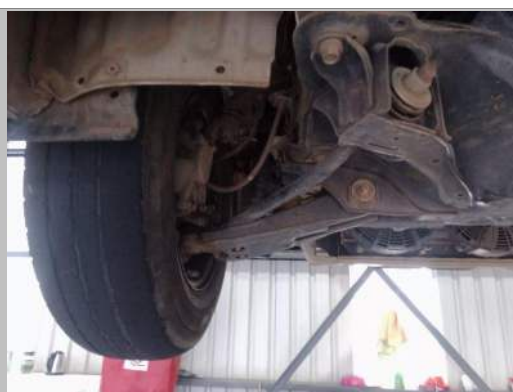

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT




Report No:
2017165812
DATE
20/02/2026



RF TYRE TREAD



LICENSE DISC

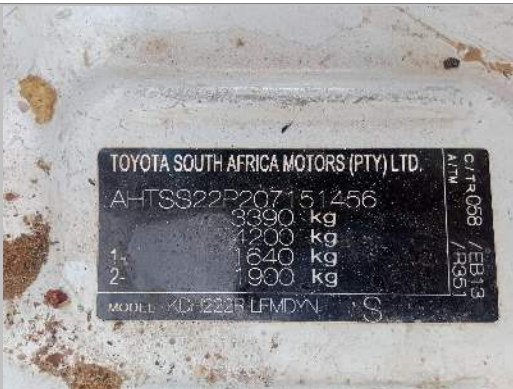

VIN PLATE OR STICKER



ENGINE 1



vehicle is a cut and join



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456




CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



Seat Front Left

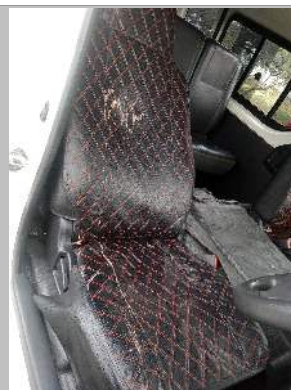

Seat Front Right



Front Bumper



Front Bumper



Bonnet



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



Door Front Left



Sill Panel Left



Rear Fender Left



Boot Lid / Hatch door



Rear bumper



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



Door Front Right



Windscreen



Engine Management Lights



Tail Light Left



Tail Light Right



Window Winder front right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026

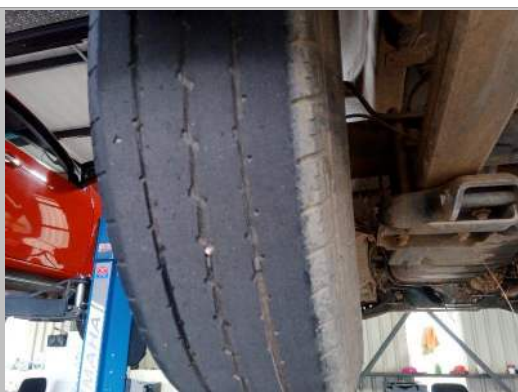

Tyre Rear Left



Tyre Rear Right



Tyre Front Left



Tyre Front Right



Gearbox



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456



CONDITION REPORT



Report No:
2017165812
DATE
20/02/2026



Front Fender Left / Inner Tray



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207151456