



## CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
GautengDEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 06/05/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 06/05/2025        |                     | Kempton Park - GT        |

## Vehicle Data


|                 |                             |                         |              |
|-----------------|-----------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE           | Registered Owner        |              |
| Manufacturer    | MAZDA                       | Registration Number     | HGL017L      |
| Model           | CX-3 2.0 ACTIVE [2018-2021] | Register Number         |              |
| VIN             | JM6DK2W76K0418626           | Date Of First Licensing |              |
| Engine Number   |                             | Last COR                |              |
| Doors           | 5                           | License Expiry Date     | 31/07/2025   |
| Color           | RED                         | Power / Displacement    |              |
| Year Model      | 2019                        | Paint Finish            | M - METALLIC |
| Km Reading      | 90,568 KM                   | Fuel                    | PETROL       |
| Cab / Body Type | STATION WAGON               | Transmission            | MANUAL       |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

| Damage                                      | Repair Way                                         |
|---------------------------------------------|----------------------------------------------------|
| Front Bumper Paintwork • Scratched          | Repair                                             |
| Bonnet Paintwork • Scratched                | Repair                                             |
| Front Fender Left Paintwork • Scratched     | Repair                                             |
| Rear Fender Left Paintwork • Scratched      | Repair                                             |
| Door Front Right Paintwork • Scratched      | Repair                                             |
| Door Rear Left Paintwork • Scratched        | Repair                                             |
| Door Rear Right Paintwork • Scratched       | Repair                                             |
| Boot Lid / Hatch door Paintwork • Scratched | Repair                                             |
| Rear bumper Paintwork • Scratched           | Repair                                             |
| Body exterior                               | Vehicle got minor scratches, stone chips and dents |
| Engine management lights illuminated        | Repair                                             |

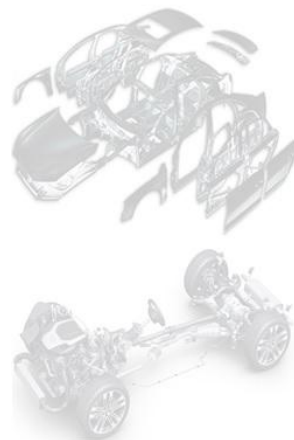DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JM6DK2W76K0418626



## CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025

### Brakes

#### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.2                | 3.3                | -                |                                  |
| Rear                | 2.2                | 2.3                | -                |                                  |
| Emergency / Parking | 0.5                | 0.6                | -                |                                  |

### Tyres and Rims

#### Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model      | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|------------|-------|-----------------|------------------|
| Front Left  | 215/65R16 | 98H              | Royal black | Royal mile | V     | 1124            | 4 mm             |
| Front Right | 215/65R16 | 98H              | Royal black | Royal mile | V     | 1124            | 4 mm             |
| Rear Left   | 215/65R16 | 98H              | Royal black | Royal mile | V     | 1124            | 4 mm             |
| Rear Right  | 215/65R16 | 98H              | Royal black | Royal mile | V     | 1124            | 4 mm             |

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code        | Description    | Status |
|----|--------|-------------|----------------|--------|
| 1  | CMDTCS | B1206:00-48 | CRASH OCCURRED |        |

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JM6DK2W76K0418626



## CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025

| Client              |     | Contract no. |      | Contract date |      |
|---------------------|-----|--------------|------|---------------|------|
| Name                |     | Address      |      | City          |      |
| Registration        |     | Vehicle no.  |      | Vehicle type  |      |
| Type                |     | Brand        |      | Model         |      |
| Year                |     | Color        |      | VIN           |      |
| Shock absorber type |     |              |      |               |      |
| Front left          | SAF | 100%         | 100% | 100%          | 100% |
| Front right         | SAF | 100%         | 100% | 100%          | 100% |
| Rear left           | SAF | 100%         | 100% | 100%          | 100% |
| Rear right          | SAF | 100%         | 100% | 100%          | 100% |
| Brake type          |     |              |      |               |      |
| Front left          | SAF | 100%         | 100% | 100%          | 100% |
| Front right         | SAF | 100%         | 100% | 100%          | 100% |
| Rear left           | SAF | 100%         | 100% | 100%          | 100% |
| Rear right          | SAF | 100%         | 100% | 100%          | 100% |

Shock and brake report

| Client       |  | Contract no. |  | Contract date |  |
|--------------|--|--------------|--|---------------|--|
| Name         |  | Address      |  | City          |  |
| Registration |  | Vehicle no.  |  | Vehicle type  |  |
| Type         |  | Brand        |  | Model         |  |
| Year         |  | Color        |  | VIN           |  |
| Engine       |  |              |  |               |  |
| Transmission |  |              |  |               |  |
| Steering     |  |              |  |               |  |
| Suspension   |  |              |  |               |  |
| Brakes       |  |              |  |               |  |
| Electrical   |  |              |  |               |  |
| Safety       |  |              |  |               |  |
| Other        |  |              |  |               |  |

Diagnostic report

| Client       |  | Contract no. |  | Contract date |  |
|--------------|--|--------------|--|---------------|--|
| Name         |  | Address      |  | City          |  |
| Registration |  | Vehicle no.  |  | Vehicle type  |  |
| Type         |  | Brand        |  | Model         |  |
| Year         |  | Color        |  | VIN           |  |
| Engine       |  |              |  |               |  |
| Transmission |  |              |  |               |  |
| Steering     |  |              |  |               |  |
| Suspension   |  |              |  |               |  |
| Brakes       |  |              |  |               |  |
| Electrical   |  |              |  |               |  |
| Safety       |  |              |  |               |  |
| Other        |  |              |  |               |  |

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JM6DK2W76K0418626



## CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JM6DK2W76K0418626



## CONDITION REPORT


Report No: 2016866417

DATE  
06/05/2025


90 DEGREE LEFT




LF TYRE TREAD

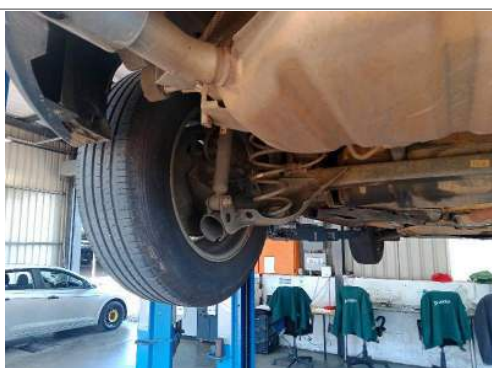

LR TYRE TREAD

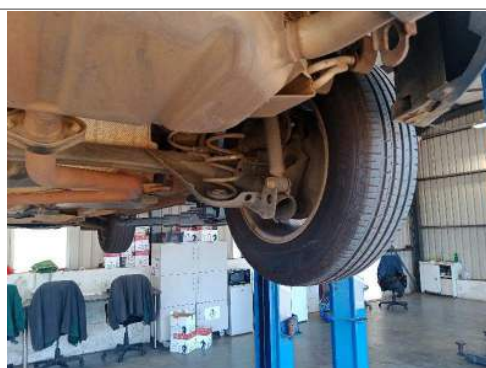

RR TYRE TREAD

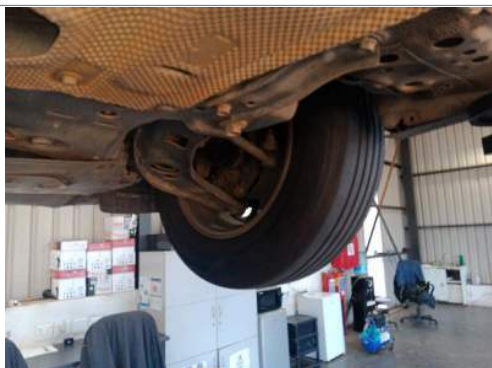

RF TYRE TREAD



No spare wheel

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JM6DK2W76K0418626



CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JM6DK2W76K0418626



## CONDITION REPORT

Report No: 2016866417

DATE  
06/05/2025


Oil cap and dipstick



Boot Lid / Hatch door



Rear bumper

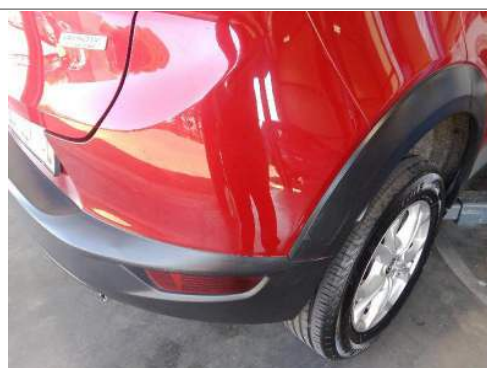

Rear bumper



Water level



Bonnet


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JM6DK2W76K0418626



## CONDITION REPORT

Report No: 2016866417

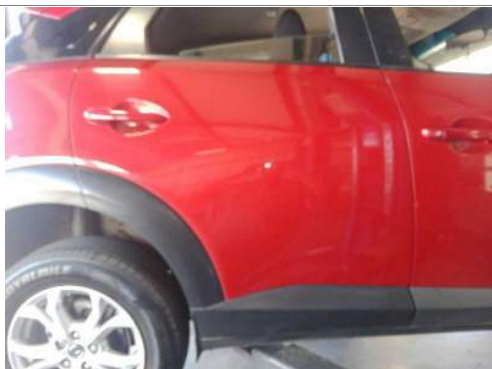DATE  
06/05/2025

Door Rear Right




Door Front Right




Front Bumper



Front Bumper

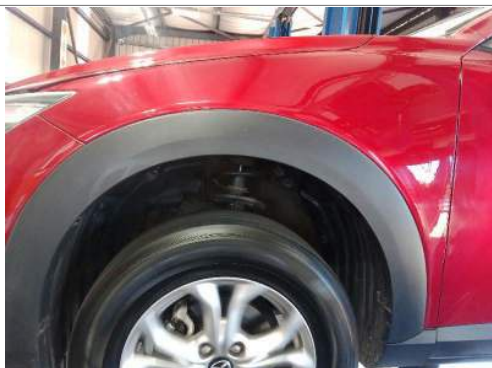

Front Fender Left

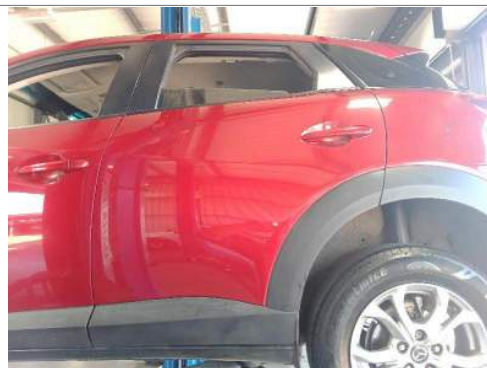

Door Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JM6DK2W76K0418626

**CONDITION REPORT**

Report No: 2016866417

DATE  
06/05/2025

Rear Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JM6DK2W76K0418626