



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/02/2024		M57 Pretoria Road - 1619
Inspection Date	08/02/2024		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MITSUBISHI	Registration Number	HPY327EC
Model	ASX	Register Number	
VIN	JMYXTGA2WFZ002379	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	176,655 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Rear Fender Left Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Tyre Rear Left Smooth	Replace

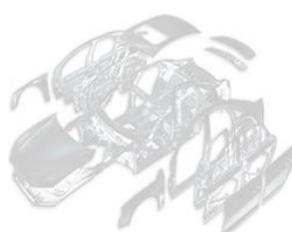



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.4	3.6	-	
Rear	2.5	2.4	-	
Emergency / Parking	1.8	1.7	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Continental	Contact	V	2319	3 mm
Front Right	215/60R17	96H	Yokohama	Aspec	V	0315	1 mm
Rear Left	215/60R17	96H	Kumho	Solus	V	0319	0 mm
Rear Right	215/60R17	96H	Continental	Contact	V	5017	5 mm
Spare	215/60R17	96H	Kumho	Solus	V	//////	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Electronics malfunction. Radio not working.

Body • Exterior:

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MYXTA2100000091

Report No: 2014260091

2 / 8

DATE

08/02/2024

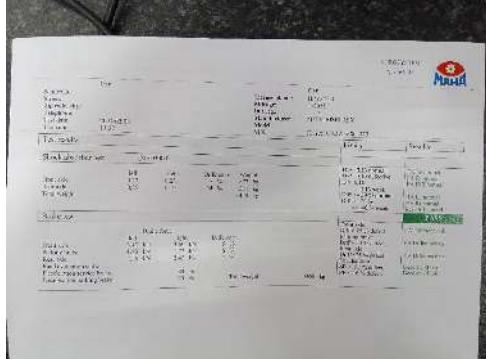

Shock and brake report



Diagnostic test



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No:** 2016260091

VIN: JMYXTGA2WFZ002379

DATE

08/02/2024

3/8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE

VIN: JMYXTGA2W~~E7002379~~

4 / 8



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE BEAR



22 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

VIN: JMYXTGA2WFZ002379

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

VIN: JMYXTGA2WFZ002379

7 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Automatic



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

Radio screen damage



Coolant reservoir



Oil cap and dipstick



Door Front Left



Rear Fender Left



Engine



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

Tyre Rear Left



CONDITION REPORT

Report No: 2016260091

DATE
08/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za