

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/03/2025		M57 Pretoria Road - 1619
Inspection Date	27/03/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	LK73ZYGP
Model	VITZ 1.0 5-DR [2023-ON]	Register Number	
VIN	JTDVFN62S00239403	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2025
Color	SILVER	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	78,312 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Radio/CD/USB Defective	Repair
Headlight Left Damaged	Replace
Seat Front Left Dirty	Repair
Seat Rear Dirty	Repair
Side Mirror Left Residual Traces of Repair	Replace
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Replace
Caliper 1. Axle right Defective	Repair
Rear Axle Defective	Repair
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDVFN62S00239403

Damage	Repair Way
Spare Tyre Damaged	Replace
Rim Front Right Dented	Repair
Rim Spare Wheel Dented	Repair
Radiator Cradle Dented	Repair
Clutch Operation Noisy	Repair
Interior	Loose wiring inside boot of vehicle
Undercarriage	Vehicle undercarriage dirty
Body and Exterior	Signs of impact damage to rear of vehicle.
Body and Exterior	Dents and scratches on some body panels
Interior	Vehicle interior dirty and some panels scratched
Engine	Engine bay dirty.
Axle and suspension	Signs of vehicle grabbing
Body and Exterior	Some body panels misaligned

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.68	1.9	-	
Rear	1.26	1.31	-	
Emergency / Parking	0.91	1.03	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81S	Bridgestone	Ecopia	V	0823	0 mm
Front Right	165/70 R14	81S	Bridgestone	Ecopia	V	0823	0 mm
Rear Left	165/70 R14	81S	Bridgestone	Ecopia	V	0723	0 mm
Rear Right	165/70 R14	81S	Bridgestone	Ecopia	V	0823	0 mm
Spare	165/70 R14	81S	Bridgestone	Ecopia	V	0723	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase
DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDVFN62S00239403


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Manual transmission

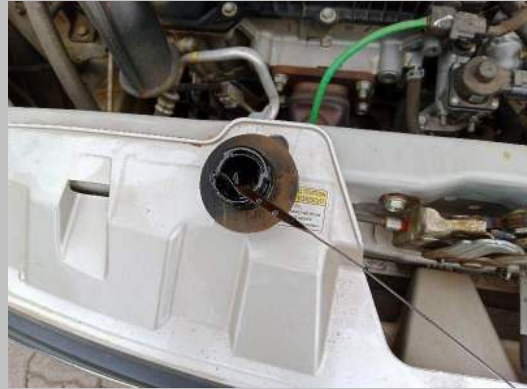

Oil cap and dipstick



Spare wheel and Accessories





Front chassis



Rear chassis



Jack

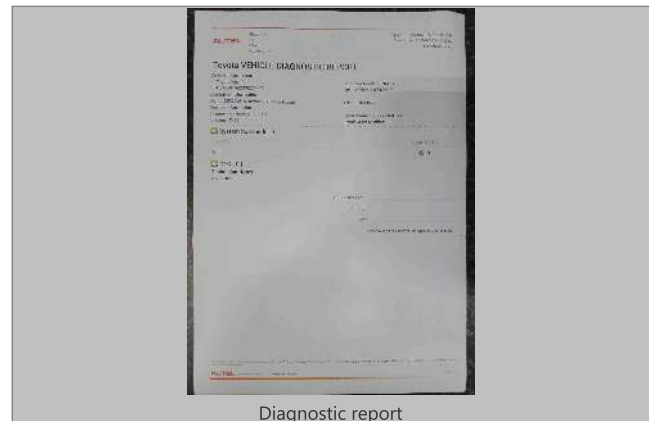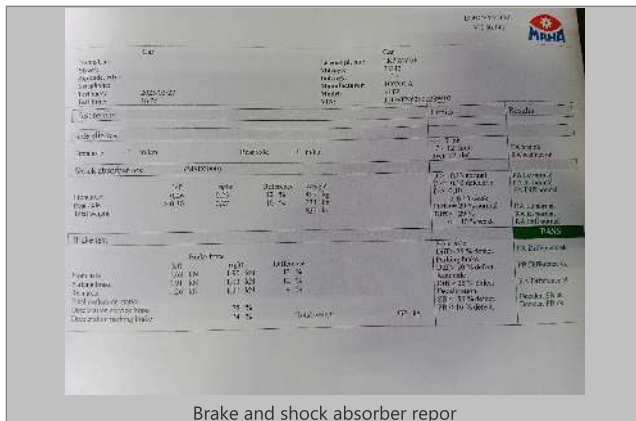



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Seat Rear



Seat Front Left



Rear bumper



Rear bumper



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



Windscreen



Front Bumper



Front Bumper



Bonnet



Headlight Left



Water level



Spare Tyre



Rim Spare Wheel



Rim Front Right



Rear Fender Left / Inner Tray




Tyre Front Right




Tyre Front Left



Radiator Cradle

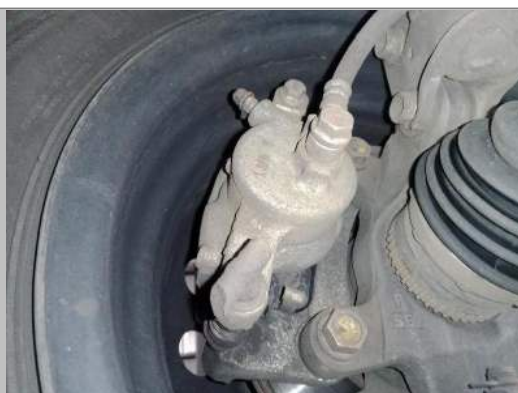

Caliper 1. Axle right

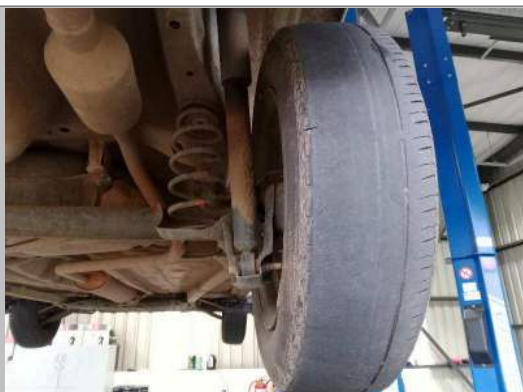

Tyre Rear Right



Tyre Rear Left



Side Mirror Left



Radio/CD/USB



Rear Axle



CONDITION REPORT

Report No: 2016818293

DATE
27/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDVFN62S00239403