



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/10/2026		M57 Pretoria Road - 1619
Inspection Date	01/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	LT66GWGP
Model	ACCENT	Register Number	
VIN	KMHCT41DLJU388010	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	197,078 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:

2017305874

DATE

01/10/2026



Damage	Repair Way
Clamps Damaged	Replace
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Repair
B • Pillar Left Dented	Repair
C • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Damaged	Repair
Windscreen Chipped	Replace
Alignment Left / Right Difference out of legal range	Repair
Rim Rear Left Damaged	Replace
Belly plates Damaged	Repair
Gearbox Oil Leak	Repair
Clutch Operation Slippery Hesitation	Repair
Body exterior	Residual traces of poor repair on body panels
Body exterior	Signs of spray work done on body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.8	-	
Rear	2.1	2.0	-	
Emergency / Parking	1	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Roadking	Argos	V	3725	3 mm
Front Right	175/70R14	84T	Roadking	Argos	V	3725	5 mm
Rear Left	175/70R14	84T	Tracmak	Privilo	V	1026	6 mm
Rear Right	175/70R14	84T	Anchee	AC808	V	2225	3 mm
Spare	165/65R14	79T	Davanti	DX	V	000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0642	SENSOR REFERENCE VOLTAGE A CIRCUIT LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHCT41DLJU388010




CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026

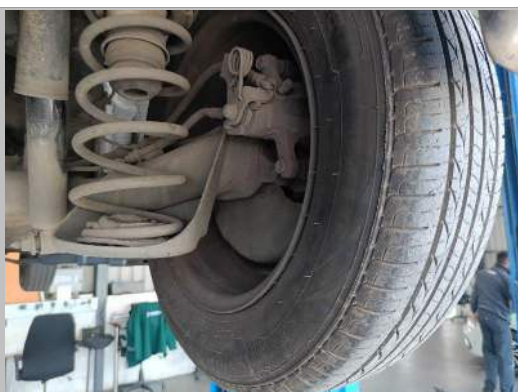

RR TYRE TREAD

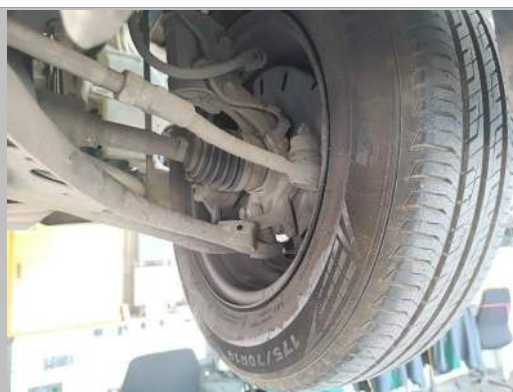

RF TYRE TREAD



Sparewheel



Oil cap and dipstick



Coolant reservoir



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:

2017305874

DATE

01/10/2026



ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC MISSING

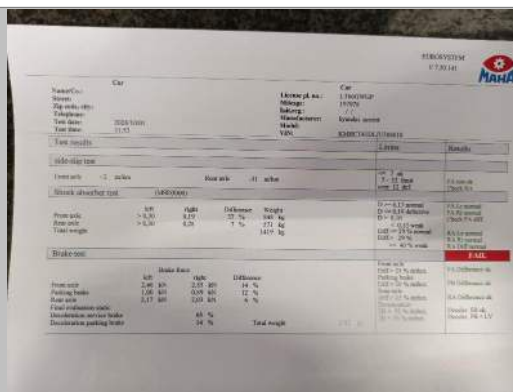

SHOCK AND BRAKE REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010




CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



DIAGNOSTIC REPORT PAGE 1

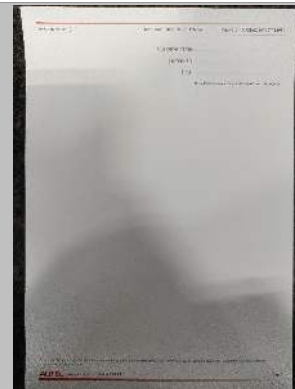

DIAGNOSTIC REPORT PAGE 2



R/F fender liner missing



L/F fender liner missing



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



Rear Fender Right



Rear Fender Left



Door Rear Left



Door Rear Left



Door Rear Left



C • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



C • Pillar Left



C • Pillar Left



B • Pillar Left



Door Front Left



Front Fender Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



Windscreen



Clamps



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:

2017305874

DATE

01/10/2026



Front Bumper



Front Bumper



Grill



Grill



Grill



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010



CONDITION REPORT



Report No:
2017305874
DATE
01/10/2026



Rim Rear Left



Rear bumper



Belly plates



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU388010