



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
GautengDEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/05/2025		M57 Pretoria Road - 1619
Inspection Date	22/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	HR05FYGP
Model	ACCENT	Register Number	
VIN	KMHCT41DLJU438487	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2019
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	301,409 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Air conditioner pump Damaged	Replace
Indicator Light Front Right Cracked	Replace
Side Mirror Left Damaged	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Paintwork • Scratched	Repair
A • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Left Paintwork • Scratched	Repair
Windscreen Cracked	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025

Damage	Repair Way
Service Brake Performance Front Axle Left / Right	Repair
Difference out of legal range	
Rim Rear Left Dented	Repair
Body exterior	Residual traces of poor repair on most body panels
Body exterior	Signs of spray work done on most body panels
Engine warning lights illuminated	Repair
Sparewheel well damage	Repair
Bootlid does not close	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.5	1.4	-	
Rear	2.1	1.9	-	
Emergency / Parking	1.1	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84H	Powertrac	Adamas	V	3724	4 mm
Front Right	175/70R14	84H	Automatic	Grip200	V	0923	1 mm
Rear Left	195/50R15	82V	Dunlop	Sport	V	0822	1 mm
Rear Right	195/50R15	82V	Dunlop	Sport	V	0822	1 mm
Spare	175/70R14	84T	Kumho	Solus	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0268	CYLINDER 3 INJECTOR CIRCUIT HIGH	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: KMHCT41DLJU438487

**CONDITION REPORT****Report No: 2016887396****DATE**
22/05/2025

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396


DATE
22/05/2025

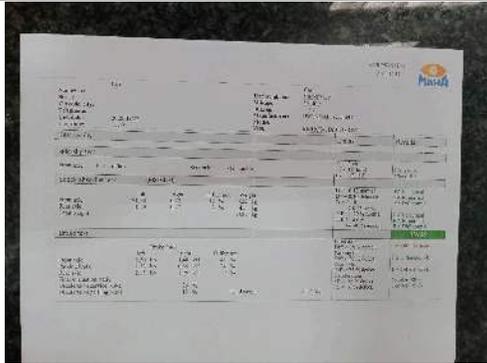

Shock and brake report



Diagnostic test

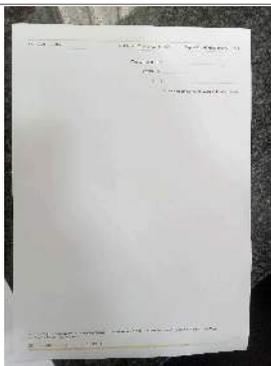

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



90 DEGREE LEFT



Sparewheel well damage



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



Sparewheel



Sparewheel well damage



Sparewheel well damage



Sparewheel well damage



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Engine warning lights illumina



R/F fender liner missing

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



R/F headlight clips broken



Coolant reservoir



Oil cap and dipstick



Front Fender Right



Windscreen



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



Side Mirror Left



Door Front Right



Door Rear Right



Rear Fender Right



A • Pillar Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



Rear Fender Right / Inner Tray



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear Fender Left



Door Rear Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



Indicator Light Front Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487



CONDITION REPORT

Report No: 2016887396

DATE
22/05/2025



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Air conditioner pump



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU438487