



CONDITION REPORT



Report No:
2016947361
DATE
15/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/07/2025		M57 Pretoria Road - 1619
Inspection Date	15/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	DL80XJGP
Model	ACCENT 1.6 FLUID 6-SP [2013-2021]	Register Number	
VIN	KMHCU41DLFU812502	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2025
Color	GREY	Power / Displacement	
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	616,861 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCU41DLFU812502



Damage	Repair Way
Engine Oil Leak	Repair
Head Light Switch Damaged	Replace
Switch Electrical Window Winder front left Defective	Repair
Seat Front Right Torn / Cut	Repair
Rear Lower Valance Damaged	Repair
Front Bumper Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Dented	Repair
Rear Fender Right / Inner Tray Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Left Damaged	Repair
Roof Dented	Repair
Tie Rod End left Damaged	Replace
Split Pin Left Missing	Replace
Stabilizer Mounting Front Left Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Torn / Cut	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Smooth	Replace
Rim Rear Left Damaged	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Gear Selections Insufficient	Repair
No battery	Replace
Front tyre size differs	Replace
Rear tyre size differs	Replace
Warning lights illuminated	Repair
Front suspension excessive noise	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.2	2.9	-	
Rear	2.0	1.7	-	
Emergency / Parking	1	0.7	-	



Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65R14	79H	Aplus	S600	V	0000	0 mm
Front Right	165/60R14	75H	Autogrip	Grip200	V	0000	0 mm
Rear Left	165/65R14	79T	General	Altimax	V	4418	1 mm
Rear Right	185/65R14	86H	Firestone	Touring	V	0000	0 mm
Spare	165/60R14	75H	Double king	DK558	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0620	ALTERNATOR CONTROL CIRCUIT ENGINE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on most body panels. Signs of spray work done on most body panels.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

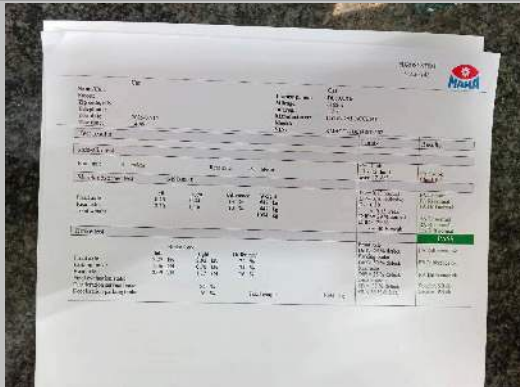

Shock and brake report

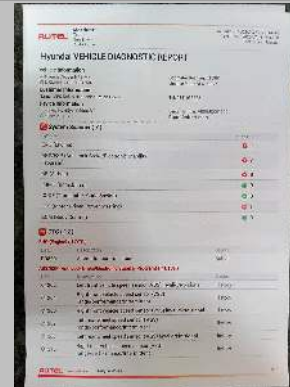

Diagnostic test

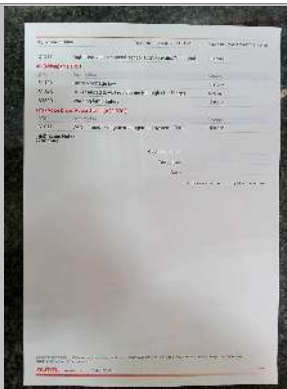

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Coolant reservoir



Warning lights illuminated



Brake booster oil sweat



No battery



Oil cap and dipstick



Spare Tyre



Door Front Left



Door Front Left



Door Front Left



Seat Front Right



Rear Fender Right



Rear Fender Left



Door Front Right



Front Fender Left



Roof



Tyre Front Right



Tyre Front Right



Control Arm Bush(es) Front Axle Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Stabilizer Mounting Front Left



Tie Rod End left



Rim Rear Left



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Split Pin Left



Gearbox



Gearbox



Engine



Engine



Sill Panel Left



Sill Panel Left



Tyre Rear Right



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Lower Valance



Rear Lower Valance



Head Light Switch



Switch Electrical Window Winder front left