

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

| | | | |
|-----------------|-------------------|---------------------|--------------------------|
| Client | MFC Auction House | Inspection Location | MFC |
| Requested Date | 25/03/2024 | | M57 Pretoria Road - 1619 |
| Inspection Date | 25/03/2024 | | Kempton Park - GT |

Vehicle Data


| | | | |
|-----------------|-------------------|-------------------------|-------------------|
| Vehicle Type | PASSENGER VEHICLE | Registered Owner | MFC AUCTION HOUSE |
| Manufacturer | HYUNDAI | Registration Number | HY01KLGP |
| Model | ELANTRA | Register Number | |
| VIN | KMHD041BVJU752052 | Date Of First Licensing | |
| Engine Number | | Last COR | |
| Doors | 4 | License Expiry Date | 31/07/2024 |
| Color | WHITE | Power / Displacement | |
| Year Model | | Paint Finish | C - COMMON |
| Km Reading | 101,461 KM | Fuel | PETROL |
| Cab / Body Type | SEDAN | Transmission | AUTOMATIC |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

| Damage | Repair Way |
|--|------------|
| Front Bumper Paintwork • Scratched | Repair |
| Rear bumper Paintwork • Scratched | Repair |
| Tyre Front Left Damaged | Replace |
| Tyre Front Right Damaged | Replace |
| Rim Rear Left Dented | Repair |
| Bolt(s) / Nut(s) Front Wheel Right Missing | Replace |

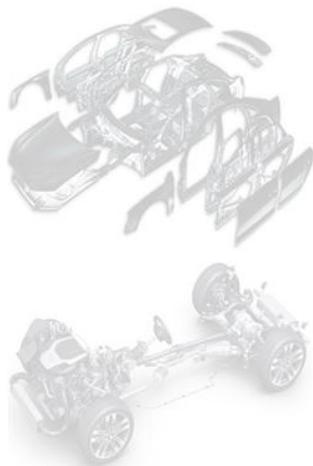

Brakes

Brake Test Results

| | Left | Right | | |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
| | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s ²] |
| Front | 2.9 | 3.0 | - | |
| Rear | 1.8 | 1.7 | - | |
| Emergency / Parking | 1.8 | 1.9 | - | |

Tyres and Rims

Tyre Specification & Measurement

| | Size | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left | 225/45R17 | 94Y | Tracmak | Privilo | V | 4520 | 0 mm |
| Front Right | 225/45R17 | 94W | Cachland | CH861 | V | 4621 | 2 mm |
| Rear Left | 225/45R17 | 94Y | Tracmak | Privilo | V | 4420 | 1 mm |
| Rear Right | 225/45R17 | 94Y | Tracmak | Privilo | V | 4720 | 2 mm |
| Spare | T125/80D16 | 97M | Hankook | Temporary | V | 0000 | 5 mm |

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
 UNDERCARRIAGE & ENGINE CO
 VERED

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic



Sparewheel



Expansion bottle



Oil cap and dipstick




Rear end



LF TYRE TREAD



LR TYRE TREAD

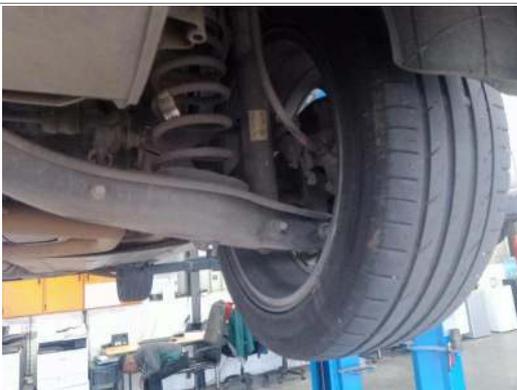


RR TYRE TREAD




RF TYRE TREAD

VIN: KMHD041BVJU752052

7 / 8

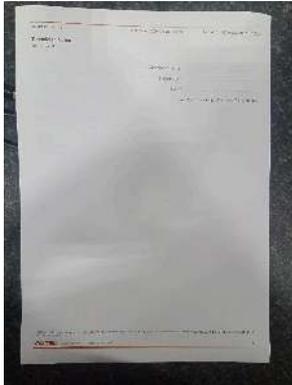

DIAGNOSTIC REPORT PAGE 2

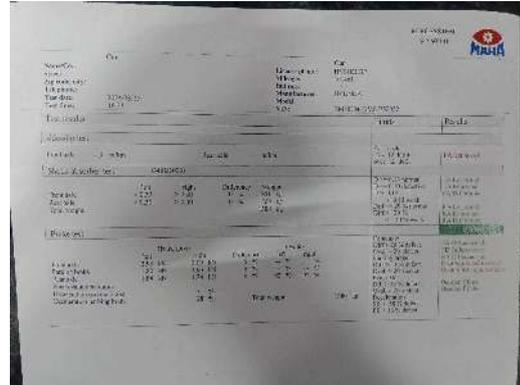

SHOCK & BRAKE REPORT



Bolt(s) / Nut(s) Front Wheel Right



Tyre Front Right



Front Bumper



Tyre Front Left



Rear bumper



Rear bumper



Tyre Front Left



Rim Rear Left



CONDITION REPORT

Report No: 2016317760

DATE
25/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za