

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/04/2025		M57 Pretoria Road - 1619
Inspection Date	23/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	KK85YGGP
Model	ELANTRA	Register Number	
VIN	KMHDH41EMDU669971	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/05/2025
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	162,473 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Air conditioner pipes Defective	Repair
Cigarette Lighter Defective	Repair
Switch Electrical Window Winder front right Damaged	Replace
Air Conditioner Insufficient	Replace
Indicator Light Front Left Damaged	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Fog Light Front Left Defective	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Defective	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Torn / Cut	Replace
Steering Wheel Trim Defective	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41EMDU669971

Damage	Repair Way
Bonnet Damaged	Repair
A • Pillar Left Paintwork • Discoloured	Repair
B • Pillar Left Damaged	Repair
C • Pillar Left Paintwork • Discoloured	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Paintwork • Discoloured	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Discoloured	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Right Damaged	Repair
Service Brake Performance Front Axle Left / Right	Repair
Difference out of legal range	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Worn	Replace
Rim Front Left Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Rim Spare Wheel Dented	Repair
Chassis Damaged	Repair
Engine to silencer pipe Damaged	Repair
Silencer Damaged	Replace
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
Radiator Cradle Damaged	Replace
Steering Malfunction	Repair
Airbag warning light illuminated on dashboard	Repair
Tyres and rims	Spare wheel lockdown pin damaged
Body and Exterior	Jigmarks on left and right sill panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Signs of impact damage to rear of vehicle
Tyres and rims	Front left and rear left center caps missing.
Body and Exterior	Signs of impact damage to front of vehicle
Tyres and rims	Front and rear tyre sizes different.

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.14	1.9	-	
Rear	1.87	1.43	-	
Emergency / Parking	1.36	0.98	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45 R17	91W	Dunlop	Sp-Sport	V	2116	0 mm
Front Right	215/45 R17	87H	Hankook	Ventus	V	1715	0 mm
Rear Left	215/45Z R17	91H	Kapsen	Sportmax	V	3417	1 mm
Rear Right	225/45 R17	91W	Continental	Contisport	V	0508	0 mm
Spare	185/65 R15	88H	Bridgestone	B250	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI LOCK BRAKE ELECTRONIC STABILITY	C1200	LEFT FRONT VEHICLE SPEED SENSOR(VSS) CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

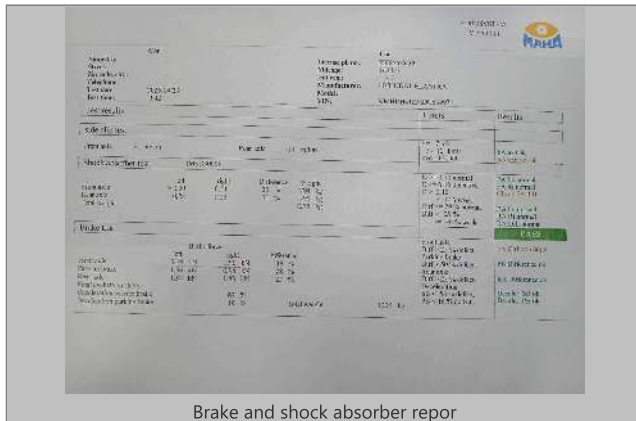

Brake and shock absorber report

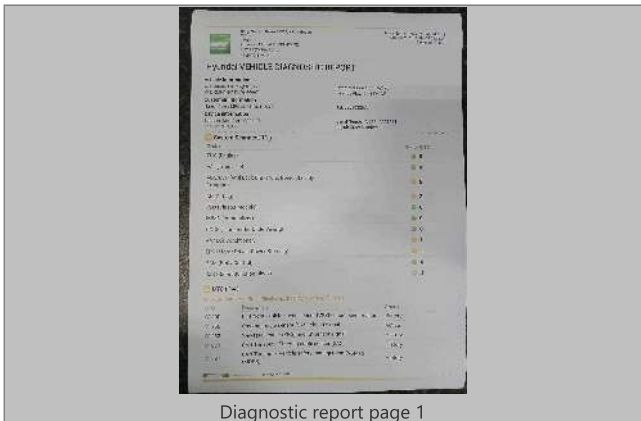

Diagnostic report page 1

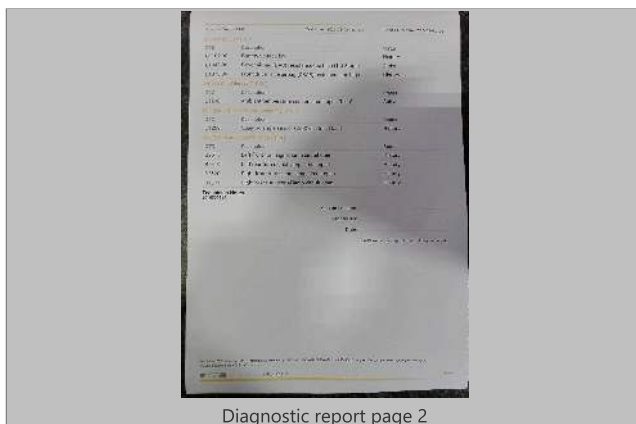

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



Spare wheel lock down pin



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



Front chassis

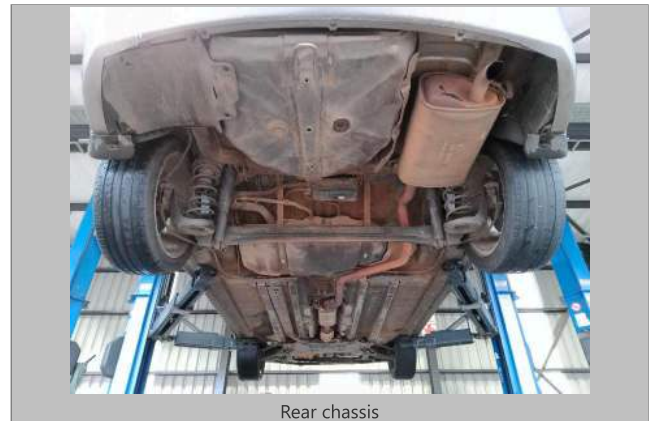

Rear chassis



Oil cap and dipstick



Switch Electrical Window Winder front right



Steering Wheel Trim



Door Sealing Rubber Front Right



Seat Rear



Seat Front Right



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Side Mirror Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Right



Tail Light Left



Rim Spare Wheel



Inner Boot Floor Pan and Spare Wheel Well



Rear Fender Left



Door Rear Left



C • Pillar Left



A • Pillar Left



Front Fender Left



Indicator Light Front Left



Door Front Left



B • Pillar Left



Seat Front Left



Door Sealing Rubber Rear Left



Front Bumper



Front Bumper



Bonnet



Fog Light Front Left



Headlight Left



Headlight Right



Water level



Sill Panel Right



Control Arm Bush(es) Front Axle Right



Rim Rear Right



Rim Rear Left



Rim Front Left



Engine Wiring



Tyre Front Right



Tyre Front Left



Tie Rod End left



Tie Rod End right



Air conditioner pipes



Radiator Cradle



Belly plates



Gearbox



Engine



Belly plates



Chassis



Silencer



Inner Boot Floor Pan and Spare Wheel Well



Tyre Rear Right



Tyre Rear Left



Engine to silencer pipe



Chassis




Water level



Cigarette Lighter



Air Conditioner

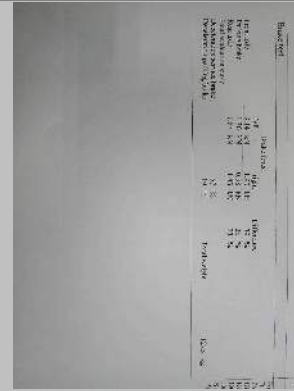

Service Brake Performance Front Axle

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41EMDU669971