



CONDITION REPORT

Report No: 2016886862

DATE
22/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/05/2025		M57 Pretoria Road - 1619
Inspection Date	22/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	KIA	Registration Number	JHY232MP
Model	PICANTO	Register Number	
VIN	KNAB3512LJT112947	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2019
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	37,910 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


VEHICLE INSPECTION

Damage

Repair Way

Windscreen Wiper Missing
Front Bumper Paintwork • Scratched
Front Fender Left Damaged
Windscreen Cracked

Replace
Repair
Repair
Replace

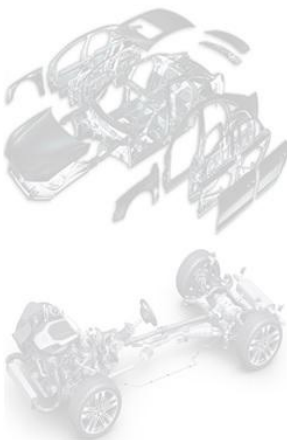

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT

Report No: 2016886862

 DATE
22/05/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.8	-	
Rear	1.4	1.5	-	
Emergency / Parking	1.2	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/55R15	86H	Nexen	Nblue	V	2617	5 mm
Front Right	185/55R15	86H	Nexen	Nblue	V	2617	3 mm
Rear Left	185/55R15	86H	Nexen	Nblue	V	2617	5 mm
Rear Right	185/55R15	86H	Nexen	Nblue	V	2617	6 mm
Spare	T115/70D16	90M	Maxxis	Temporary	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MOTOR DRIVEN POWER STEERING	C1102:16	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT


Report No: 2016886862

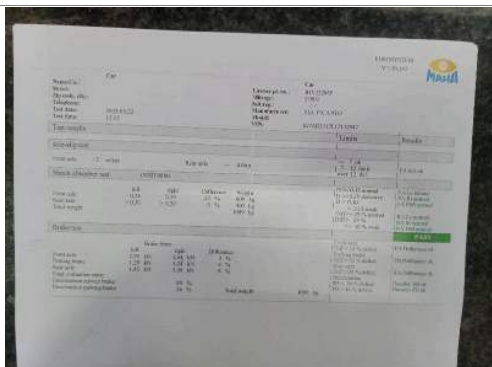DATE
22/05/2025

Shock and brake



Diagnostic test

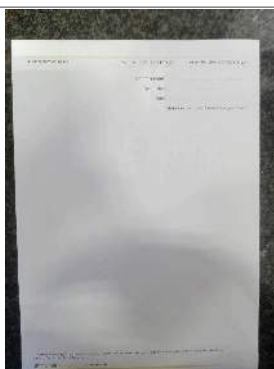

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT

Report No: 2016886862

DATE
22/05/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT


Report No: 2016886862

DATE
22/05/2025

90 DEGREE LEFT



LF TYRE TREAD

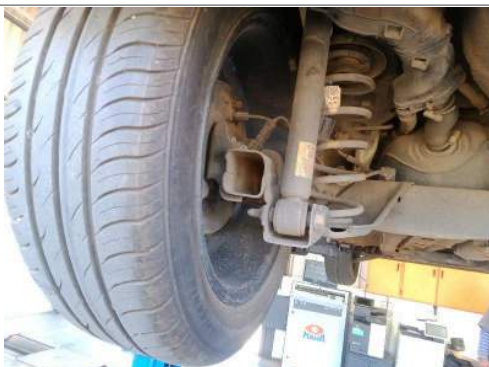

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT

Report No: 2016886862

DATE
22/05/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT

Report No: 2016886862

DATE
22/05/2025

Oil cap and dipstick




Steering adjustable lever dama



Coolant reservoir



L/F fender liner missing

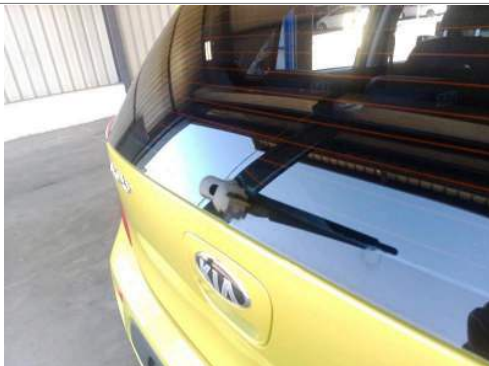

Windscreen Wiper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947



CONDITION REPORT

Report No: 2016886862

DATE
22/05/2025

Windscreen



Windscreen



Water level



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB3512LJT112947