



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/07/2025		M57 Pretoria Road - 1619
Inspection Date	24/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	KN04MWGP
Model	PICANTO 1.0 LS 5-DR [2015-2018]	Register Number	
VIN	KNABE511LHT427752	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	SILVER	Power / Displacement	
Year Model	2017	Paint Finish	M - METALLIC
Km Reading	249,046 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Caps Damaged	Replace
Battery clamps Defective	Replace
Air cleaner Damaged	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Door Handle Front Left Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Dented	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Split Pin Left Missing	Replace
Split Pin Right Missing	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Smooth	Replace
Spare Tyre Smooth	Replace
Rim Front Left Dented	Repair
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Rim Rear Right Dented	Repair
Main Beam Left Damaged	Replace
Radiator Cradle Damaged	Replace
Gear Selections Malfunction	Repair
Clutch Operation Incorrect	Replace
Both headlights are loose	Repair
foreign substance on oil caps	Repair
radiator is loose	Repair
Front tyre size differs	Replace
Rear tyre size differs	Replace
Some body panels misaligned	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.1	2.3	-	
Rear	0.7	0.7	-	
Emergency / Parking	1.1	1.1	-	



Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Duragrip	HD918	V	0124	2 mm
Front Right	165/60R14	75H	Tracmak	Privilo	V	2153	2 mm
Rear Left	175/65R14	82H	Powertrac	Adams	V	3124	0 mm
Rear Right	165/70R14	81S	MRF	ZVTS	V	4622	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels. Residual traces of poor repair on most body panels.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

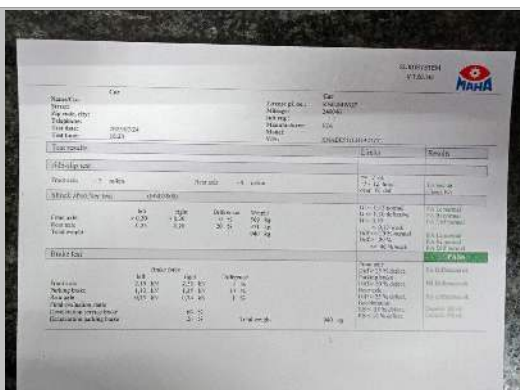

Shock and brake report



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1




ENGINE 2



CHASSIS



Rear end

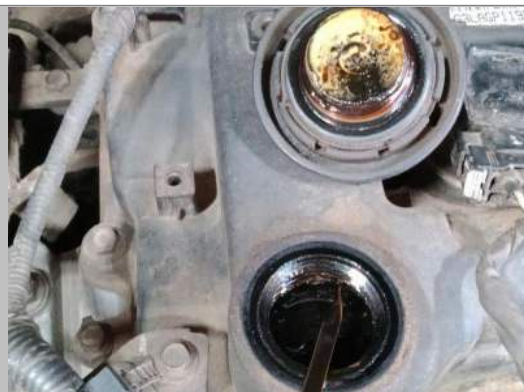

Oil cap and dipstick



Coolant reservoir



L/F fender liner missing



Seat Front Right



Front Fender Right



Rear Fender Right



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Spare Tyre



Rear Fender Left



Rear Fender Left



Door Rear Left



Door Front Left



Door Handle Front Left



Front Fender Left




Bonnet



Air cleaner



Caps

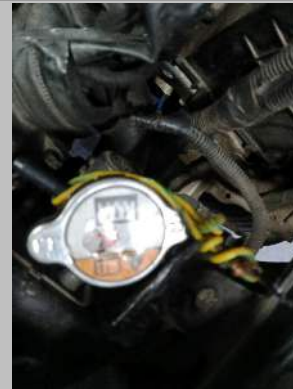

Engine Wiring



Battery clamps



Rim Front Right



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



Rim Front Left



Rim Front Left



Engine



Engine



Front Bumper



Front Bumper



Main Beam Left



Main Beam Left



Radiator Cradle



Split Pin Left



Split Pin Right




Tyre Rear Left



Rim Rear Left



Rim Rear Right

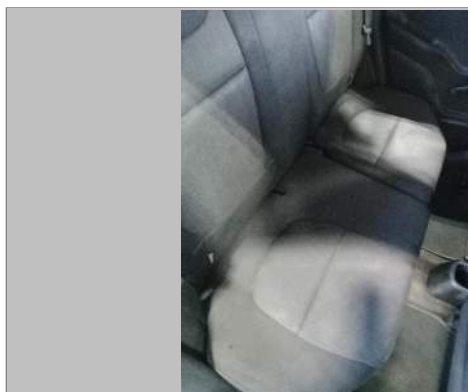

Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNABE511LHT427752