



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/04/2025		M57 Pretoria Road - 1619
Inspection Date	02/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	KIA	Registration Number	DX25XNGP
Model	RIO 1.4 5-DR [2015-2018]	Register Number	
VIN	KNADN512LF6564235	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2015	Paint Finish	TWO COAT UNI
Km Reading	182,026 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Wiring Defective	Repair
Switch Electrical Window Winder front right Damaged	Replace
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Cracked	Replace
Number Plate Light Left Damaged	Replace
Number Plate Light Right Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Defective	Repair
Dash Padding Defective	Repair
C • Pillar Right Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Damaged	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

Damage	Repair Way
Sill Panel Left Dented	Repair
Windscreen Chipped	Repair
Caliper 1. Axle right Sweat	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Shock Absorber Rear Right Leak	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Dented	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Chassis Dented	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Replace
Fuel Tank Dented	Repair
Engine Noise Excessive	Repair
Rear right shock absorber weak	Replace
Body and Exterior	Boot does not open
Vehicle electronics malfunctioning	Repair
Undercarriage	Vehicle undercarriage dirty
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Axle and suspension	Signs of vehicle grabbing
Tyres and rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.32	2.34	-	
Rear	1.85	2.3	-	
Emergency / Parking	1.2	0.53	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/45 R17	88W	Michelin	Pilot Sport	V	4717	1 mm
Front Right	205/50Z R17	93W	Wideway	Sport	V	2015	0 mm
Rear Left	205/50Z R17	91W	Silverstone	Sport	V	3918	0 mm
Rear Right	205/45Z R17	88W	Michelin	Pilot Sport	V	2318	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P2188	SYSTEM TOO RICH AT IDLE(BANK 1)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

[illegible]

Brake and shock absorber report

sidship test				
Item no.	5	mean	SD	1
Shock absorber	25	0.50000		
	left	right	7	Weight
Front axle	0.25	0.50	20 %	575 kg
Rear axle	0.50	0.50	33 %	59 kg
Total weight				634 kg

Baker test				
Static load				
	left	right	Difference	
Front axle	2.22 kN	2.24 kN	1 %	
Parking brake	1.20 kN	0.53 kN	55 %	
Rear axle	1.85 kN	2.20 kN	23 %	
Final restraint on door				
Disconnection service brake		33 %		
Disconnection parking brake		15 %		
			Total weight	Total kg

Shock absorber readings

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

90 DEGREE REAR



90 DEGREE LEFT



LR TYRE TREAD



LF TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235

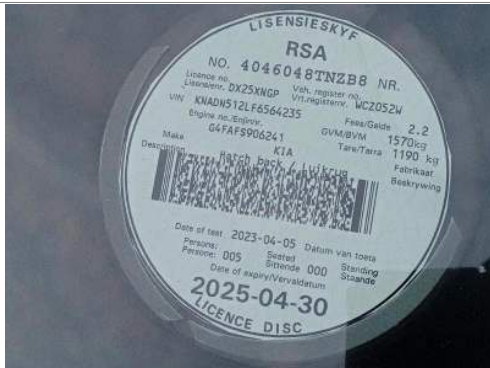

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear Chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025


Dash Padding



Seat Front Right




Seat Rear

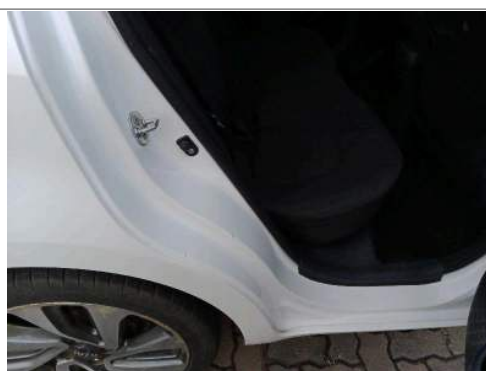

C • Pillar Right



Windscreen

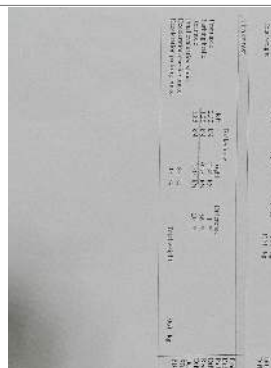

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

Headlight Right



Engine Wiring



Water level



Water level



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

Indicator Light Front Right



Front Fender Right



Tyre Front Right



Rim Front Right



Front Fender Right / Inner Tray



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

Rear Fender Right



Tyre Rear Right



Rim Rear Right



Bolt(s) / Nut(s) Rear Wheel Right



Number Plate Light Left



Number Plate Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT


Report No: 2016825494

DATE
02/04/2025

Rim Rear Left



Rear Fender Left

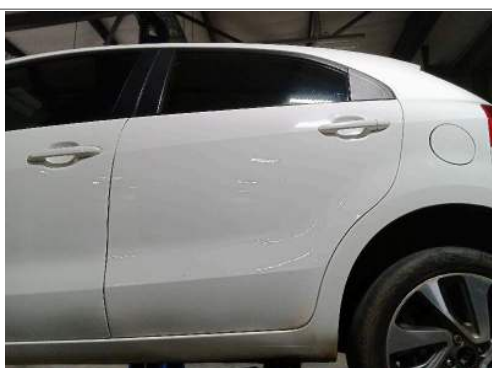

Door Rear Left



Sill Panel Left



Door Front Left



Indicator Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT


Report No: 2016825494

DATE
02/04/2025

Bolt(s) / Nut(s) Front Wheel Left



Rim Front Left

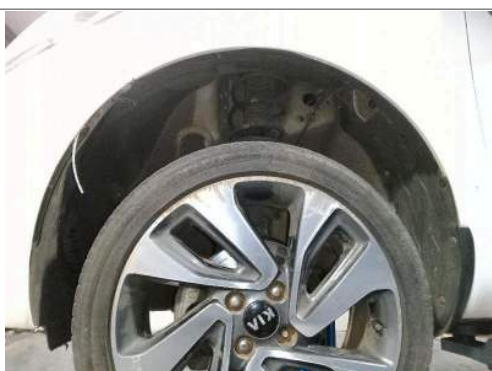

Front Fender Left / Inner Tray



Control Arm Bush(es) Front Axle Left



Tyre Front Right



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235



CONDITION REPORT

Report No: 2016825494

DATE
02/04/2025

Sub Frame



Chassis



Fuel Tank



Tyre Rear Left



Shock Absorber Rear Right



Caliper 1. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235

**CONDITION REPORT**

Report No: 2016825494

DATE
02/04/2025

Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6564235