



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	JJX551MP
Model	RIO 1.4 TEC 5-DR [2015-2018]	Register Number	
VIN	KNADN512LG6767023	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2020
Color	SILVER	Power / Displacement	
Year Model	2017	Paint Finish	M - METALLIC
Km Reading	59,208 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items****VEHICLE INSPECTION**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Damage	Repair Way
Seat Belt Rear Left Defective	Repair
Hood Lining Dirty	Repair
Side Mirror Left Broken	Replace
Side Mirror Right Broken	Replace
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Broken	Replace
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Roof Dented	Repair
Sealing Sun Roof Worn	Repair
Windscreen Chipped	Repair
Tyre Front Right Torn / Cut	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Worn	Replace
Rim Front Left Dented	Repair
Rim Rear Right Scratched	Repair
Sub Frame Scratched	Repair
Fuel Tank Deformed	Repair

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.6	2.7	-	-
Rear	1.7	1.7	-	-
Emergency / Parking	0.9	1.1	-	-

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/45ZR17	88W	Autogrip	Grip200	V	3618	1 mm
Front Right	205/45ZR17	88W	Autogrip	Grip200	V	3618	0 mm
Rear Left	205/45ZR17	88W	Continental	ContiSport	V	3215	0 mm
Rear Right	205/45ZR17	84W	Dunlop	SP Sport	V	1117	0 mm
Spare	205/45R17	88W	Continental	ContiSport	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023

**CONDITION REPORT**

Report No:
2016963143
DATE
30/07/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Vehicle Dirty
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Sunroof wind deflector worn. Signs of hail damage on some body panels. Minor dents, scratches and chip marks on various body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Clive Russon

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023




CONDITION REPORT

Report No:
2016963143
DATE
30/07/2025

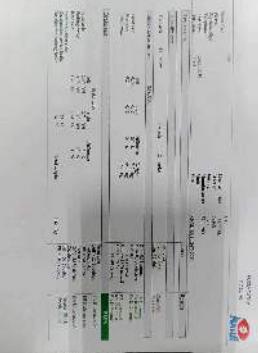

Brake test report

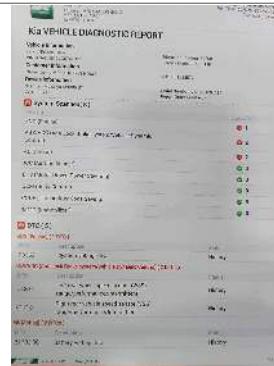

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



ENGINE 2



CHASSIS

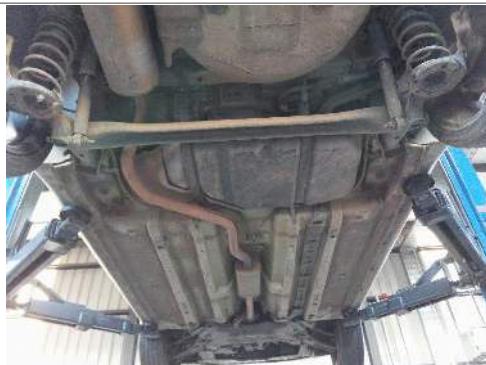

REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Coolant level



Oil cap and dipstick



ADDITIONAL 4



Spare Tyre



Hood Lining



Sealing Sun Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Seat Belt Rear Left



Tyre Front Right



Tyre Rear Left



Tyre Rear Left



Tyre Rear Right



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Tyre Rear Left



Rim Front Left



Front Fender Right / Inner Tray



Sub Frame



Fuel Tank



Rim Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Rim Front Left



Front Bumper



Front Bumper



Front Bumper



Front Fender Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Door Front Left



Door Front Left



Door Rear Left



Door Rear Left



Rear Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Door Rear Right



Door Rear Right



Side Mirror Right



Side Mirror Left



Side Mirror Left



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023



CONDITION REPORT



Report No:
2016963143
DATE
30/07/2025



Front Fender Right



Windscreen



Bonnet



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LG6767023