



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/02/2024		M57 Pretoria Road - 1619
Inspection Date	16/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	KIA	Registration Number	KW29WSGP
Model	SPORTAGE	Register Number	
VIN	KNAPC813SF7689996	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	203,232 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Switch Electrical Window Winder rear left Defective	Repair
Switch Electrical Window Winder rear right Defective	Repair
Interior Lights Defective	Replace
Fog Light Front Left Defective	Replace
Fog Light Rear Right Cracked	Replace
Wiring connections Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Caliper 1. Axle right Leak	Repair
Stabilizer Mounting Front Left Damaged	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Prop Shaft Damaged	Replace
CV Joint(s) Front Left (inner/outer) Damaged	Repair
CV Joint(s) Front Right (inner/outer) Damaged	Repair
Engine Smoke Excessive	Repair
Gear Selections Malfunction	Repair
Multiple warning signs illuminated.	Repair.
Signs of spray work done on some body panels.	
Some body panels misaligned.	
Automatic gear selection faulty.	
Minor dents scratches stone chips	on some body panels
Have to press the shift lock release button	to release button to select gears.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAPC813SF7689996

1 / 13



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	-
Rear	-	-	-	-
Emergency / Parking	-	-	-	-

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R18	98V	General	Grabber	V	1020	1 mm
Front Right	225/55R18	98V	General	Grabber	V	1020	1 mm
Rear Left	225/55R18	98H	Hankook	Optimo	V	3019	2 mm
Rear Right	225/55R18	98H	Hankook	Optimo	V	3019	2 mm
Spare	T155/90D16	110M	Maxxis	Temporary	V	///////	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0684	GLOW PLUG CONTROL MODULE TO PCM COMMUNICATION CIRC	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips on some body panels.
 Road Test: Automatic g

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 201629096


2 / 13

DATE


16/02/2024

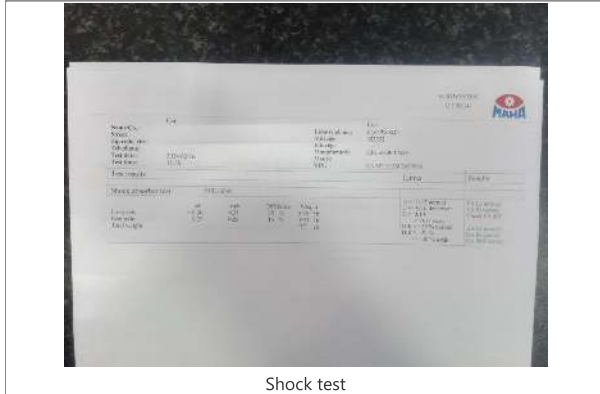


Shock test

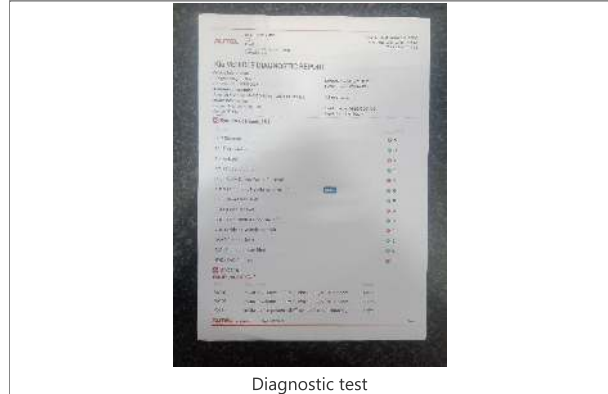

Diagnostic test

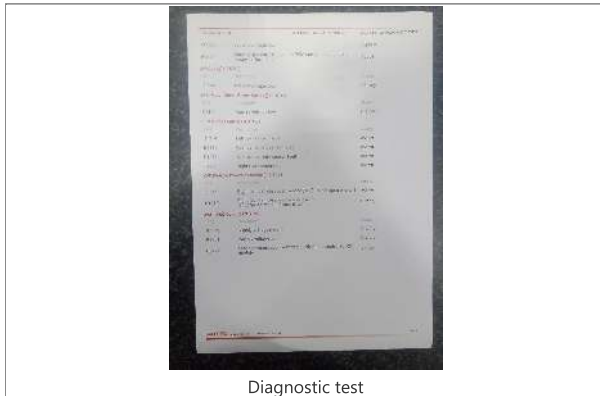

Diagnostic test

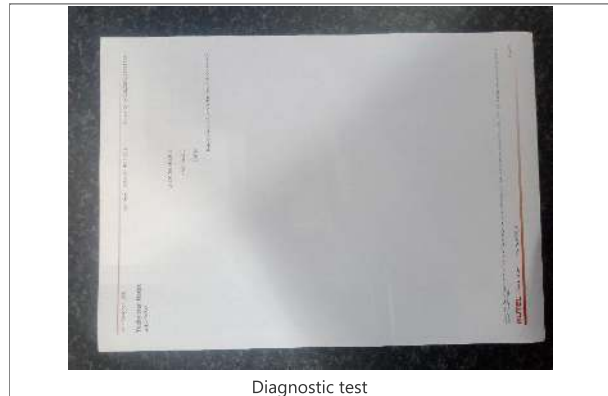

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

VIN: KNAPC813SF7689996

DATE

16/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE: 16/02/2024
VIN: KNAPC81357662804
4 / 13



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996


6 / 13



90 DEGREE LEFT



LF TYRE TREAD

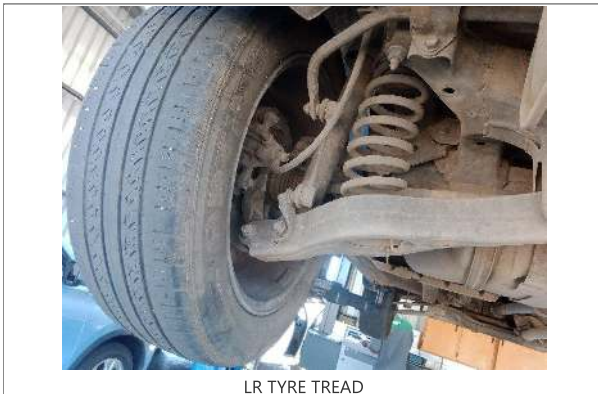

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996

7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Automatic.



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996

9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



Rear end



Coolant reservoir


VIN: KNAP013SF7689996
10 / 13




Oil cap and dipstick



Exhaust oil leak.

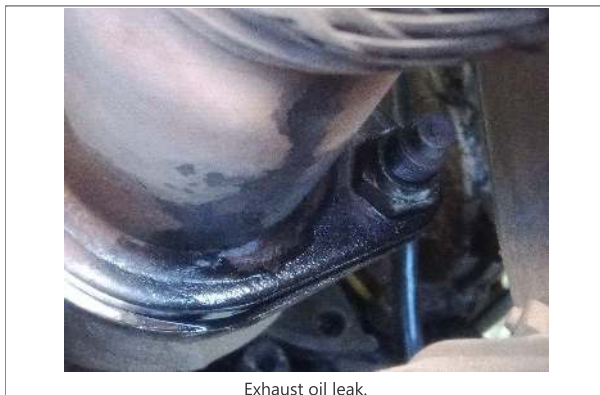

Exhaust oil leak.

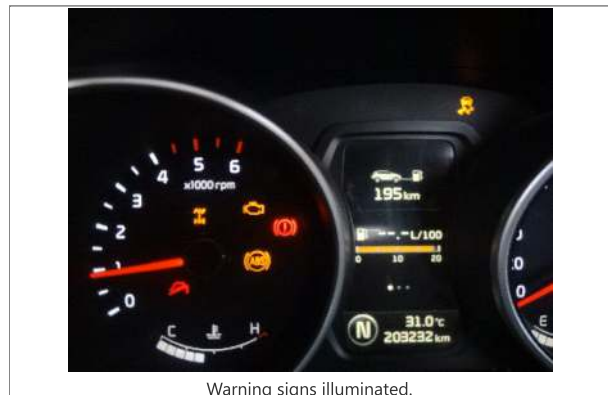

Warning signs illuminated.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



R/F fender liner missing.



L/F fender liner missing.

VIN: KNAPC813SF7689996
12 / 13



Water level



Bolt(s) / Nut(s) Front Wheel Right



Control Arm Bush(es) Front Axle Right



Ball Joint(s) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

VIN: KNAPC813SF7689996
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



Front Bumper



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Left



Stabilizer Mounting Front Left



Fog Light Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

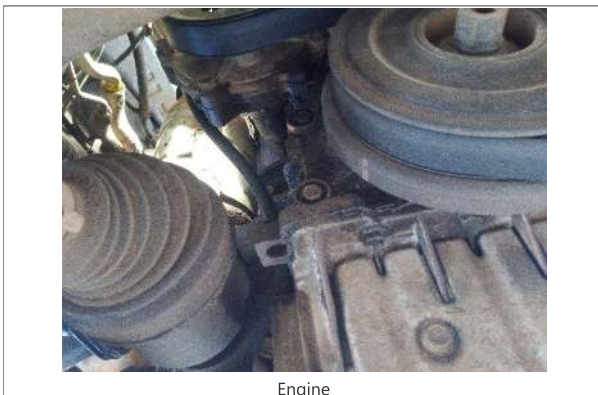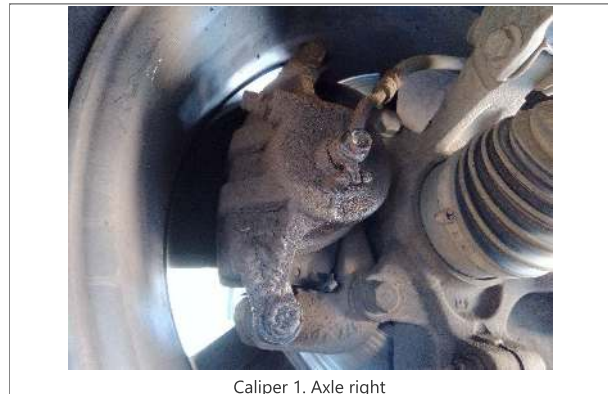

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024



Switch Electrical Window Winder rear left



Wiring connections



Boot Lid / Hatch door



Boot Lid / Hatch door



Fog Light Front Left



Interior Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

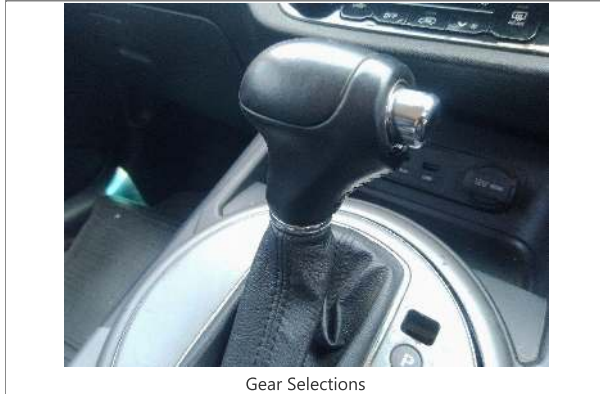



CONDITION REPORT

Report No: 2016270741

DATE
16/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za