



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/09/2024		M57 Pretoria Road - 1619
Inspection Date	26/09/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HAVAL	Registration Number	KDY591MP
Model	H1 1.5 VVT-I [2019-2022]	Register Number	
VIN	LGWED2A33LE621200	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2022
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT METALLIC
Km Reading	68,500 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

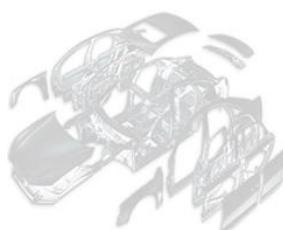

Damage	Repair Way
Center Console / Cubbyhole + Lid Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace





## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

### Brakes

#### Brake Test Results

	Left	Right	Axe Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	2.96	2.66	-	-
Rear	1.96	1.96	-	-
Emergency / Parking	1.09	0.87	-	-

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92H	Giti	Radial	V	4819	0 mm
Front Right	205/55R16	94W	Dunlop	Sp	V	2720	0 mm
Rear Left	205/60R16	92H	Giti	Radial	V	4019	0 mm
Rear Right	205/60R18	92H	Giti	Radial	V	4819	1 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of repair work done to somebody panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT


VIN: LGWED2A31H621200

Report No.: 2016546840


2 / 8

DATE

26/09/2024

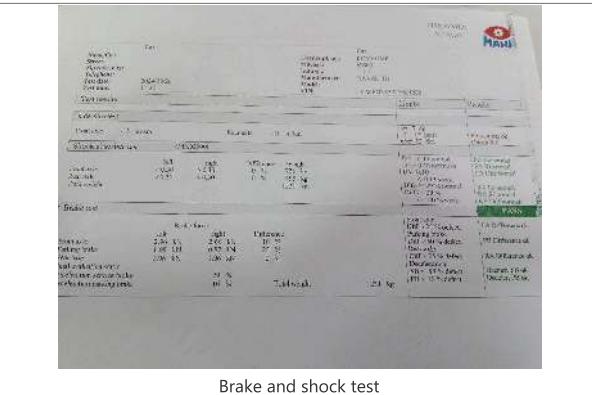

Brake and shock test

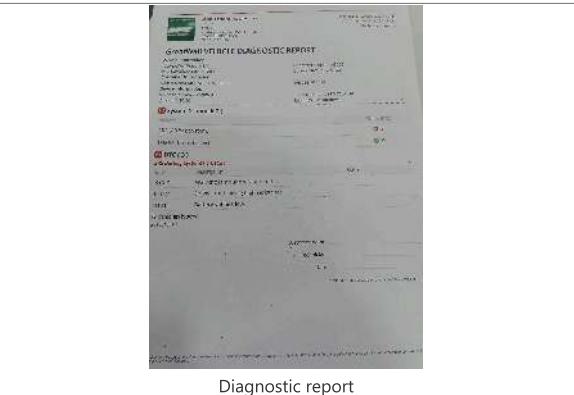

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



**CONDITION REPORT****Report No:** 2016546840

VIN: LGWED2A33LE621200

**DATE**

26/09/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016546840

DATE

VIN: LGWED2A33LE621200

26/09/2024

4 / 8



ODOMETER



manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



## CONDITION REPORT

Report No: 2016546840

DATE

26/09/2024

VIN: LGWED2A33LE621200

5 / 8

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

VIN: LGWED2A33LE621200

6 / 8




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

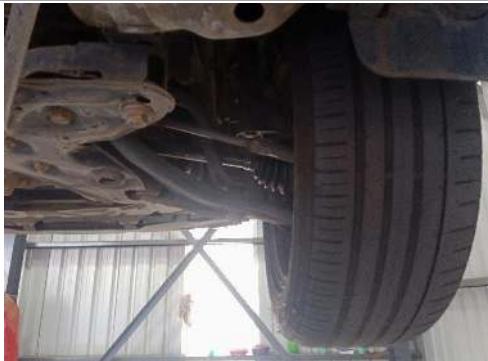

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

VIN: LGWED2A33LE621200

7 / 8



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

ENGINE 1



undercarriage front.



undercarriage rear.



oil cap and dipstick.



Water level



Front Bumper



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

Front Bumper



Bonnet



Door Rear Left



Rear bumper



Rear bumper



Center Console / Cubbyhole + Lid

**CONDITION REPORT**

Report No: 2016546840

DATE  
26/09/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016546840

DATE  
26/09/2024

Tyre Rear Left



Tyre Front Left



Tyre Front Right



Windscreen

**CONDITION REPORT**

Report No: 2016546840

DATE

26/09/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)