



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2025		M57 Pretoria Road - 1619
Inspection Date	06/05/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HAVAL	Registration Number	FKN173L
Model	H6 C 2.0T LUXURY DCT [2017-2022]	Register Number	
VIN	LGWEF6A52LH908559	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	82,294 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

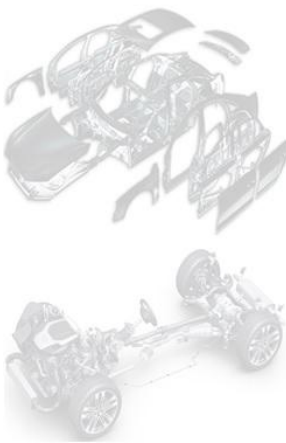

Damage	Repair Way
Engine Oil Leak	Repair
Battery box Corrosion	Repair
Central Air Vent Damaged	Replace
Indicator Light Front Left Missing	Replace
Indicator Light Rear Left Defective	Repair
Park Light Front Left Missing	Replace
Hood Lining Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Gearbox Defective	Repair
Warning light illuminated on dashboard	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

Damage

Undercarriage
Body and Exterior

Repair Way

Bottom of engine and gearbox fully covered
Minor dents and scratches on some body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55 R19	99V	Maxtrek	Sierra	V	1322	3 mm
Front Right	225/55 R19	99V	Maxtrek	Sierra	V	1322	2 mm
Rear Left	225/55 R19	99H	Kumho	Crugen	V	5320	3 mm
Rear Right	225/55 R19	99V	Rapid	EcoSport	V	0923	4 mm
Spare	T155/90 R18	113M	Cooper	Temporary	V	4518	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM(ENGINE CONTROL MODULE)	U110116	CAN MODULE INPUT VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

Automatic Transmission



Spare wheel and Accessories




Oil cap and dipstick



Front chassis



Rear chassis

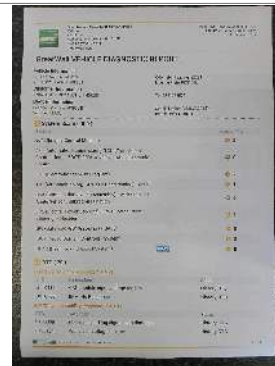

Diagnostic report page 1


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559




CONDITION REPORT

Report No: 2016865978

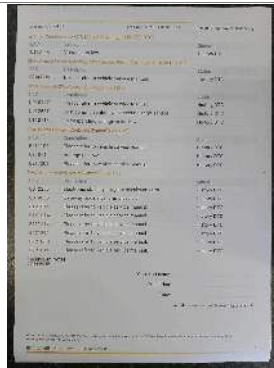DATE
06/05/2025

Diagnostic report page 2

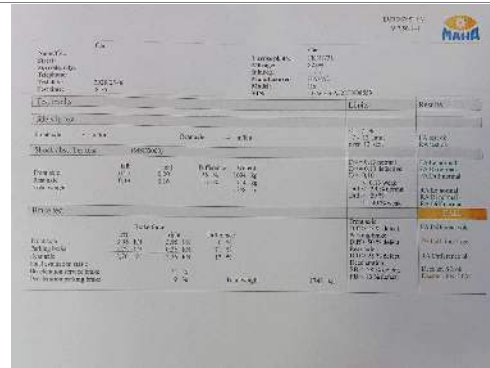

Brake and shock absorber report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT


Report No: 2016865978

DATE
06/05/2025

LR TYRE TREAD




RR TYRE TREAD

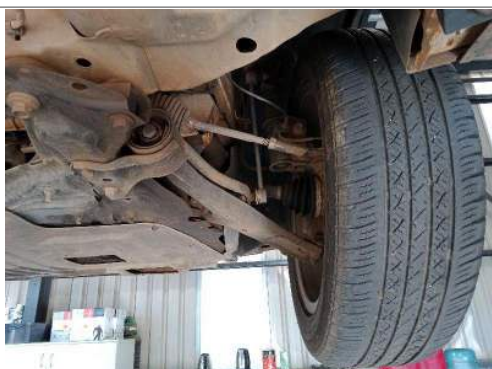

RF TYRE TREAD



LICENSE DISC

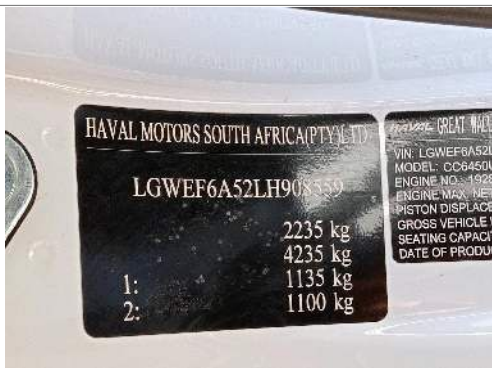

VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

Hood Lining



Windscreen



Door Rear Left



Rear bumper



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

Front Fender Right



Parking Brake Performance



Indicator Light Front Left



Park Light Front Left



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025


Bonnet



Water level



Battery box

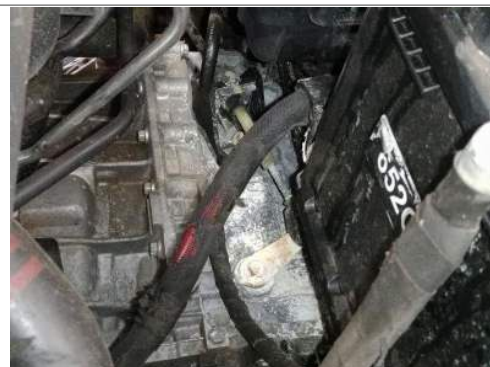

Gearbox



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559



CONDITION REPORT

Report No: 2016865978

DATE
06/05/2025

Gearbox



Engine



Water level



Indicator Light Rear Left



Central Air Vent

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEF6A52LH908559