

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	03/03/2025		M57 Pretoria Road - 1619
Inspection Date	03/03/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	CHERY	Registration Number	KX90WDGP
Model	TIGGO 4 PRO 1.5T ELITE CVT [2021-ON]	Register Number	
VIN	LVVDB21B5ND262299	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2024
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	37,006 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Heater control Damaged	Replace
Air Conditioner Damaged	Replace
Boot Carpet Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Smart Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Warning lights illuminated on dashboard	Repair
Undercarriage	Bottom of engine and gearbox covered
Undercarriage	Vehicle undercarriage dirty
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5ND262299

1 / 10

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.68	3.71	-	
Rear	2.62	2.94	-	
Emergency / Parking	1.51	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60 R17	96H	Citi	Comfort	V	2122	3 mm
Front Right	215/60 R17	96H	Citi	Comfort	V	2422	3 mm
Rear Left	215/60 R17	96H	Citi	Comfort	V	2222	3 mm
Rear Right	215/60 R17	96H	Citi	Comfort	V	2422	3 mm
Spare	T125/80 R17	99M	Linglong	Temporary	V	2822	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM(ENGINE SYSTEM)- EMS(ENGINE MANAGEMENT SYSTEM	U016487	LOST COMMUNICATION WITH A/C CONTROLLER	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Automatic Transmission

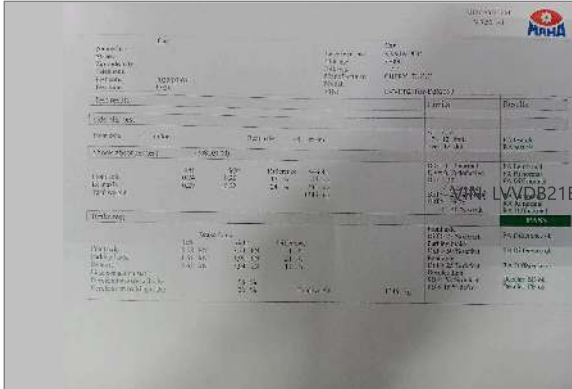


Brake and shock absorber report

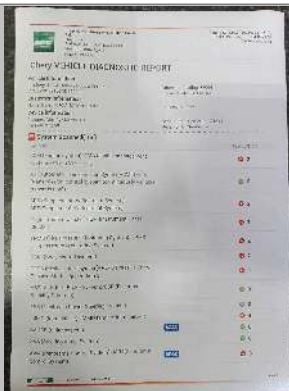

Diagnostic report page 1



Diagnostic report page 2

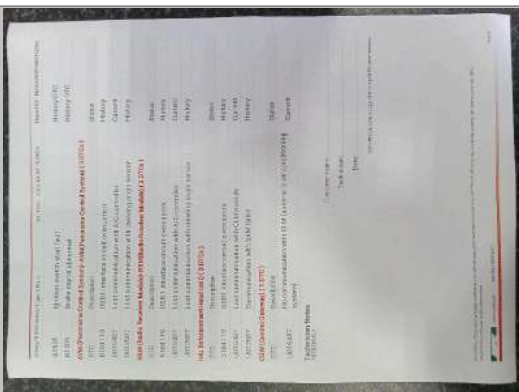

Diagnostic report page 3



Oil cap and dipstick

VIN: LVVDB21B5ND262299

3 / 10



Spare wheel and Accessories



Front chassis



Rear chassis



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

VIN: LVVDB21B5ND262299

5 / 10



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: LVVD821B5ND262299

6 / 10

VIN: LVVDB21B5ND262299

7 / 10



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

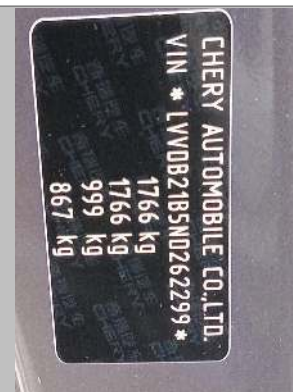

VIN PLATE OR STICKER



ENGINE 1



Heater control



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper

VIN: LVVDB21B5ND262299

10 / 10



Front Bumper



Bonnet



Side Mirror Left



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Boot Carpet



Roof



Air Conditioner



Water level



Water level



CONDITION REPORT

Report No: 2016785801

DATE
03/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za