



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/07/2025		M57 Pretoria Road - 1619
Inspection Date	21/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	MAHINDRA	Registration Number	KW92SHGP
Model	TUV 300 1.5 MHAWK T8 DSL [2017-2022]	Register Number	
VIN	MA1NA2WEXL6080562	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	RED	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	103,276 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Switch Electrical Window Winder front right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tyre Front Right Smooth	Replace
Spare Tyre Smooth	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	3.1	-	
Rear	2.4	2.2	-	
Emergency / Parking	2.2	2.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/75R15	100T	Royal black	Royal a/t	V	4621	2 mm
Front Right	215R15	109/107S	Autogrip	Blazer	V	1317	0 mm
Rear Left	215/75R15	100S	Hifly	All terrain	V	3321	5 mm
Rear Right	215/75R15	100S	Ceat	Czar h/t	V	4519	4 mm
Spare	215R15	109/107S	Autogrip	Blazer	V	1417	0 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	U170100	LIN ERROR	CURRENT

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



General Information		Physical Properties		Chemical Analysis		Biological Data	
Item	Value	Item	Value	Item	Value	Item	Value
1. Name	Sample 1234	3. Color	White	5. pH	7.2	7. Growth	100%
2. Date	2023-10-27	4. Odor	None	6. Conductivity	150 $\mu S/cm$	8. Viability	95%
3. Location	Lab 101	5. Solubility	High	7. Titration	0.1M	9. Motility	Yes
4. Operator	J. Doe	6. Viscosity	Low	8. Spectroscopy	254nm	10. Spores	1000
5. Instrument	Model X	7. Stability	Good	9. Microscopy	1000x	11. Bioassay	50%
6. Reagents	Reagent A	8. Storage	4°C	10. PCR	Yes	12. Sequencing	100%
7. Results	Pass	9. Notes	Sample OK	11. Gel Electrophoresis	Yes	13. Western Blot	Yes
8. Conclusion	Sample meets criteria	10. Signatures	[Signatures]	12. Mass Spec	Yes	14. Protein Expr	Yes

Shock and brake report

[illegible]

Diagnostic report

[illegible]

Diagnostic report

[illegible]

Diagnostic report



Spare wheel



Expention bottle



Oil cap and dipstick



Manual



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Switch Electrical Window Winder front right



Windscreen



Water level



Spare Tyre



Door Rear Right




Door Front Right



Front Fender Right



Front Bumper

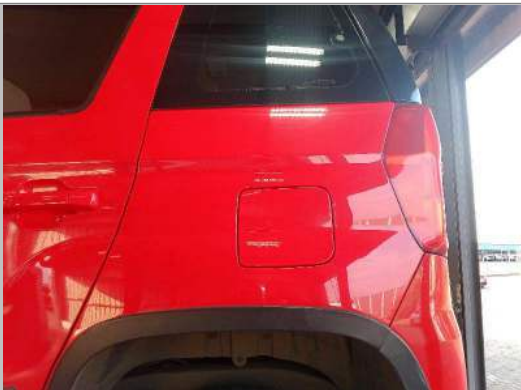

Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NA2WEXL6080562